



ARBORICULTURAL IMPACT ASSESSMENT REPORT

Prepared for Rob & Sheridan Belgiovanne

Site address

28 Delecta Avenue Clareville

<u>Prepared by</u> David Gowenlock AQF5

(Director of Seasoned Tree Consulting)

Address PO BOX 3044

Asquith NSW 2077

Mobile 0415 961 074

Email david@seasonedtreeconsulting.com.au

ABN 73 606 422 351

Date 27 October 2022

Table of Contents

1.	Introduction	3
2.	SCOPE OF THE REPORT	
3.	LIMITATIONS	
4.	METHODOLOGY	
5.	SITE LOCATION AND BRIEF DESCRIPTION OF PROPOSAL	6
6.	OBSERVATIONS AND GENERAL INFORMATION IN RELATION TO PROTECTING TREES OF	N
DEVE	LOPMENT SITES	
7.	ASSESSEMENT OF CONSTRUCTION IMPACTS	<u>e</u>
8.	CONCLUSIONS	11
9.	Photographs	12
10.	RECOMMENDATIONS	16
11.	ARBORICULTURAL WORK METHOD STATEMENT (AMS) AND TREE PROTECTION	
REQU	IREMENTS	17
12.	HOLD POINTS	22
13.	BIBLIOGRAPHY/REFERENCES	23
Appe	NDIX 1 — EXISTING SITE/ TREE LOCATION PLAN	25
Appe	NDIX 1A- PROPOSED SITE PLAN AND TREE PROTECTION PLAN	26
APPE	ENDIX 2- Tree Inspection Schedule	27

LIST OF OTHER APPENDICES

Appendix 3 – Tree Health

Appendix 4 – Tree Protection Zone

Appendix 5 – Structural Root Zone

Appendix 6 - Amenity Value

Appendix 7 – Age Class

Appendix 8 – Structural Condition

Appendix 9 – SULE Categories

Appendix 10 – Trees AZ

1. INTRODUCTION

1.1 This report has been commissioned by Rob & Sheridan Belgiovanne to provide an Arboricultural Impact Assessment Report in relation to trees located on or close to the site that may be affected by a proposed development.

TABLE 1: DOCUMENTS PROVIDED FOR THE ASSESSMENT

Title	Author	Date	Reference on document
Proposed Alterations and Addtions	Gerald Gilchrist + Associates Pty Ltd	30 May 2022	<u>-</u>
Survey Plan	DP Surveying	19 Jan 2022	-

- 1.2 A single site inspection was carried out for the purpose of this assessment on 25th October 2022. The site inspection was undertaken to collect tree and site data.
- 1.3 The weather during the site inspection was sunny with good visibility.

2. SCOPE OF THE REPORT

- 2.1 This report has been undertaken to meet the following objectives.
- 2.2 Conduct a visual assessment from ground level of multiple trees located close to proposed works on the site.
- 2.3 Determine the trees estimated contributing years, remaining useful life expectancy and award the trees a retention value.
- 2.4 Provide an assessment of the potential impact the proposed development is likely to have on the condition of the subject trees in accordance with AS4970 Protection of trees on development sites (2009).
- 2.5 Recommend methods to mitigate development impacts where appropriate.
- 2.6 Recommend pragmatic tree protection measures for any tree to be retained in accordance with AS4970 Protection of Trees on Development Sites 2009.

3. LIMITATIONS

- 3.1 Observations and recommendations are based on the single site inspection. The findings of this report are based on the observations and site conditions at the time inspection.
- 3.2 All observations were carried out from ground level. No detailed additional testing was carried out on trees or soil on site and none of the surrounding surfaces were lifted for investigation.
- 3.3 Root decay can sometimes be present with no visual indication above ground. It is also impossible to know the extent of any root damage caused by mechanical damage such as underground root cutting during the installation of services without undertaking detailed root investigation. Any form of tree failure due to these activities is beyond the scope of this assessment.
- 3.4 The report reflects the subject tree(s) as found on the day of inspection. Any changes to the growing environment of the subject tree, or tree management works beyond those recommended in this report may alter the findings of the report. There is no warranty, expressed or implied, that problems or deficiencies relating to the subject tree, or subject site may not arise in the future.
- 3.5 Tree identification is based on accessible visual characteristics at the time of inspection. As key identifying features are not always available the accuracy of identification is not guaranteed. Where tree species is unknown, it is indicated with a spp.
- 3.6 All diagrams, plans and photographs included in this report are visual aids only and are not to scale unless otherwise indicated.
- 3.7 Seasoned Tree Consulting neither guarantees, nor is responsible for, the accuracy of information provided by others that is contained within this report.
- 3.8 While an assessment of the subject trees estimated useful life expectancy is included in this report, no specific tree risk assessment has been undertaken for any of trees at the site.
- 3.9 Where trees are stated as retainable under the current proposal, this will only become a reality if all recommendations and specifications are followed exactly.
- 3.10 The ultimate safety of any tree cannot be categorically guaranteed. Even trees apparently free of defects can collapse or partially collapse in extreme weather conditions. Trees are dynamic, biological entities subject to changes in their environment, the presence of pathogens and the effects of ageing. These factors reinforce the need for regular inspections. It is generally accepted that hazards can only be identified from distinct defects or from other failure-prone characteristics of a tree or its locality.
- 3.11 Alteration of this report invalidates the entire report.

4. METHODOLOGY

- 4.1 The following information was collected during the assessment of the subject tree(s).
- 4.2 Tree common name
- 4.3 Tree botanical name
- 4.4 Tree age class
- 4.5 DBH (Trunk/Stem diameter at breast height/1.4m above ground level) millimetres.
- 4.6 Estimated height metres
- 4.7 Estimated crown spread (Radius of crown) metres
- 4.8 Health
- 4.9 Structural condition
- 4.10 Amenity value
- 4.11 Estimated remaining contribution years (SULE)¹
- 4.12 Retention value (Tree AZ)²
- 4.13 Notes/comments
- 4.14 An assessment of the trees condition was made using the visual tree assessment (VTA) model (Mattheck & Breloer, 1994).³
- 4.15 Tree diameter was measured using a DBH tape or in some cases estimated. All other measurements were estimations unless otherwise stated. The other tools I used during the assessment were a digital camera and a Leica DistoD410 digital laser tape.
- 4.16 All DBH measurements, tree protection zones, and structural root zones were calculated in accordance with methods set out in AS4970 Protection of trees on development sites (2009) ⁴ and in some cases estimated. See appendices for information.
- 4.17 Details of how the observations in this report have been assessed are listed in the appendices.

¹ Barrell Tree Consultancy, SULE: Its use and status into the New Millennium, TreeAZ/03/2001, http://www.treeaz.com/.

² Barrell Tree Consultancy, *Tree AZ version 10.10-ANZ*, http://www.treeaz.com/.

³ Mattheck, C. & Breloer, H., *The body language of trees - A handbook for failure analysis*, The Stationary Office, London, England (1994).

⁴ Council of Standards Australia, AS4970 Protection of trees on development sites (2009).

5. SITE LOCATION AND BRIEF DESCRIPTION OF PROPOSAL

- 5.1 The site is located in the suburb of Clareville in the Northern Beaches Council LGA. This assessment has been carried out in accordance with the following documents and legislation;
 - 5.1.1 Pittwater Local Environmental Plan 2014
 - 5.1.2 Pittwater (DCP) 21
 - 5.1.3 SEPP (Biodiversity and Conservation) 2021
- 5.2 The site is zoned C4: Environmental Living and is approx 902 sqm in size. The site has an existing house, garage and pool. The site is not located within a Heritage Conservation Area. The site is not mapped as containing Pittwater and Wagstaffe Spotted Gum Forest in the Sydney Basin Bioregion⁵. The site is not located within mapped bushfire prone land. Only trees immediately surrounding the existing dwelling have been assessed.
- 5.3 The proposal consists of the removal of the existing garage & replacement with a new garage & studio set back further from the road. The existing & new structure is on concrete slab, framed & clad with sheeting & a custom orb roof. There are additional alterations and additions to the main house.

Tile 1: Site location6



⁵ https://geo.seed.nsw.gov.au/Public_Viewer/index.html?viewer=Public_Viewer&locale=en-AU

6

⁶https://maps.six.nsw.gov.au/

6. OBSERVATIONS AND GENERAL INFORMATION IN RELATION TO PROTECTING TREES ON DEVELOPMENT SITES

- 6.1 **Tree information**: Details of each individual tree assessed, including the observations taken during the site inspection can be found in the tree inspection schedule in appendix 2, where the indicative tree protection zone (TPZ) for the subject trees has been calculated. The TPZ and SRZ should be measured in radius from the centre of the trunk. Trees have been awarded a retention value based on site observations. The system used to award the retention value is Tree AZ. Tree AZ is used to identify higher value trees worthy of being a constraint to development and lower value trees that should generally not be a constraint to the development. A field sheet of Tree AZ categories sheet (Barrell Tree Consultancy) has been included at the end of the report to assist with understanding the retention values. The retention value that has been allocated to the subject trees in this report is not definitive and should only be used as a guideline.
- 6.2 **Site plans:** Appendix 1 contains an existing site plan identifying tree locations and an overlay of the indicative TPZ and SRZ of each tree. Appendix 1A contains the proposed site plans and calculated encroachments Appendix 1B contains a tree protection plan.
- 6.3 Tree protection zone (TPZ): The TPZ is principle means of protecting trees on development sites and is an area required to maintain the viability of trees during development. It is commonly observed that tree roots will extend significantly further than the indicative TPZ, however the TPZ is an area identified AS4970-2009 to be the extent where root loss or disturbance will generally impact the viability of the tree. The TPZ is identified as a restricted area to prevent damage to trees either above or below ground during a development. Where trees are intended to be retained proposed developments must provide an adequate TPZ around trees. The TPZ is set aside for the tree's root zone, trunk and crown and it is essential for the stability and longevity of the tree. The tree protection also incorporates the SRZ (see below for more information about the SRZ). The TPZ of palms, other monocots, cycads and tree ferns has been calculated at one metre outside the crown projection. Appendix 4 contains additional information about the TPZ including information about calculating the TPZ and examples of TPZ encroachment.
- 6.4 **Structural Root Zone (SRZ)**: This is the area around the base of a tree required for the trees stability in the ground. An area larger than the SRZ always needs to be maintained to preserve a viable tree. There are several factors that can vary the SRZ which include height, crown area, soil type and soil moisture. It can also be influenced by other factors such as natural or built structures. Generally work within the SRZ should be avoided. Soil level changes should also generally be avoided inside the SRZ of trees to be retained. Palms, other monocots, cycads and tree ferns do not have an SRZ. See appendix 5 for more information about the SRZ.

- 6.5 **Minor encroachment into TPZ**: Sometimes encroachment into the TPZ is unavoidable. Encroachment includes but is not limited to activities such as excavation, compacted fill and machine trenching. Minor encroachment of up to 10% of the overall TPZ area is normally considered acceptable, providing there is space adjacent to the TPZ for the tree to compensate <u>and</u> the tree is displaying adequate vigour/health to tolerate changes to its growing environment.
- 6.6 Major encroachment into TPZ: Where encroachment of more than 10% of the overall TPZ area is proposed an Arborist must investigate and demonstrate that the tree will remain in a viable condition. In some cases, tree sensitive construction methods such as pier and beam footings, suspended slabs, or cantilevered sections, can be utilised to allow additional encroachment into the TPZ by bridging over roots and minimising root disturbance. Major encroachment is only possible if it can be undertaken without severing significant size roots, or if it can be demonstrated that significant roots will not be impacted.



7. ASSESSEMENT OF CONSTRUCTION IMPACTS

7.1 **Table 2:** The table below contains a summary of the impact of proposed development impact to all trees included in the assessment.

Tree ID	Common name	Retentio n value	TPZ radiu s (m)	SRZ Radius (m)	TPZ Area (sq m)	TPZ Encroach ment See Appendix	Discussion/ Conclusion	Recommendatio n
						1A		
1	Black bean	A 2	7.08	2.8	157.5	Major	The tree is located close to the existing driveway. The tree will be subject to a major encroachment from proposed plans of a driveway extension and demolition and rebuild of the garage within the TPZ of the tree (calculated at 19.5sqm = 12.4%). However, section 3.3.4 of AS4970-2009 discusses that the presence of existing or past structures or obstacles affecting root growth should be considered when assessing the impact of TPZ and SRZ encroachments. There is a solid besser block wall running along the Delecta Avenue boundary line. The wall appears solid and does not have any cracks and does not appear to be disturbed at all. The footings and besser block wall are highly likely to have restricted root growth to be outside of the property boundary, therefore any development works within the footprint of the existing subject property will not impact the tree's root system. This is on the proviso the demolition of existing structures and then construction of proposed is well supervised and managed by a project arborist. The additional triangular piece of driveway crossover is deemed to be low impact due to a maximum of 150mm of excavation and new slab expected. No canopy pruning shall be required to accommodate the redesigned garage.	Retain and protect.
2	Swamp mahogany	A2	7.2	2.7	162.9	Nil	Tree located outside of the construction area and will not be subject to TPZ encroachment.	Retain and protect.
3	шаподану	AZ.	1.2	2.1	102.9	Minor	Tree is located within the footprint of the new deck area and is required to be removed.	Remove/ Transplant.
	Frangipani	Z 3	-	-	-		The is exempt from requiring council permission for removal. This species transplants well and could be reused within the site if desired.	



Tree ID	Common name	Retentio n value	TPZ radiu s (m)	SRZ Radius (m)	TPZ Area (sq m)	TPZ Encroach ment See Appendix 1A	Discussion/ Conclusion	Recommendatio n
4	Cheese tree	A2	8.4	3	221.7	Minor	Tree is located along the southern boundary fence line and is shared with the neighbours. There is no ground work encroachment from proposed plans. Second floor addition will create at maximum of a 1.0m higher roof line, which appears to be below the lowest branch that hangs across the roof. There is still likely to be minor pruning required to be carried out. The pruning must be undertaken by a qualified AQF3 Arborist. The level of encroachment is considered to be of low impact to the tree, and with high quality Project Arborist supervision employed during demolition and construction the tree will be able to be retained in a viable condition.	Retain and protect.
5	2 x Riberry	Z 2	3	1.8	28.3	Minor	Tree is located along the southern boundary fence line and is shared with the neighbours. There is no ground work encroachment from proposed plans. Second floor replacement works will be of a similar roof height. There is likely to be minor pruning required to be carried out. The pruning must be undertaken by a qualified AQF3 Arborist. The level of encroachment is considered to be of low impact to the tree, and with high quality Project Arborist supervision employed during demolition and construction the tree will be able to be retained in a viable condition.	Retain and protect.
6	Jacaranda	A1	7.2	2.7	162.9	Nil	Tree located outside of the construction area and will not be subject to TPZ encroachment.	Retain and protect.



8. CONCLUSIONS

8.1 **Table 3:** Summary of the impact to trees during the development;

Impact	Reason		
		Α	Z
Trees to be removed	Building construction, new surfacing and/or proximity, trees in poor condition, or the creation of an APZ	None	T3 (1 tree)
Retained trees that will be subject to TPZ encroachment	Removal of existing surfacing/structures and/or installation of new surfacing/structures	T1, T4 (2 trees)	T5 (1 tree)
Trees to be retained that will not be subject to TPZ encroachment	Space for development	T2, T6 (2 trees)	None
Trees requiring further investigation (Root Mapping)	Soil characteristics, topography and level changes within the TPZ	None	None

9. PHOTOGRAPHS





Image c:



Image d:

Т3

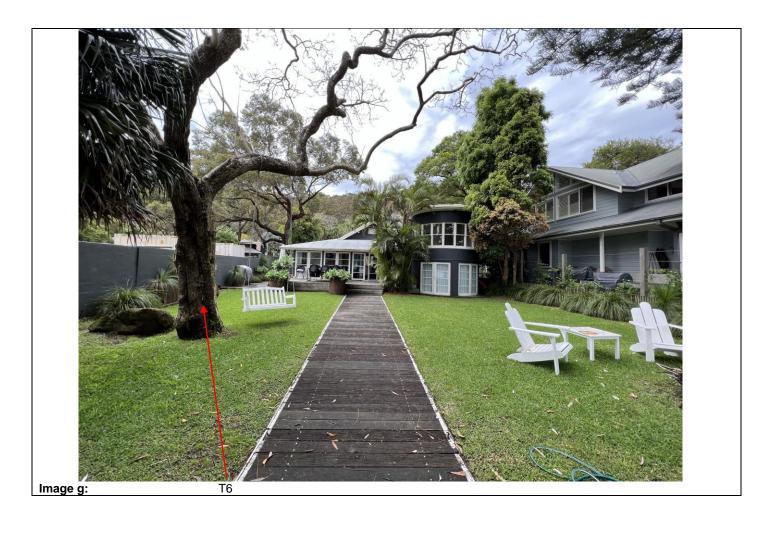


Image e: T4



Image f:

T5 (x 2)





10. RECOMMENDATIONS

- 10.1 This report assesses the impact of a proposed development at the site on **6 trees** located on the site in accordance with AS4970 Protection of trees on development sites (2009).
- 10.2 For the construction of the proposed development it is recommended that **Tree 3** (total of 1 tree) be removed or transplanted non the site. The tree is exempt from requiring removal/ transplant permission.
- 10.3 It is recommended that Trees numbered 1, 2, 4, 5 and 6 (total of 5 trees) be retained and protected.
- 10.4 Tree protection measures are required to be installed on Trees numbered 1, 2, 4, 5 and 6 (total of 5 trees).
- 10.5 The demolition and then construction of the proposed wall and driveway extension close to the SRZ of T2 must be undertaken under strict project arborist supervision.
- 10.6 It is recommended that all proposed landscaping works within the TPZ and SRZ of any retained tree must be carried out under management advice and supervision from the Project Arborist. Level changes must be sympathetic and very limited above (max 100mm) or below (max 100mm) existing natural ground levels.
- 10.7 Where possible underground services should be located outside the TPZ of trees to be retained. All underground services located inside the TPZ of any retained tree must be installed via tree sensitive techniques.

 This should include either directional drilling methods or manual/ hydro vacuum excavations, with any tree root over 30mm in diameter to be retained and not harmed.
- 10.8 All tree removal and pruning works are to be undertaken by a minimum AQF Level 3 qualified Arborist.
- 10.9 This report does not provide approval for tree removal or pruning works. All recommendations in this report are subject to approval by the relevant authorities and/or tree owners. This report should be submitted as supporting evidence with any tree removal/pruning or development application.
- 10.10 All construction activity is to comply with Australian Standard AS4970 Protection of Trees on Development Sites (2009), sections 7, 11 and 12 of this report.

11. ARBORICULTURAL WORK METHOD STATEMENT (AMS) AND TREE PROTECTION REQUIREMENTS

- 11.1 Use of this report: All contractors must be made aware of the tree protection requirements prior to commencing works at the site and be provided a copy of this report.
- 11.2 **Project Arborist:** Prior to any works commencing at the site a project Arborist should be appointed. The project Arborist should be qualified to a minimum AQF level 5 and/or equivalent qualifications and experience and should assist with any development issues relating to trees that may arise. If at any time it is not feasible to carryout works in accordance with this, an alternative must be agreed in writing with the project Arborist.
- 11.3 **Tree work:** All tree work must be carried out by a qualified and experienced Arborist with a minimum of AQF level 3 in arboriculture, in accordance with NSW Work Cover Code of Practice for the Amenity Tree Industry (1998) and AS4373 Pruning of amenity trees (2007).
- 11.4 Initial site meeting/on-going regular inspections: The project Arborist is to hold a pre-construction site meeting with the principle contractor to discuss methods and importance of tree protection measures and resolve any issues in relation to tree protection that may arise. In accordance with AS4970-2009, the project Arborist should carryout regular site inspections to ensure works are carried out in accordance with this document throughout the development process. I recommend regular site inspections on a frequency based on the longevity of the project, this is to be agreed in the initial meeting.


11.5 Site Specific Tree Protection Recommendations:

Table 4: Individual tree protection requirements, see Appendix 1B for locations and further guidance.

3						
Tree Number	Protection specification					
1, 2, 4, 5 and 6	 Retain and protect. Tree Protection Fencing or Tree trunk protection and high quality Ground protection as the Project Arborist see fit once engaged. Any ground work within these designated ground 					
	protection areas must be undertaken by hand and must be supervised by the project arborist					

11.6 Tree protection Specifications: It is the responsibility of the principle contractor to install tree protection prior to works commencing at the site (prior to demolition works) and to ensure that the tree protection remains in adequate condition for the duration of the development. The tree protection must not be moved without prior agreement of the project Arborist. The project Arborist must inspect that the tree protection has been installed in accordance with this document and AS4970-2009 prior to works commencing.


- 11.7 Protective fencing: Where it is not feasible to install fencing at the specified location due to factors such restricting access to areas of the site or for constructing new structures, an alternative location and protection specification must be agreed with the project Arborist. Where the installation of fencing in unfeasible due to restrictions on space, trunk and branch protection will be required (see below). The protective fencing must be constructed of 1.8 metre 'cyclone chainmesh fence'. The fencing must only be removed for the landscaping phase and must be authorised by the project Arborist. Any modifications to the fencing locations must be approved by the project Arborist.
- 11.8 **TPZ signage:** Tree protection signage is to be attached to the protective fencing, displayed in a prominent position and the sign repeated at 10 metres intervals or closer where the fence changes direction. Each sign shall contain in a clearly legible form, the following information:
 - Tree protection zone/No access.
 - This fence has been installed to prevent damage to the tree/s and their growing environment both above and below ground. Do not move fencing or enter TPZ without the agreement of the project Arborist.
 - The name, address, and telephone number of the developer/builder and project Arborist
- 11.9 **Trunk and Branch Protection:** The trunk must be protected by wrapped hessian or similar material to limit damage. Timber planks (50mm x 100mm or similar) should then be placed around tree trunk. The timber planks should be spaced at 100mm intervals, and must be fixed against the trunk with tie wire, or strapping and connections finished or covered to protect pedestrians from injury. The hessian and timber planks must not be fixed to the tree in any instance. The trunk and branch protection shall be installed prior to any work commencing on site and shall be maintained in good condition for the entire development period.
- 11.10 **Mulch:** Any areas of the TPZ located inside the subject site (only trees to be retained directly adjacent to site works must be mulched to a depth of 75mm with good quality composted wood chip/leaf mulch.
- 11.11 Ground Protection: Ground protection is required to protect the underlying soil structure and root system in areas where it is not practical to restrict access to whole TPZ, while allowing space for construction. Ground protection must consist of good quality composted wood chip/leaf mulch to a depth of between 150-300mm, laid on top of geo textile fabric. If vehicles are to be using the area, additional protection will be required such as rumble boards or track mats to spread the weight of the vehicle and avoid load points. Ground protection is to be specified by the project Arborist as required.

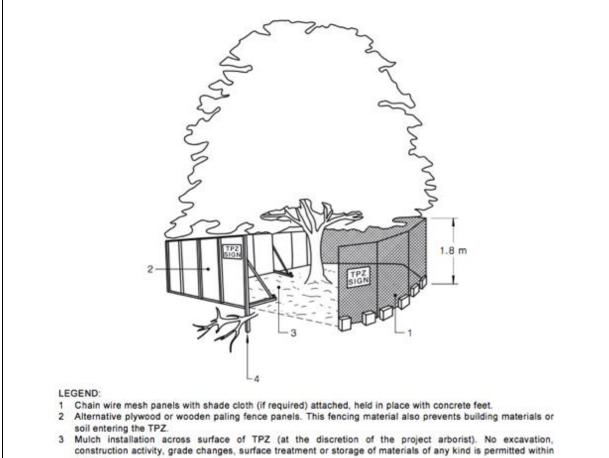

- the TPZ.
- Bracing is permissible within the TPZ. Installation of supports should avoid damaging roots.

An image from AS4970-2009,7 with example tree protection.

⁷ Council of Standards Australia, *AS4970 Protection of trees on development sites* (2009), page 16.

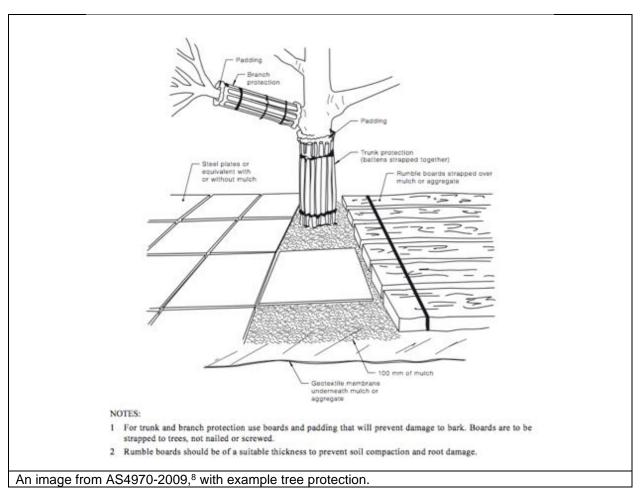

11.12 **Restricted activities inside TPZ:** The following activities must be avoided inside the TPZ of all trees to be retained unless approved by the project Arborist. If at any time these activities cannot be avoided an alternative must be agreed in writing with the project Arborist to minimise the impact to the tree.

- A) Machine excavation.
- B) Ripping or cultivation of soil.
- C) Storage of spoil, soil or any such materials
- D) Preparation of chemicals, including preparation of cement products.
- E) Refueling.
- F) Dumping of waste.
- G) Wash down and cleaning of equipment.
- H) Placement of fill.
- I) Lighting of fires.
- J) Soil level changes.
- K) Any physical damage to the crown, trunk, or root system.
- L) Parking of vehicles.

⁸ Council of Standards Australia, AS4970 Protection of trees on development sites (2009), page 17.

- 11.13 Demolition: The demolition of all existing structures inside or directly adjacent to the TPZ of trees to be retained must be undertaken in consultation with the project Arborist. Any machinery is to work from inside the footprint of the existing structures or outside the TPZ, reaching in to minimise soil disturbance and compaction. If it is not feasible to locate demolition machinery outside the TPZ of trees to be retained, ground protection will be required. The demolition should be undertaken inwards into the footprint of the existing structures, sometimes referred to as the 'top down, pull back' method.
- 11.14 **Excavations and root pruning:** The project Arborist must supervise and certify that all excavations are in accordance with AS4373-2007 and AS4970-2009. For excavations within the TPZ, manual excavation is required along the edge of the structures closest to the subject trees.
- 11.15 **Landscaping:** All landscaping works within the TPZ of trees to be retained are to be undertaken in consultation with a consulting Arborist to minimize the impact to trees. General guidance is provided below to minimise the impact of new landscaping to trees to be retained.
- 11.16 **Sediment and Contamination:** All contamination run off from the development such as but not limited to concrete, sediment and toxic wastes must be prevented from entering the TPZ at all times.
- 11.17 Tree Wounding/Injury: Any wounding or injury that occurs to a tree during the construction process will require the project Arborist to be contacted for an assessment of the injury and provide mitigation/remediation advice. It is generally accepted that trees may take many years to decline and eventually die from root damage. All repair work is to be carried out by the project Arborist, at the contractor's expense.
- 11.18 **Completion of Development Works:** After all construction works are complete the project Arborist should assess that the subject trees have been retained in the same condition and vigour. If changes to condition are identified the project Arborist should provide recommendations for remediation.

12. HOLD POINTS

- 12.1 **Hold Points:** Below is a sequence of hold points requiring project Arborist certification throughout the development process. It provides a list of hold points that must be checked and certified. All certification must be provided in written format upon completion of the development. The final certification must include details of any instructions for remediation undertaken during the development.
- 12.2 Hold points applicable to the development have been shaded in grey.

Hold Point	Stage	Responsibility	Certification	Complete Y/N and date
Project Arborist to hold pre construction site meeting with principle contractor to discuss methods and importance of tree protection measures and resolve any issues in relation to feasibility of tree protection requirements that may arise.	Prior to work commencing.	Principle contractor	Project Arborist	
Project Arborist to assess and certify that tree protection has been installed in accordance with section 11 and AS4970-2009 prior to works commencing at site.	Prior to development work commencing.	Principle contractor	Project Arborist	
In accordance with AS4970-2009 the project arborist should carryout regular site inspections to ensure works are carried out in accordance with the recommendations. I recommend site inspections on a monthly frequency.	Ongoing throughout the development	Principle contractor	Project Arborist	
Project Arborist to supervise all manual excavations and demolition inside the TPZ of any tree to be retained.	Construction	Principle contractor	Project Arborist	
Project Arborist to certify that all pruning of roots greater than 30mm in diameter has been carried out in accordance with AS4373-2007. All root pruning must be carried out by a qualified Arborist/Horticulturalist with a minimum AQF level 3.	Construction	Principle contractor	Project Arborist	
Project Arborist to certify that all underground services including storm water inside TPZ of any tree to be retained have been installed in accordance with AS4970-2009.	Construction	Principle contractor	Project Arborist	

All landscaping works within the TPZ of trees to be retained are to be undertaken in consultation with the project Arborist to minimize the impact to trees.	Landscape	Principle contractor	Project Arborist	
After all construction works are complete the project Arborist should assess that the subject trees have been retained in the same condition and vigor and authorize the removal of protective fencing. If changes to condition are identified the project Arborist should provide recommendations for remediation.	Upon completion of construction	Principle contractor	Project Arborist	
Any wounding or injury that occurs to a tree during the demolition/construction process will require the project arborist to be contacted for an assessment of the injury and provide mitigation/remediation advice. All remediation work is to be carried out by the project arborist, at the contractor's expense.	Ongoing throughout the development	Principle contractor	Project Arborist	

13. BIBLIOGRAPHY/REFERENCES

- Council of Standards Australia, AS4970 Protection of trees on development sites (2009).
- Council of Standards Australia, AS4373 Pruning of amenity trees (2007).
- Mattheck, C. & Breloer, H., *The body language of trees A handbook for failure analysis*, The Stationary Office, London, England (1994).
- Barrell Tree Consultancy, *SULE: Its use and status into the New Millennium*, TreeAZ/03/2001.
- Barrell Tree Consultancy, *Tree AZ version 10.10-ANZ*, http://www.treeaz.com/. Property.
- State Environmental Planning Policy (Vegetation in Non-Rural Areas 2017).

14. **LIST OF APPENDICES**

The following are included in the appendices:

Appendix 1 – Existing Site/ Tree Location Plan

Appendix 1A- Proposed Site Plan and Tree Protection Plan

Appendix 2 - Tree Inspection schedule

Appendix 3 - Tree Health

Appendix 4 – Tree Protection Zone

Appendix 5 – Structural Root Zone

Appendix 6 – Amenity Value


Appendix 7 – Age Class Appendix 8 – Structural Condition

Appendix 9 – SULE Categories

Appendix 10 – Trees AZ




APPENDIX 1 - EXISTING SITE/TREE LOCATION PLAN

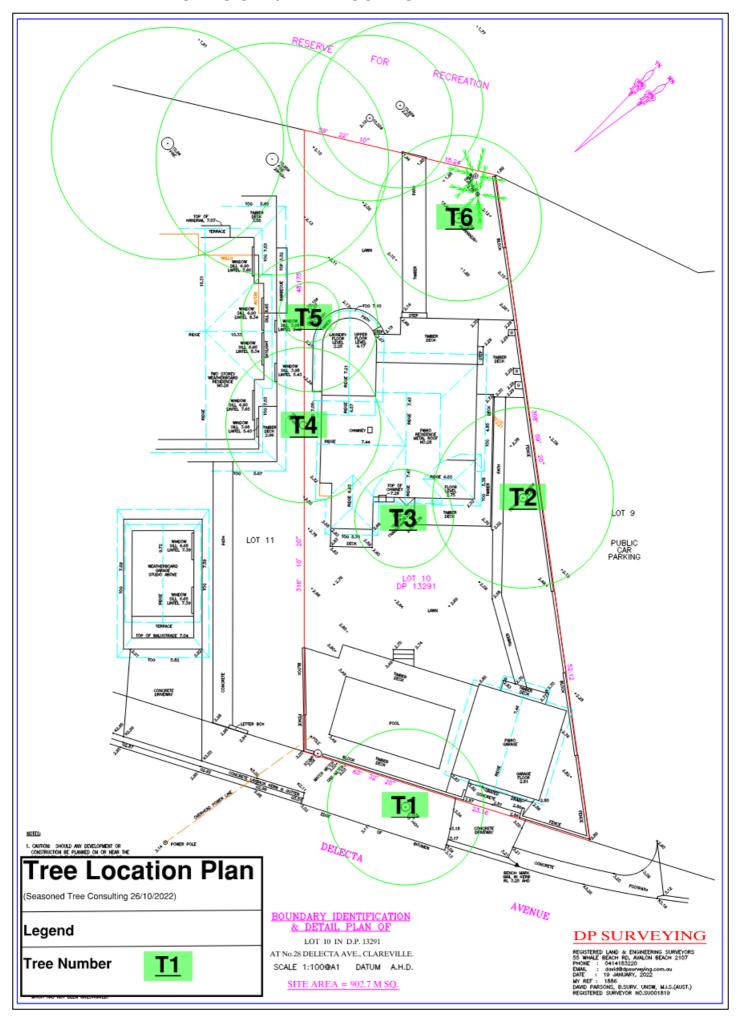



APPENDIX 1A- PROPOSED SITE PLAN AND TREE PROTECTION PLAN

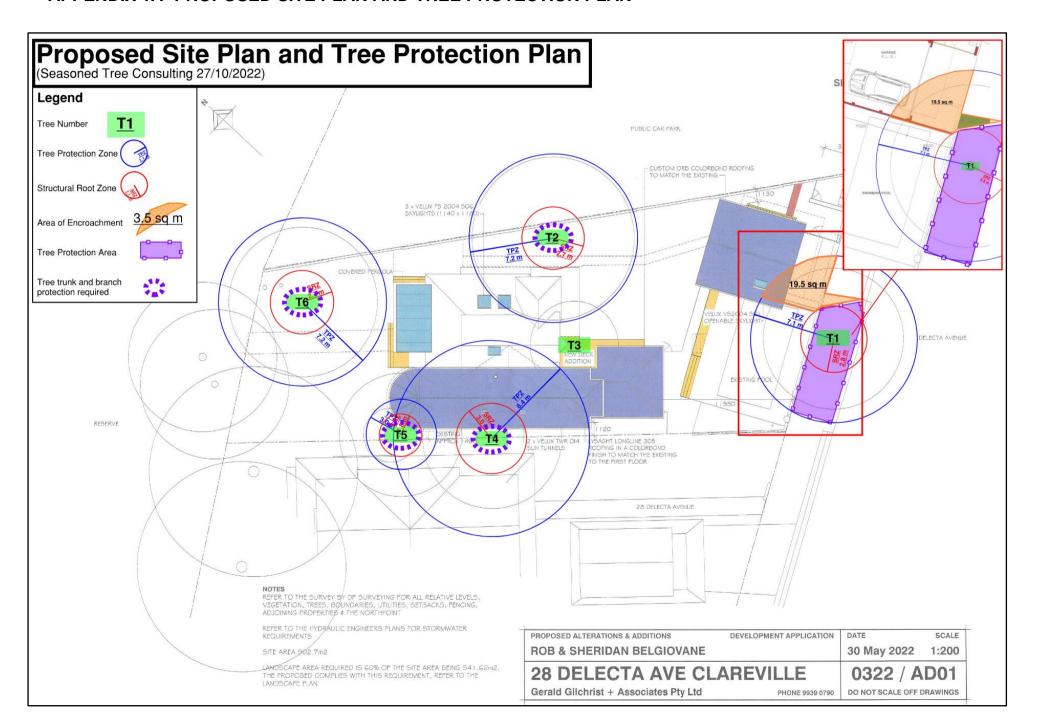



APPENDIX 2- TREE INSPECTION SCHEDULE

Tree Inspection Site: 28 Delecta Ave, Clareville Surveyed by: David Gowenlock Date of Inspection: 24/10/2022 Tagged: No

Tree ID	Tree Species	рвн (см)	TPZ radius (M)	TPZ Area (Sq.M)	DAB (CM)	SRZ radius (M)	Height (M)	Spread (M)	Age Class	Health	Structure	Amenity value	SULE (yrs.)	TreeAZ retention Value	Comments
1	Castanospermum australe, Black bean	45*38 (=59)	7.08	157.5	65	2.8	11	9	Mature	Fair	Fair	High	15 > 40	A2	Codominant poorly attached from 1.0m. Dbh estimated as cannot get a tape around due to close stems. Top of tree is dead.
2	Eucalyptus robusta, Swamp mahogany	60	7.2	162.9	60	2.7	15	15	Mature	Good	Good	Very high	15 > 40	A2	
3	Plumerai acutifolia, Frangipani	-	-	-	-	-	-		Mature	Good	Good	Low	15 > 40	Z3	Exempt.
4	Glochidion ferdinandi, Cheese tree	70	8.4	221.7	80	3	11	8	Mature	Good	Poor	High	15 > 40	A2	Significantly lopped on both sides of the tree
5	2 x Syzygium luehmannii, Riberry	25	3	28.3	25	1.8	10	5	Mature	Good	Good	Medium	>40	Z2	Exempt due to proximity to existing house.
6	Jacaranda mimosifolia, Jacaranda	60	7.2	162.9	60	2.7	15	12	Mature	Good	Good	High	15 > 40	A1	

Explanatory Notes

Tree Species - Botanical name followed by common name in brackets. Where species is unknown it is indicated with an 'spp'.

Diameter at Breast Height (DBH) - Measured with a DBH tape or estimated at approximately 1.4m above ground level. Where DBH has been estimated it is indicated with an 'Est'. The (1) indicates the stem number and the (t) indicates the total DBH when calculated in accordance with AS4970-2009 definition.

Tree Protection Zone (TPZ) - DBH x 12. Measured in radius from the center of the trunk. Rounded to nearest 0.1m. For monocots, the TPZ is set at 1 meter outside the crown projection.

TPZ Area (Sq.M)- The area of the TPZ calculated in square metres.

Diameter Above root Buttresses (DAB): Measured with a DBH tape or estimated above root buttresses (DAB) for calculating the SRZ.

Structural Root Zone (SRZ) - (DAB x 50) $^{0.42}$ x 0.64. Measured in radius from the center of the trunk. Rounded up to nearest 0.1m.

Height - Height from ground level to top of crown. All heights are estimated unless otherwise indicated.

Spread - Radius of crown at widest section. All tree spreads are estimated unless otherwise indicated.

Age Class - Over mature (OM), Mature (M), Early mature (EM), Semi mature (SM), Young (Y), Dead (D).

Health - Good/Fair/Poor/Dead **Structure** - Good/Fair/Poor

Amenity Value - Very High/High/Medium/Low/Very Low.

Safe Useful Life Expectancy (SULE) - 1. Long (40+years), 2. Medium (15 - 40 years), 3.

Short (5 - 15 years), 4. Remove (under 5 years), 5. Small/young.

TreeAZ retention Value- See Appendix 10



Appendix 3 - Condition/Overall health

Category	Example condition	<u>Summary</u>				
Good	 Crown has good foliage density for species. Tree shows no or minimal signs of pathogens that are unlikely to have an effect on the health of the tree. Tree is displaying good vigour and reactive growth development. Branch unions appear to be strong with no sign of defects. There are no significant cavities. The tree is unlikely to fail in usual conditions. The tree has a balanced crown shape and 	The tree is in above average health and condition and no remedial works are required. The tree is considered structurally good with well developed form.				
	form.					
Fair	 The tree may be starting to dieback or have over 25% deadwood. Tree may have slightly reduced crown density or thinning. There may be some discolouration of foliage. Average reactive growth development. There may be early signs of pathogens which may further deteriorate the health of the tree. There may be epicormic growth indicating increased levels of stress within the tree. The tree may have minor structural defects within the structure of the crown that could potentially develop into more significant defects. The tree may a cavity that is currently unlikely to fail but may deteriorate in the future. The tree is an unbalanced shape or leans significantly. The tree may have minor damage to its roots. The root plate may have moved in the past but the tree has now compensated for this. 	The tree is in below average health and condition and may require remedial works to improve the trees health. The identified defects are unlikely cause major failure. Some branch failure may occur in usual conditions. Remedial works can be undertaken to alleviate potential defects.				
Poor	Branches may be rubbing or crossing. The may be in decline, have extensive	The tree is displaying low levels				
	 dieback or have over 30% deadwood. The canopy may be sparse or the leaves may be unusually small for species. Pathogens or pests are having a significant detrimental effect on the tree health. The tree has significant structural defects. Branch unions may be poor or weak. The tree may have a cavity or cavities with excessive levels of decay that could cause catastrophic failure. The tree may have root damage or is displaying signs of recent movement. The tree crown may have poor weight distribution which could cause failure. 	of health and removal or remedial works may be required. The identified defects are likely to cause either partial or whole failure of the tree.				
Dangerous	The tree is dead or almost dead. The tree is an imminent danger to people	The tree should generally be removed.				

or property.

Appendix 4 - Tree Protection Zone (TPZ)

The tree protection zone (TPZ) is the principle means of protecting trees on development sites. The TPZ is a combination of the root area and crown area requiring protection. It is an area isolated from construction disturbance, so that the tree remains viable. The TPZ incorporates the structural root zone (SRZ).

Determining the TPZ

The radius of the TPZ is calculated for each tree by multiplying its DBH × 12.

 $TPZ = DBH \times 12$

Where

DBH = trunk diameter measured at 1.4 m above ground


Radius is measured from the centre of the stem at ground level. A TPZ should not be less than 2 m nor greater than 15 m (except where crown protection is required).

Minor encroachment into the TPZ


Where encroachment into the TPZ is unavoidable it is generally accepted that encroachment of under 10% of the total TPZ is possible without carrying out detailed root investigations. This minor loss of root area is normally compensated by the roots developing elsewhere.


Major encroachment into the TPZ

If an encroachment of more than 10% is proposed into the TPZ it would be necessary to demonstrate that the tree would remain viable. None destructive root investigations may be required to determine any potential impact the encroachment may have on the tree.

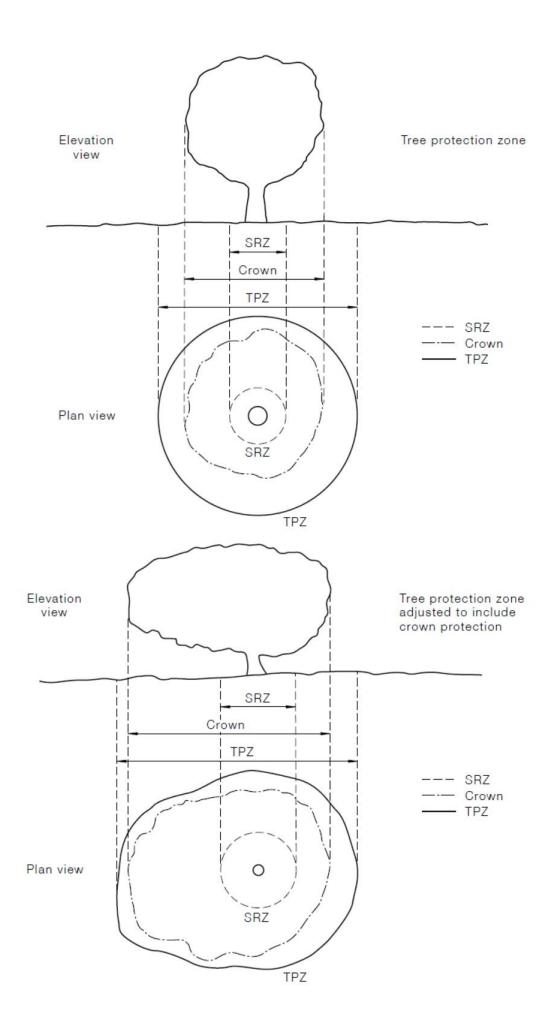

Encroachment into the tree protection zone (TPZ) is sometimes unavoidable. Figure D1 provides examples of TPZ encroachment by area, to assist in reducing the impact of such incursions.

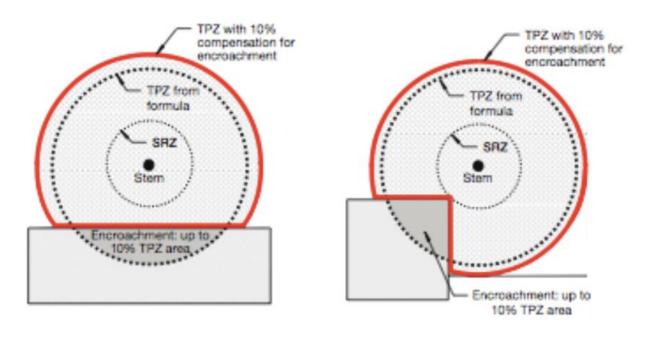

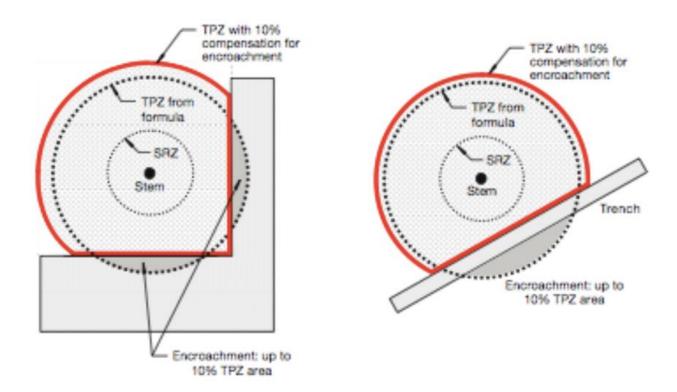

NOTE: Less than 10% TPZ area and outside SRZ. Any loss of TPZ compensated for elsewhere.

Appendix 5 - Structural root zone (SRZ)

This is the area around the base of a tree required for the trees stability in the ground. An area larger than the SRZ always need to be maintained to preserve a viable tree as it will only have a minor effect on the trees vigour and health. There are several factors that determine the SRZ which include height, crown area, soil type and soil moisture. It can also be influenced by other factors such as natural or built structures. Generally work within the SRZ should be avoided.

Determining the SRZ

An indicative SRZ radius can be determined from the diameter of the trunk measured immediately above the root buttresses. Root investigation could provide more information about the extent of the SRZ. The following formula should be used to calculate the SRZ.

SRZ radius = $(D \times 50)^{0.42} \times 0.64$

where

D = trunk diameter in m, measured above the root buttress.

Note - The SRZ for trees with trunk diameters less than 0.15 will be 1.5m.

Appendix 6 - Amenity value

To determine the amenity value of a tree we assess a number of different factors which include but are not limited to the information below.

- · The visibility of the tree to adjacent sites.
- The relationship between the tree and the site.
- Whether the tree is protected by any statuary conditions.
- The habitat value of the tree.
- Whether the tree is considered a noxious weed species.

Appendix 7 - Age class

If can be difficult to determine the age of a tree without carrying out invasive tests that may damage the tree, so we have categorised there likely age class which is defined below.

Category	<u>Description</u>
Young/Newly planted	Young or recently planted tree.
Semi Mature	 Up to 20% of the usual life expectancy for the species.
Early mature/Mature	 Between 20% - 80% of the usual life expectancy for the species.
Over mature	Over 80% of the usual life expectancy for the species.
Dead	Tree is dead or almost dead.

Appendix 8 - Structural condition

Category	Example condition	Summary				
Good	 Branch unions appear to be strong with no sign of defects. There are no significant cavities. The tree is unlikely to fail in usual conditions. The tree has a balanced crown shape and form. 	The tree is considered structurally good with well developed form.				
Fair	 The tree may have minor structural defects within the structure of the crown that could potentially develop into more significant defects. The tree may a cavity that is currently unlikely to fail but may deteriorate in the future. The tree is an unbalanced shape or leans significantly. The tree may have minor damage to its roots. The root plate may have moved in the past but the tree has now compensated for this. Branches may be rubbing or crossing. 	 The identified defects are unlikely cause major failure. Some branch failure may occur in usual conditions. Remedial works can be undertaken to alleviate potential defects. 				
Poor	 The tree has significant structural defects. Branch unions may be poor or weak. The tree may have a cavity or cavities with excessive levels of decay that could cause catastrophic failure. The tree may have root damage or is displaying signs of recent movement. The tree crown may have poor weight distribution which could cause failure. 	The identified defects are likely to cause either partial or whole failure of the tree.				

Appendix 9 - Safe Useful Life Expectancy (SULE), (Barrel, 2001)

A trees safe useful life expectancy is determined by assessing a number of different factors including the health and vitality, estimated age in relation to expected life expectancy for the species, structural defects, and remedial works that could allow retention in the existing situation.

Category	Description
1. Long - Over 40 years	 (a) Structurally sound trees located in positions that can accommodate future growth. (b) Trees that could be made suitable for retention in the long term by remedial tree care. (c) Trees of special significance for historical, commemorative or rarity reasons that would warrant extraordinary efforts to secure their long term retention.
2. Medium - 15 to 40 years	 (a) Trees that may only live between 15 and 40 more years. (b) Trees that could live for more than 40 years but may be removed for safety or nuisance reasons. (c) Trees that could live for more than 40 years but may be removed to prevent interference with more suitable individuals or to provide space for new planting. (d) Trees that could be made suitable for retention in the medium term by remedial tree care.
3. Short - 5 to 15 years	 (a) Trees that may only live between 5 and 15 more years. (b) Trees that could live for more than 15 years but may be removed for safety or nuisance reasons. (c) Trees that could live for more than 15 years but may be removed to prevent interference with more suitable individuals or to provide space for new planting. (d) Trees that require substantial remedial tree care and are only suitable for retention in the short term.
4. Remove - Under 5 years	 (a) Dead, dying, suppressed or declining trees because of disease or inhospitable conditions. (b) Dangerous trees because of instability or recent loss of adjacent trees. (c) Dangerous trees because of structural defects including cavities, decay, included bark, wounds or poor form. (d) Damaged trees that are clearly not safe to retain. (e) Trees that could live for more than 5 years but may be removed to prevent interference with more suitable individuals or to provide space for new planting. (f) Trees that are damaging or may cause damage to existing structures within 5 years. (g) Trees that will become dangerous after removal of other trees for the reasons given in (a) to (f). (h) Trees in categories (a) to (g) that have a high wildlife habitat value and, with appropriate treatment, could be retained subject to regular review.
5. Small/Young	(a) Small trees less than 5m in height. (b) Young trees less than 15 years old but over 5m in height. (c) Formal hedges and trees intended for regular pruning to artificially control growth.

Appendix 10- TreeAZ Categories

TreeAZ Categories (Version 10.04-ANZ)

CAUTION: TreeAZ assessments <u>must</u> be carried out by a competent person qualified and experienced in arboriculture. The following category descriptions are designed to be a brief field reference and are <u>not</u> intended to be self-explanatory. They <u>must</u> be read in conjunction with the most current explanations published at <u>www.TreeAZ.com</u>.

Category Z: Unimportant trees not worthy of being a material constraint

Local policy exemptions: Trees that are unsuitable for legal protection for local policy reasons including size, proximity and species

- **Z1** Young or insignificant small trees, i.e. below the local size threshold for legal protection, etc
- **Z2** Too close to a building, i.e. exempt from legal protection because of proximity, etc
- Species that cannot be protected for other reasons, i.e. scheduled noxious weeds, out of character in a setting of acknowledged importance, etc

High risk of death or failure: Trees that are likely to be removed within 10 years because of acute health issues or severe structural failure

- **Z4** Dead, dying, diseased or declining
- Severe damage and/or structural defects where a high risk of failure <u>cannot</u> be satisfactorily reduced by
- zs reasonable remedial care, i.e. cavities, decay, included bark, wounds, excessive imbalance, overgrown and vulnerable to adverse weather conditions, etc
- **Z6** Instability, i.e. poor anchorage, increased exposure, etc
 - Excessive nuisance: Trees that are likely to be removed within 10 years because of unacceptable impact on people
- Excessive, severe and intolerable inconvenience to the extent that a locally recognized court or tribunal would be likely to authorize removal, i.e. dominance, debris, interference, etc
- Excessive, severe and intolerable damage to property to the extent that a locally recognized court or tribunal would be likely to authorize removal, i.e. severe structural damage to surfacing and buildings, etc

Good management: Trees that are likely to be removed within 10 years through responsible management of the tree population

- Severe damage and/or structural defects where a high risk of failure can be <u>temporarily</u> reduced by reasonable remedial care, i.e. cavities, decay, included bark, wounds, excessive imbalance, vulnerable
- to adverse weather conditions, etc

 Poor condition or location with a low potential for recovery or improvement, i.e. dominated by adjacent
- trees or buildings, poor architectural framework, etc
- **Z11** Removal would benefit better adjacent trees, i.e. relieve physical interference, suppression, etc
- Z12 Unacceptably expensive to retain, i.e. severe defects requiring excessive levels of maintenance, etc

NOTE: Z trees with a high risk of death/failure (Z4, Z5 & Z6) or causing severe inconvenience (Z7 & Z8) at the time of assessment and need an urgent risk assessment can be designated as ZZ. ZZ trees are likely to be unsuitable for retention and at the bottom of the categorization hierarchy. In contrast, although Z trees are not worthy of influencing new designs, urgent removal is not essential and they could be retained in the short term, if appropriate.

Category A: Important trees suitable for retention for more than 10 years and worthy of being a material constraint

- A1 No significant defects and could be retained with minimal remedial care
- A2 Minor defects that could be addressed by remedial care and/or work to adjacent trees
- A3 Special significance for historical, cultural, commemorative or rarity reasons that would warrant extraordinary efforts to retain for more than 10 years
- A4 Trees that may be worthy of legal protection for ecological reasons (Advisory requiring specialist assessment)

NOTE: Category A1 trees that are already large and exceptional, or have the potential to become so with minimal maintenance, can be designated as AA at the discretion of the assessor. Although all A and AA trees are sufficiently important to be material constraints, AA trees are at the top of the categorization hierarchy and should be given the most weight in any selection process.