

/ Main sections

Project name 2A WEST ST, BALGOWLAH	Project Number:	Responsible:	Date: 7/08/2019
--	-----------------	--------------	---------------------------

No.	Start MH	End MH	Date	Location/Street	Tape No.	Material	m	(m)
1	SW1	SW2	7/08/2019	WEST ST		Concrete pipe	9.53	9.53

Pipe size: CIRCULAR 375 = 9.53 m (9.53 m)

All sections = 9.53 m (9.53 m)

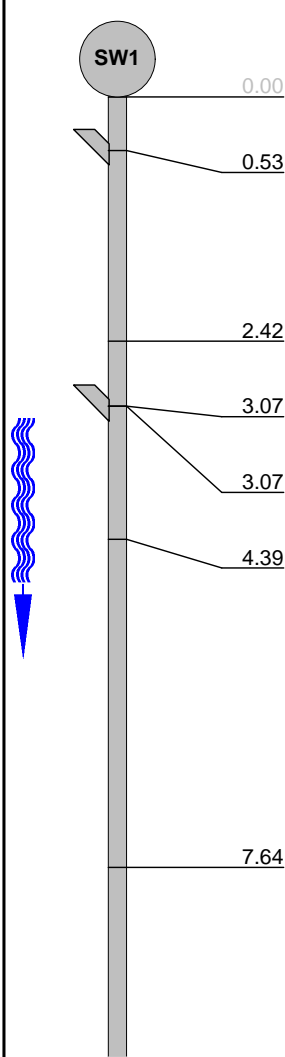
WSA assessment

Date: 7/08/2019	Asset owner's job ref.: 202379'2781	Asset Owner:	Operator : CRAIG PICKUP	Section number: 1	Pipe Asset Id: SW 1
Time of inspection: 12:27:00	Cleaning: not cleaned	Standard: WSA 05-2008 2.2	LRP Inside Face of the Wall	Conduit Unit Length	Method of Inspection Television Camera

Town: Suburb: BALGOWLAH HEIGHTS Street: WEST ST Asset Location Light road	Catchment: Asset Owner: Precipitation.: Flow control No measures	US MH: SW1 Survey Dir: downstream DS MH: SW2 Inspect Lenght : 9.53 m
---	--	---

Purpose of inspection : Structural Condition Inspection	Shape : Circular
Use of Conduit: Drain	Dia/Height: 375 mm
Type of Conduit: Storm water drain	Lining:
Lining Method:	Pipe Material: Concrete pipe

Remarks :

1:75	Position	Observation	Photo	
		0.00	Circumferential fracture , width 0.5mm , from 1 to 5 o'clock	1_1_4_A.JPG
		0.53	Connection, poor workmanship, connection appears to be open , diameter 150mm	1_1_5_A.JPG
		2.42	S1 Longitudinal fracture , width 0.5mm , at 1 o'clock, Start	1_1_6_A.JPG
		3.07	E1 Longitudinal fracture , width 0.5mm , at 1 o'clock, End	
		3.07	Connection, poor workmanship, connection appears to be open , diameter 150mm	1_1_8_A.JPG
		4.39	Breaking, some pieces are missing, at joint, length of break 100, exposed reomesh, at 12 o'clock	1_1_9_A.JPG
		7.64	Finish node, grated inlet pit, Nodename: SW2	

Inspection Pictures

Location/Street WEST ST	Town or suburb:	Date : 7/08/2019	Section number: 1	Sewer Ref.: SW 1
-----------------------------------	-----------------	----------------------------	-----------------------------	----------------------------



Photo: 1_1_4_A.JPG
0m, Circumferential fracture , width 0.5mm , from 1 to 5 o'clock



Photo: 1_1_5_A.JPG
0.53m, Connection, poor workmanship, connection appears to be open , diameter 150mm



Photo: 1_1_6_A.JPG
2.42m, Longitudinal fracture , width 0.5mm , at 1 o'clock, Start



Photo: 1_1_8_A.JPG
3.07m, Connection, poor workmanship, connection appears to be open , diameter 150mm

Inspection Pictures

Location/Street WEST ST	Town or suburb:	Date : 7/08/2019	Section number: 1	Sewer Ref.: SW 1
-----------------------------------	-----------------	----------------------------	-----------------------------	----------------------------



Photo: 1_1_9_A.JPG
4.39m, Breaking, some pieces are missing, at joint, length of
break 100, exposed reomesh, at 12 o'clock