



REPORT TO
ADDENBROOKE PTY LTD

ON
**GEOTECHNICAL SLOPE STABILITY RISK
ASSESSMENT**

FOR
PROPOSED ALTERATIONS AND ADDITIONS

AT
**NORTH HARBOUR MARINA, GOURLAY AVENUE,
BALGOWLAH, NSW**

Date: 25 March 2024

Ref: 36597Srpt

JKGeotechnics
www.jkgeotechnics.com.au

T: +61 2 9888 5000
JK Geotechnics Pty Ltd
ABN 17 003 550 801



Report prepared by:



Ben Sheppard
Senior Geotechnical Engineer

Report reviewed by:



Paul Stubbs
Principal | Geotechnical Engineer

For and on behalf of
JK GEOTECHNICS
PO BOX 976
NORTH RYDE BC NSW 1670

DOCUMENT REVISION RECORD

Report Reference	Report Status	Report Date
36597Srpt	Final Report	25 March 2024

© Document copyright of JK Geotechnics

This report (which includes all attachments and annexures) has been prepared by JK Geotechnics (JKG) for its Client, and is intended for the use only by that Client.

This Report has been prepared pursuant to a contract between JKG and its Client and is therefore subject to:

- JKG's proposal in respect of the work covered by the Report;
- The limitations defined in the Client's brief to JKG;
- The terms of contract between JKG and the Client, including terms limiting the liability of JKG.

If the Client, or any person, provides a copy of this Report to any third party, such third party must not rely on this Report, except with the express written consent of JKG which, if given, will be deemed to be upon the same terms, conditions, restrictions and limitations as apply by virtue of (a), (b), and (c) above.

Any third party who seeks to rely on this Report without the express written consent of JKG does so entirely at their own risk and to the fullest extent permitted by law, JKG accepts no liability whatsoever, in respect of any loss or damage suffered by any such third party.

At the Company's discretion, JKG may send a paper copy of this report for confirmation. In the event of any discrepancy between paper and electronic versions, the paper version is to take precedence. The USER shall ascertain the accuracy and the suitability of this information for the purpose intended; reasonable effort is made at the time of assembling this information to ensure its integrity. The recipient is not authorised to modify the content of the information supplied without the prior written consent of JKG.



Table of Contents

1	INTRODUCTION	1
2	ASSESSMENT PROCEDURE	1
3	SUMMARY OF OBSERVATIONS	2
4	SLOPE STABILITY RISK ASSESSMENT	3
5	COMMENTS AND RECOMMENDATIONS	4
6	GENERAL COMMENTS	4

ATTACHMENTS

Table A: Summary of Risk Assessment to Property

Table B: Summary of Risk Assessment to Life

Figure 1: Site Location Plan

Figure 2: Geotechnical Sketch Plan

Figure 3: Geotechnical Sketch Plan Showing Geotechnical Hazards

Figure 4: Section A-A' Showing Potential Landslide Hazards

Figure 5: Geotechnical Mapping Symbols

Appendix A: Landslide Risk Management Terminology

Appendix B: Some Guidelines For Hillside Construction

1 INTRODUCTION

This report presents the results of a geotechnical slope stability risk assessment for the proposed alterations and additions at North Harbour Marina, Goulray Avenue, Balgowlah, NSW. The location of the site is shown in Figure 1. The assessment was commissioned by Mr Ned O’Neil of Addenbrooke Pty Ltd and was carried out in accordance with our proposal dated 20 February 2024, Ref: P60145S.

Based on the provided preliminary layout plan prepared by International Marina Consultants (Drawing No.6318-01/H, dated 22 January 2024), we understand the alterations and additions include:

- Extension of the existing deck to the rear of the boathouse accommodate an additional seating area.
- Construction of a new deck to the south-east of the existing boathouse. A new three-tiered kayak storage area will be constructed above the new deck. We have assumed that the new deck will be constructed at existing grade and that no excavation will be required.
- Installation of new pontoons and berths along the existing jetty, which will be above water structures.

The site is located within Zone ‘G1’ of the Manly Council’s Landslide Risk Zoning Maps, and therefore, a geotechnical slope stability risk assessment is required.

The purpose of the assessment was to complete a walkover inspection of the site in order to complete a geotechnical slope stability risk assessment for the proposed development. Comments and recommendations are also provided herein on geotechnical issues for the proposed works, though we note these are limited to new footings for the proposed deck.

2 ASSESSMENT PROCEDURE

The stability assessment is based upon a detailed walkover inspection of the topographic, surface drainage and geological conditions of the site and its immediate environs by our Senior Geotechnical Engineer, Mr Ben Sheppard, on 5 March 2024. The attached Figure 2 presents a geotechnical sketch plan. Figure 2 is based on the survey plan prepared by Andrew P. Mason (Ref: 33641-DP, dated 8 December 2023). Additional features on Figure 2 have been measured by hand held inclinometer and tape measure techniques and hence are only approximate. Should any of the features be critical to the proposed development, we recommend they be located more accurately using instrument survey techniques. Figure 3 presents the geotechnical sketch plan with the assessed geotechnical hazards. Figure 4 presents a typical cross-section through the site based on the survey data augmented by our mapping observations. Figure 5 defines the mapping symbols used.

The slope stability risk assessment was carried out in accordance with the Australian Geomechanics Society (2007c) guidelines (Reference 1). The attached Appendix A defines the terminology adopted for the risk assessment together with a flowchart illustrating the Risk Management Process based on the guidelines given in AGS 2007c.

3 SUMMARY OF OBSERVATIONS

The site observations provided below should be read in conjunction with the attached Figures 1 to 4.

The site is located at the toe of a north-east facing hillside that slopes down at about 15° towards North Harbour. The site is situated within the foreshore area of North Harbour, a short distance from the toe of the hillside.

The site contains a single-storey timber boathouse which is raised above the foreshore on concrete columns. The structure appears to be in good external condition, based on a cursory inspection. A raised timber deck extends from the rear of the boathouse, above the water, and was also supported on concrete columns. A jetty then extends from the edge of the deck out into North Harbour. To the east of the boathouse are two concrete and timber working platforms, with surrounding ancillary structures. The working platforms are raised above existing ground levels and appear to be supported on concrete and timber columns. Ground levels below the southern side of the working platforms are retained by a timber post and panel wall up to about 1m high, which appears to be in good condition, with no significant outward rotation or bulging observed. Above the crest of the timber wall, and extending to the front of the boathouse, is a brick paved walkway which slopes to the north-west at about 5°. Sandstone bedrock is outcropping within the foreshore below and adjacent to the boathouse. The sandstone was assessed to be moderately weathered and of at least medium strength.

To the south-west of the site is a steep embankment which slopes up to the south-west and supports Gourley Avenue. The embankment generally slopes at about 35°, with locally low-height steeper slopes, up to 55°, cut into the embankment to accommodate a pedestrian pathway and a small brick structure. The embankment was densely vegetated with small to large trees and low-height shrubbery. Small to medium sized boulders were observed over the embankment slope, however were more common towards the crest, and were generally embedded into the soil profile. A localised erosion gully was evident on the north-western side of the brick structure, although has since been re-vegetated. Similarly, evidence of a possible landslide was observed along the low side of Gourley Avenue to the north of the site, and appeared to be about 4m wide. It was not obvious that a landslide had occurred, although the lack of large vegetation may suggest an area of previous instability. Sandstone bedrock was observed within a cutting for the pedestrian pathway, and was assessed to be moderately weathered and of medium strength.

Gourley Avenue extends along the crest of the embankment and slopes down to the south-east where it passes the site, and then turns to connect to the aforementioned brick pathway. The roadway appeared to be generally in good condition, with some patchwork observed along the crest of the embankment. Gourley Avenue appears to have been formed by cut and fill of the hillside, with the embankment supporting the low side and a cutting within the hillside on the high side. The cutting, which may potentially be a natural cliff, is up to about 4.2m high, and reduces in height to the north-west. The cutting exposed highly variable sandstone bedrock ranging from extremely weathered to moderately weathered sandstone and of soil strength to medium strength. No signs of recent instability at the toe of the cut were observed. Extremely weathered bands up to 2m thick were observed, possible extending over the full height of the cut at the south-eastern end. Very large 'lenticular' shaped boulders are situated at the crest of the sandstone cut and

adjacent to the road, and were measured to be up to about 5m wide. The hillside above the crest of the cut sloped up to the south and south-west at about 15° to 20°.

Along the foreshore to the south-east of the site was a low-height embankment and sandstone boulder wall, which supports the continuation of Gourley Avenue. Sandstone bedrock was outcropping below the embankment. Sandstone boulders were observed at the toe of the embankment to the north-west and south-east of the site.

4 SLOPE STABILITY RISK ASSESSMENT

Based on our walkover inspection, we consider that the potential landslide hazards associated with the site and the proposed development are as follows:

- A. Instability of the embankment above the site.
 - i. Global Instability
 - ii. Localised Instability
- B. Instability of floaters/boulders.
- C. Instability of sandstone outcrops.
- D. Instability of low-height sandstone cobble, sandstone block and timber post and panel walls.
- E. Instability of localised oversteep batters

The attached Table A summarises our qualitative assessment of each potential landslide hazard and the consequences to property should the landslide hazard occur. The terminology adopted for this qualitative assessment is in accordance with Table A1 given in Appendix A. Table A indicates that the assessed risk to property varies between “Very Low” and “low”, which would be considered ‘acceptable’ in accordance with the criteria given in Reference 1.

We have also used the indicative probabilities associated with the assessed likelihood of instability to calculate the risk to life for the person most at risk. The temporal and vulnerability factors that have been adopted are given in the attached Table B together with the resulting risk calculation. Our assessed total risk to life for the person most at risk is about 8.7×10^{-7} . This would be considered to be ‘acceptable’ in relation to the criteria given in Reference 1.

Our assessment of the probability of failure of existing structural elements, such as retaining walls, is based upon a visual appraisal of their type and condition at the time of our inspection.

Based on the above slope stability risk assessment the proposed development can be constructed to achieve an ‘acceptable’ level of risk, provided the recommendations given in Section 5 are followed during design and construction of the proposed development.

5 COMMENTS AND RECOMMENDATIONS

We understand that the proposed works include the extension of the timber deck to the rear of the boathouse, along with the construction of a new deck to the south-east of the boathouse. We expect that the deck extension and new deck will be suspended between new footings.

The subsurface conditions at the site are not known as no subsurface investigation has been carried out. However, based on our walkover mapping, and nearby outcrops below the proposed structures, sandstone bedrock is expected to be at shallow depths. Marine sands are expected to overlie the sandstone bedrock, particularly where the deck extension is proposed.

Any new footings that are required must be founded on the sandstone bedrock. New footings must be founded below the base of the timber sleeper retaining wall (or any other wall within the area) so that additional surcharge loads are not placed on the existing wall. Footings for the new deck may comprise of shallow pad or strip footings, where the depth of the overlying sands are expected to be thin and would not be an issue. Within the area of the proposed deck extension, extending footings/piles through the water charged sands above the sandstone bedrock may pose as a constructability issue. In this regard, steel tube piles may be driven/screwed to the surface of the sandstone bedrock and then the material within the tube drilled out.

Footings and piles founded within sandstone bedrock of at least very low strength may be designed based on an allowable bearing pressure of 600kPa. The footing excavations/pile drilling should be inspected by a geotechnical engineer to confirm the bearing pressure of the foundation material.

6 GENERAL COMMENTS

The recommendations presented in this report include specific issues to be addressed during the construction phase of the project. In the event that any of the construction phase recommendations presented in this report are not implemented, the general recommendations may become inapplicable and JK Geotechnics accept no responsibility whatsoever for the performance of the structure where recommendations are not implemented in full and properly tested, inspected and documented.

This report provides advice on geotechnical aspects for the proposed civil and structural design. As part of the documentation stage of this project, Contract Documents and Specifications may be prepared based on our report. However, there may be design features we are not aware of or have not commented on for a variety of reasons. The designers should satisfy themselves that all the necessary advice has been obtained. If required, we could be commissioned to review the geotechnical aspects of contract documents to confirm the intent of our recommendations has been correctly implemented.

A waste classification is required for any soil and/or bedrock excavated from the site prior to offsite disposal. Subject to the appropriate testing, material can be classified as Virgin Excavated Natural Material (VENM), Excavated Natural Material (ENM), General Solid, Restricted Solid or Hazardous Waste. Analysis can take up to seven to ten working days to complete, therefore, an adequate allowance should be included in the

construction program unless testing is completed prior to construction. If contamination is encountered, then substantial further testing (and associated delays) could be expected. We strongly recommend that this requirement is addressed prior to the commencement of excavation on site.

This report has been prepared for the particular project described and no responsibility is accepted for the use of any part of this report in any other context or for any other purpose. If there is any change in the proposed development described in this report then all recommendations should be reviewed. Copyright in this report is the property of JK Geotechnics. We have used a degree of care, skill and diligence normally exercised by consulting engineers in similar circumstances and locality. No other warranty expressed or implied is made or intended. Subject to payment of all fees due for the investigation, the client alone shall have a licence to use this report. The report shall not be reproduced except in full.

Reference 1: Australian Geomechanics Society (2007c) *'Practice Note Guidelines for Landslide Risk Management'*, Australian Geomechanics, Vol 42, No 1, March 2007, pp63-114.




TABLE A
SUMMARY OF RISK ASSESSMENT TO PROPERTY

POTENTIAL LANDSLIDE HAZARD	A1	A2	B	C	D	E
	Global instability of embankment above the site	Localised instability of the embankment above the site	Instability of floaters/boulders	Instability of sandstone outcrops	Instability of low-height sandstone cobble, sandstone block and timber post and panel walls	Instability of localised oversteep batters
Assessed Likelihood	Rare	Possible	Unlikely	Possible	Unlikely	Likely
Assessed Consequence	Major	Insignificant	Minor	Insignificant	Insignificant	Insignificant
Risk	Low	Very Low	Low	Very Low	Very Low	Low
Comments	Embankment appears steep, but sandstone bedrock is likely to be shallow so global failure through the bedrock is highly unlikely. Impact to entire site.	Embankment appears steep, though the depth of soils above the bedrock is expected to be limited which would result in limited material activated. Deepest soil cover likely adjacent to Gourley Avenue which support roadway. Possible high traffic loads (garbage trucks) along road. Impact to carpark area only.	Floaters generally appear to be embedded in the soil profile and therefore stable. Failure would result in impact to boathouse. Very large boulders on the high side of Gourley Avenue are not expected to travel over roadway and therefore will not impact site.	No signs of instability observed. Sandstone bedrock quality is poor, and may result in failure. Impact to Gourley Avenue only.	Walls are generally in good condition. Failure would result in minor remediation of pathways and wall itself.	Batters are considered to be oversteep and are likely to have a low Factor of Safety against failure. Oversteep batters are generally of minimal height. Slumping likely, although minimal impact to occur to site besides some remediation to the carpark and pathway.




TABLE B
SUMMARY OF RISK ASSESSMENT TO LIFE

POTENTIAL LANDSLIDE HAZARD	A1 Global instability of embankment above the site	A2 Localised instability of the embankment above the site	B Instability of floaters/boulders	C Instability of sandstone outcrops	D Instability of low-height sandstone cobble, sandstone block and timber post and panel walls	E Instability of localised oversteep batters
Assessed Likelihood	Rare	Possible	Unlikely	Unlikely	Unlikely	Likely
Indicative Annual Probability	10^{-5}	10^{-3}	10^{-4}	10^{-4}	10^{-4}	10^{-2}
Persons at risk	(i) Above – person walking along Gourley Ave (ii) Below – Person working around boathouse/working platform	(i) Above – person walking along Gourley Ave (ii) Below – Person in carpark	Person working around boathouse/working platforms	Person walking down Gourley Ave	Person working around boathouse/working platforms	(i) Above – person walking along Gourley Ave (ii) Below – Person walking along pathway
Duration of Use of area Affected (Temporal Probability)	(i) Above 2 minutes/day 1.4×10^{-3} (ii) Below 8 hours/day 3.3×10^{-1}	(i) Above 2 minutes/day 1.4×10^{-3} (ii) Below 5 minute/day 3.5×10^{-3}	8 hours/day 3.3×10^{-1}	2 minutes/day 1.4×10^{-3}	2 hours/day 8.3×10^{-2}	(i) Above 2 minutes/day 1.4×10^{-3} (ii) Below 2 minute/day 1.4×10^{-3}
Probability of not Evacuating Area Affected	(i) 1.0 (ii) 1.0	(i) 0.1 (ii) 0.1	1.0	1.0	0.1	(i) 0.1 (ii) 0.1
Spatial Probability	6m length (~1x max embankment height) over total 40m, $6/40 = 0.15$	3m length (~1x max likely soil height) over total 40m, $3/40 = 0.01$	Approximate average width of boulder ~1m wide. Say 1 boulder fails over total 40m, $1/40 = 0.01$	Total length of outcrops 40m, say 2m wide block falls, $2/40 = 0.05$	3m length (~2x max height) over total 28m, $3/28 = 0.11$	2m length (~1x max height) over total 50m, $3/40 = 0.04$
Vulnerability to Life if Failure Occurs Whilst Person Present	(i) 0.8 (ii) 1.0	(i) 0.2 (ii) 0.5	1.0	1.0	0.1	0.1
Risk for Person most at Risk	(i) 1.7×10^{-9} (ii) 5.0×10^{-7}	(i) 2.8×10^{-10} (ii) 1.8×10^{-9}	3.3×10^{-7}	7.0×10^{-9}	9.1×10^{-9}	(i) 5.6×10^{-9} (ii) 5.6×10^{-9}
Combined total Risk	8.7×10^{-7}					

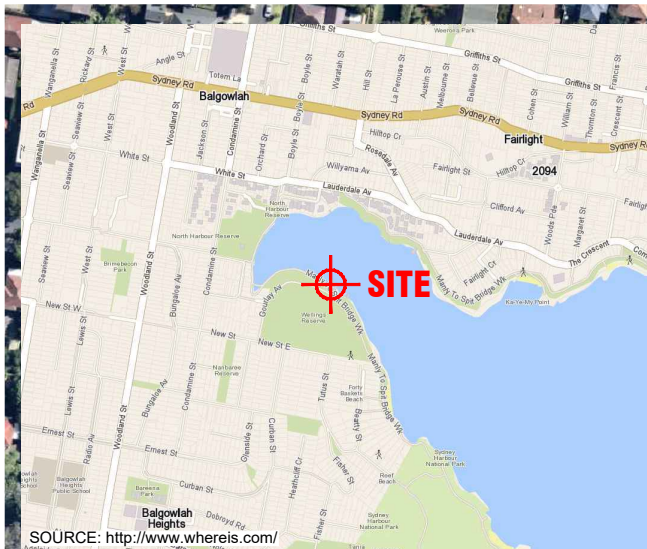


AERIAL IMAGE SOURCE: MAPS.AU.NEARMAP.COM

Title:		SITE LOCATION PLAN	
Location:		GOURLAY AVENUE, BALGOWLAH, NSW	
Report No:		36597S	Figure No: 1
JKGeotechnics			

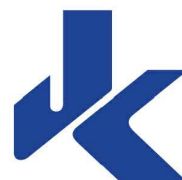


This plan should be read in conjunction with the JK Geotechnics report.

PLOT DATE: 26/03/2024 9:57:33 AM DWG FILE: J:\6F GEOTECHNICAL JOBS\3600\36597\SM BALGOWLAH\CAD\36597S.DWG

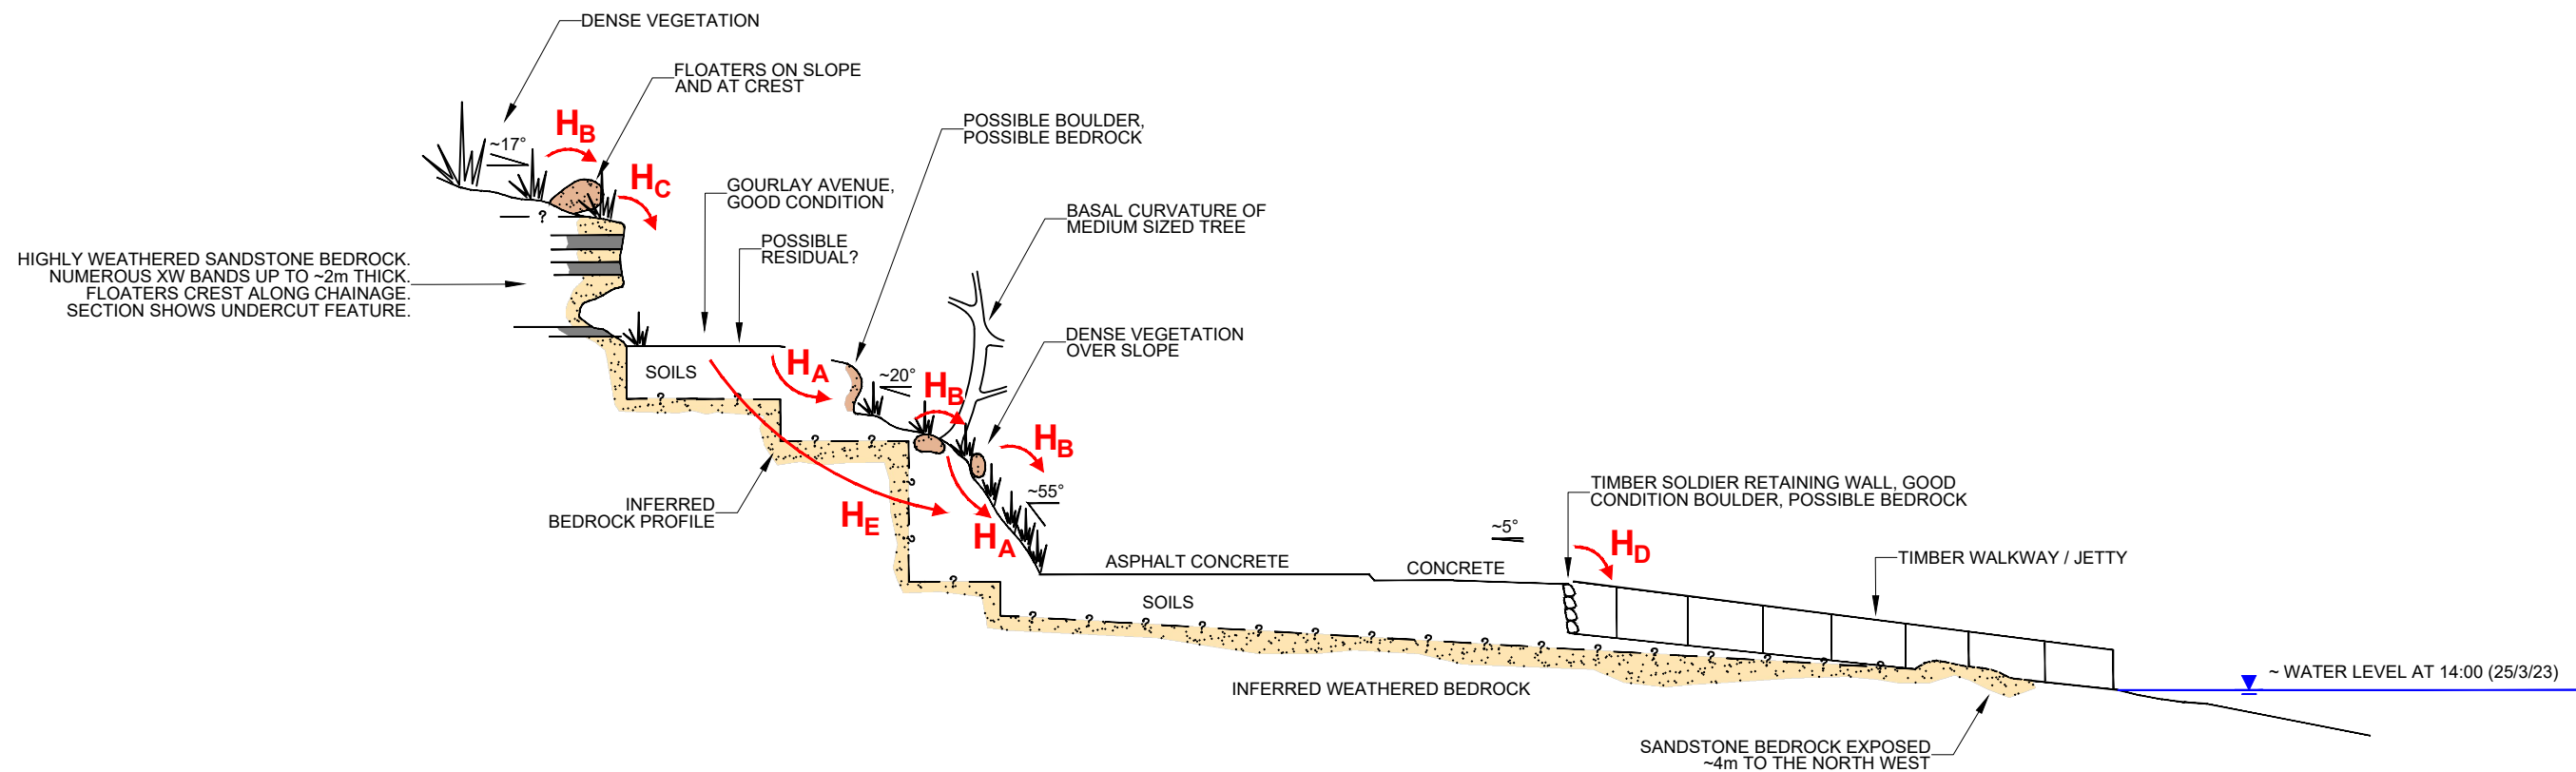

- LEGEND**
- GEOTECHNICAL HAZARD
 - INFERRED GEOTECHNICAL BOUNDARY
 - SANDSTONE OUTCROP
 - SANDSTONE BOULDER



This plan should be read in conjunction with the JK Geotechnics report.

Title: SECTION A-A'	
Location: GOURLAY AVENUE, BALGOWLAH, NSW	
Report No: 36597S	Figure No: 4
JKGeotechnics	



TOPOGRAPHY


Symbol Ground Profile

		convex	}	well defined or angular break of slope
		concave		
		convex	}	poorly defined or smooth change of slope
		concave		
		breaks of slope	}	convex and concave too close together to allow the use of separate symbols
		changes of slope		
		sharp	}	ridge crest
		rounded		
		Cliff or escarpment or sharp break 40° or more (estimated height in metres)		
		Uniform Slope	}	Slope direction and angle (Degrees)
		Concave Slope		
		Convex Slope		
		Top	}	Cut or fill slope, arrows pointing down slope
		Bottom		
		Hummocky or irregular ground		


OTHER FEATURES

	Boulder
	Seepage/spring
	Swallow hole for runoff
	Natural water course
	Open drain, unlined
	Open drain, lined
	Fenceline
	Property boundary
	Dry Stone Wall
	Major joint in rock face (opening in millimetres)
	Tension crack (opening in millimetres)
	Masonry or concrete wall
	Ponding water
	Boggy or swampy area

EXAMPLE OF USE OF TOPOGRAPHIC SYMBOLS:

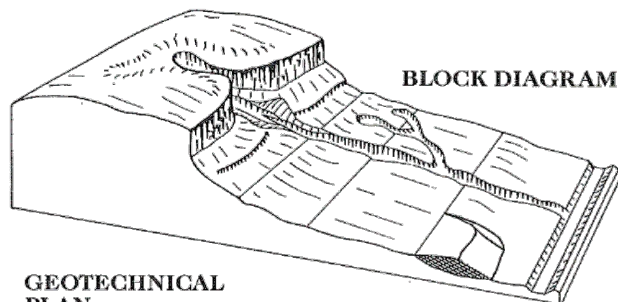


GEOTECHNICAL PLAN

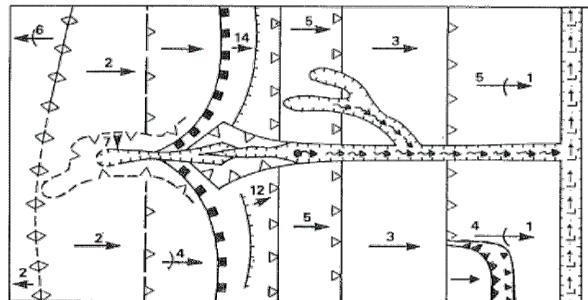

(After Gardiner, V & Dackombe, R. V.
(1983), Geomorphological Field Manual;
George Allen & Unwin).

Title:	GEOTECHNICAL MAPPING SYMBOLS	
Location:	GOURLAY AVENUE, BALGOWLAH, NSW	
Report No:	36597S	Figure No: 5
JKGeotechnics		

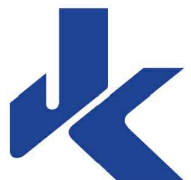

This plan should be read in conjunction with the JK Geotechnics report.



APPENDIX A

**LANDSLIDE RISK
MANAGEMENT
TERMINOLOGY**

LANDSLIDE RISK MANAGEMENT

Definition of Terms and Landslide Risk

Risk Terminology	Description
Acceptable Risk	A risk for which, for the purposes of life or work, we are prepared to accept as it is with no regard to its management. Society does not generally consider expenditure in further reducing such risks justifiable.
Annual Exceedance Probability (AEP)	The estimated probability that an event of specified magnitude will be exceeded in any year.
Consequence	The outcomes or potential outcomes arising from the occurrence of a landslide expressed qualitatively or quantitatively, in terms of loss, disadvantage or gain, damage, injury or loss of life.
Elements at Risk	The population, buildings and engineering works, economic activities, public services utilities, infrastructure and environmental features in the area potentially affected by landslides.
Frequency	A measure of likelihood expressed as the number of occurrences of an event in a given time. See also 'Likelihood' and 'Probability'.
Hazard	A condition with the potential for causing an undesirable consequence (the landslide). The description of landslide hazard should include the location, volume (or area), classification and velocity of the potential landslides and any resultant detached material, and the likelihood of their occurrence within a given period of time.
Individual Risk to Life	The risk of fatality or injury to any identifiable (named) individual who lives within the zone impacted by the landslide; or who follows a particular pattern of life that might subject him or her to the consequences of the landslide.
Landslide Activity	The stage of development of a landslide; pre failure when the slope is strained throughout but is essentially intact; failure characterised by the formation of a continuous surface of rupture; post failure which includes movement from just after failure to when it essentially stops; and reactivation when the slope slides along one or several pre-existing surfaces of rupture. Reactivation may be occasional (eg. seasonal) or continuous (in which case the slide is 'active').
Landslide Intensity	A set of spatially distributed parameters related to the destructive power of a landslide. The parameters may be described quantitatively or qualitatively and may include maximum movement velocity, total displacement, differential displacement, depth of the moving mass, peak discharge per unit width, or kinetic energy per unit area.
Landslide Risk	The AGS Australian GeoGuide LR7 (AGS, 2007e) should be referred to for an explanation of Landslide Risk.
Landslide Susceptibility	The classification, and volume (or area) of landslides which exist or potentially may occur in an area or may travel or retrogress onto it. Susceptibility may also include a description of the velocity and intensity of the existing or potential landsliding.
Likelihood	Used as a qualitative description of probability or frequency.
Probability	A measure of the degree of certainty. This measure has a value between zero (impossibility) and 1.0 (certainty). It is an estimate of the likelihood of the magnitude of the uncertain quantity, or the likelihood of the occurrence of the uncertain future event. These are two main interpretations: (i) Statistical – frequency or fraction – The outcome of a repetitive experiment of some kind like flipping coins. It includes also the idea of population variability. Such a number is called an 'objective' or relative frequentist probability because it exists in the real world and is in principle measurable by doing the experiment.

Risk Terminology	Description
Probability (continued)	(ii) Subjective probability (degree of belief) – Quantified measure of belief, judgment, or confidence in the likelihood of an outcome, obtained by considering all available information honestly, fairly, and with a minimum of bias. Subjective probability is affected by the state of understanding of a process, judgment regarding an evaluation, or the quality and quantity of information. It may change over time as the state of knowledge changes.
Qualitative Risk Analysis	An analysis which uses word form, descriptive or numeric rating scales to describe the magnitude of potential consequences and the likelihood that those consequences will occur.
Quantitative Risk Analysis	An analysis based on numerical values of the probability, vulnerability and consequences and resulting in a numerical value of the risk.
Risk	A measure of the probability and severity of an adverse effect to health, property or the environment. Risk is often estimated by the product of probability x consequences. However, a more general interpretation of risk involves a comparison of the probability and consequences in a non-product form.
Risk Analysis	The use of available information to estimate the risk to individual, population, property, or the environment, from hazards. Risk analyses generally contain the following steps: scope definition, hazard identification and risk estimation.
Risk Assessment	The process of risk analysis and risk evaluation.
Risk Control or Risk Treatment	The process of decision-making for managing risk and the implementation or enforcement of risk mitigation measures and the re-evaluation of its effectiveness from time to time, using the results of risk assessment as one input.
Risk Estimation	The process used to produce a measure of the level of health, property or environmental risks being analysed. Risk estimation contains the following steps: frequency analysis, consequence analysis and their integration.
Risk Evaluation	The stage at which values and judgments enter the decision process, explicitly or implicitly, by including consideration of the importance of the estimated risks and the associated social, environmental and economic consequences, in order to identify a range of alternatives for managing the risks.
Risk Management	The complete process of risk assessment and risk control (or risk treatment).
Societal Risk	The risk of multiple fatalities or injuries in society as a whole: one where society would have to carry the burden of a landslide causing a number of deaths, injuries, financial, environmental and other losses.
Susceptibility	See 'Landslide Susceptibility'.
Temporal Spatial Probability	The probability that the element at risk is in the area affected by the landsliding, at the time of the landslide.
Tolerable Risk	A risk within a range that society can live with so as to secure certain net benefits. It is a range of risk regarded as non-negligible and needing to be kept under review and reduced further if possible.
Vulnerability	The degree of loss to a given element or set of elements within the area affected by the landslide hazard. It is expressed on a scale of 0 (no loss) to 1 (total loss). For property, the loss will be the value of the damage relative to the value of the property; for persons, it will be the probability that a particular life (the element at risk) will be lost, given the person(s) is affected by the landslide.

NOTE: Reference should be made to Figure A1 which shows the inter-relationship of many of these terms and the relevant portion of Landslide Risk Management.

Reference should also be made to the paper referenced below for Landslide Terminology and more detailed discussion of the above terminology.

This appendix is an extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

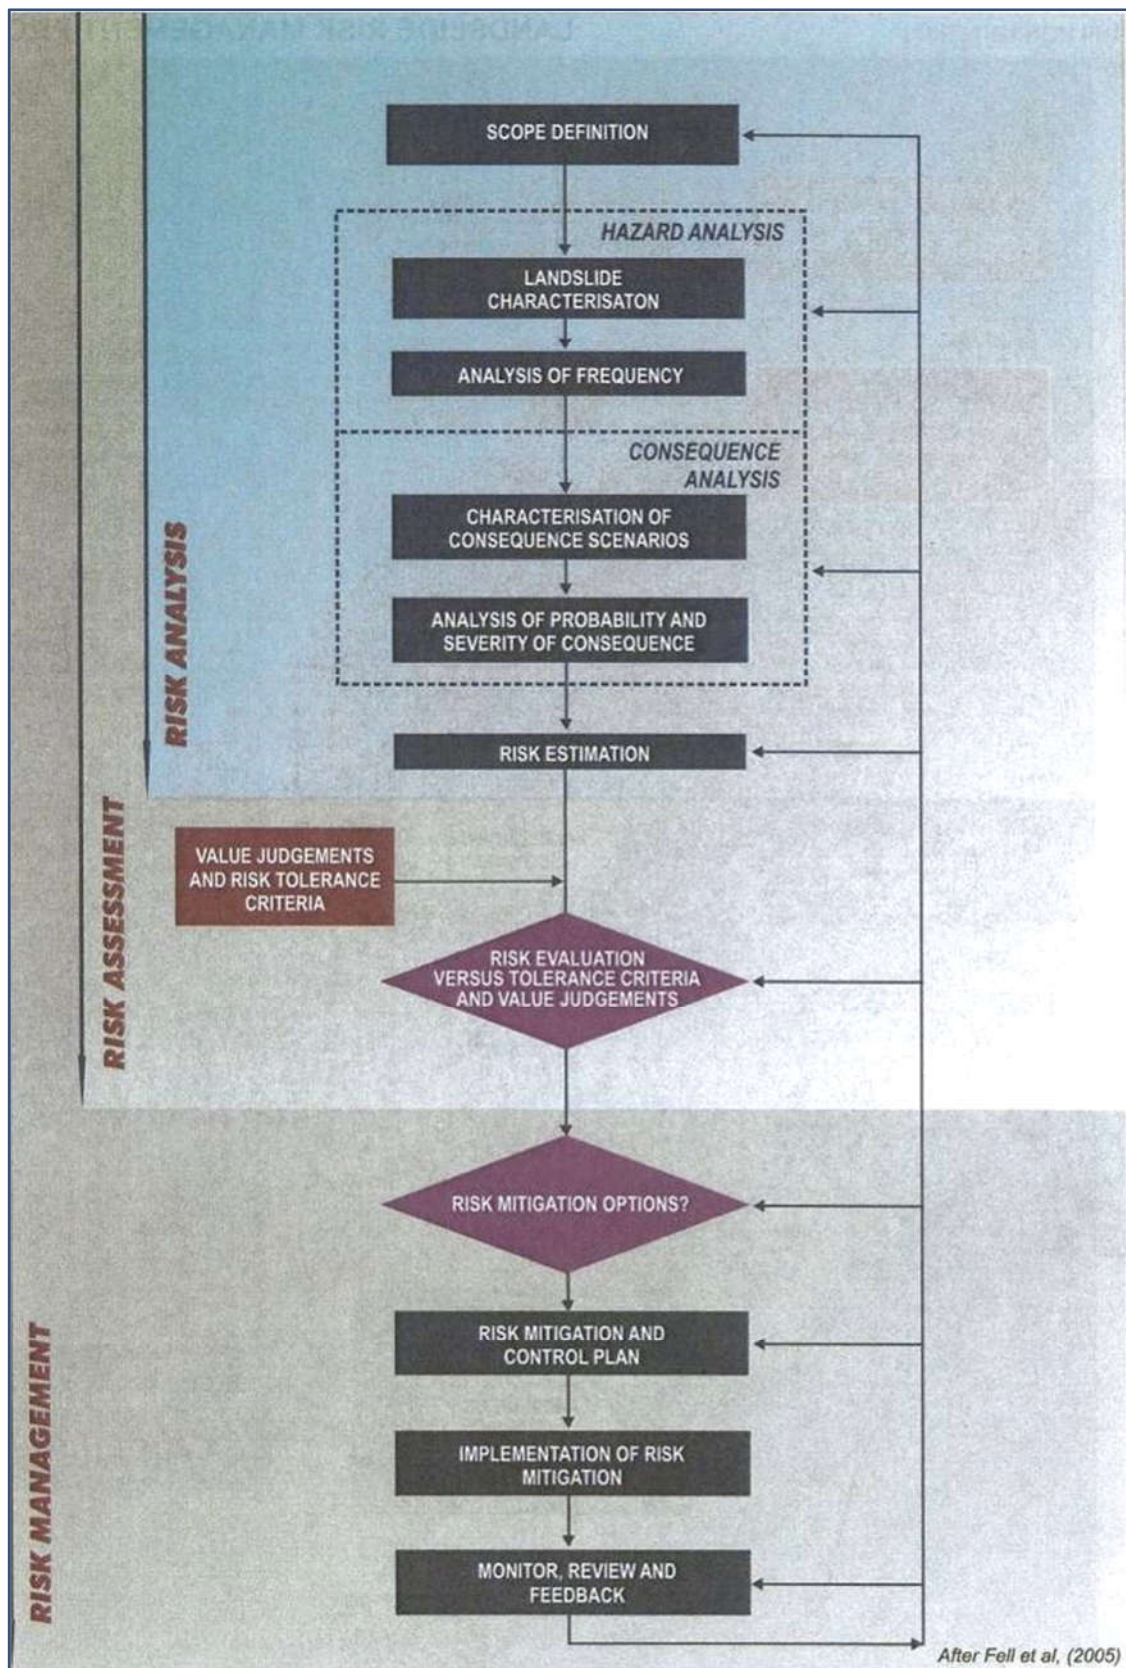


FIGURE A1: Flowchart for Landslide Risk Management.

This figure is an extract from GUIDELINE FOR LANDSLIDE SUSCEPTIBILITY, HAZARD AND RISK ZONING FOR LAND USE PLANNING, as presented in Australian Geomechanics Vol 42, No 1, March 2007, which discusses the matter more fully.

TABLE A1: LANDSLIDE RISK ASSESSMENT
QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY

QUALITATIVE MEASURES OF LIKELIHOOD

Approximate Annual Probability		Implied Indicative Landslide Recurrence Interval		Description	Descriptor	Level
Indicative Value	Notional Boundary					
10 ⁻¹	5×10 ⁻²	10 years	20 years	The event is expected to occur over the design life.	ALMOST CERTAIN	A
10 ⁻²		100 years		The event will probably occur under adverse conditions over the design life.	LIKELY	B
10 ⁻³	5×10 ⁻³	1000 years	200 years	The event could occur under adverse conditions over the design life.	POSSIBLE	C
10 ⁻⁴	5×10 ⁻⁴	10,000 years	2000 years	The event might occur under very adverse circumstances over the design life.	UNLIKELY	D
10 ⁻⁵	5×10 ⁻⁵	100,000 years	20,000 years	The event is conceivable but only under exceptional circumstances over the design life.	RARE	E
10 ⁻⁶	5×10 ⁻²	1,000,000 years	200,000 years	The event is inconceivable or fanciful over the design life.	BARELY CREDIBLE	F

Note: (1) The table should be used from left to right; use Approximate Annual Probability or Description to assign Descriptor, not *vice versa*.

QUALITATIVE MEASURES OF CONSEQUENCES TO PROPERTY

Approximate cost of Damage		Description	Descriptor	Level
Indicative Value	Notional Boundary			
200%	100%	Structure(s) completely destroyed and/or large scale damage requiring major engineering works for stabilisation. Could cause at least one adjacent property major consequence damage.	CATASTROPHIC	1
60%		Extensive damage to most of structure, and/or extending beyond site boundaries requiring significant stabilisation works. Could cause at least one adjacent property medium consequence damage.	MAJOR	2
20%	40%	Moderate damage to some of structure, and/or significant part of site requiring large stabilisation works. Could cause at least one adjacent property minor consequence damage.	MEDIUM	3
5%	10%	Limited damage to part of structure, and/or part of site requiring some reinstatement stabilisation works.	MINOR	4
0.5%	1%	Little damage. (Note for high probability event (Almost Certain), this category may be subdivided at a notional boundary of 0.1%. See Risk Matrix.)	INSIGNIFICANT	5

Notes: (2) The Approximate Cost of Damage is expressed as a percentage of market value, being the cost of the improved value of the unaffected property which includes the land plus the unaffected structures.

(3) The Approximate Cost is to be an estimate of the direct cost of the damage, such as the cost of reinstatement of the damaged portion of the property (land plus structures), stabilisation works required to render the site to tolerable risk level for the landslide which has occurred and professional design fees, and consequential costs such as legal fees, temporary accommodation. It does not include additional stabilisation works to address other landslides which may affect the property.

(4) The table should be used from left to right; use Approximate Cost of Damage or Description to assign Descriptor, not *vice versa*.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

TABLE A1: LANDSLIDE RISK ASSESSMENT
QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY (continued)

QUALITATIVE RISK ANALYSIS MATRIX – LEVEL OF RISK TO PROPERTY

LIKELIHOOD		CONSEQUENCES TO PROPERTY (With Indicative Approximate Cost of Damage)				
	Indicative Value of Approximate Annual Probability	1: CATASTROPHIC 200%	2: MAJOR 60%	3: MEDIUM 20%	4: MINOR 5%	5: INSIGNIFICANT 0.5%
A – ALMOST CERTAIN	10^{-1}	VH	VH	VH	H	M or L (5)
B – LIKELY	10^{-2}	VH	VH	H	M	L
C – POSSIBLE	10^{-3}	VH	H	M	M	VL
D – UNLIKELY	10^{-4}	H	M	L	L	VL
E – RARE	10^{-5}	M	L	L	VL	VL
F – BARELY CREDIBLE	10^{-6}	L	VL	VL	VL	VL

Notes: (5) Cell A5 may be subdivided such that a consequence of less than 0.1% is Low Risk.
(6) When considering a risk assessment it must be clearly stated whether it is for existing conditions or with risk control measures which may not be implemented at the current time.

RISK LEVEL IMPLICATIONS

Risk Level		Example Implications (7)
VH	VERY HIGH RISK	Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low; may be too expensive and not practical. Work likely to cost more than value of the property.
H	HIGH RISK	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to Low. Work would cost a substantial sum in relation to the value of the property.
M	MODERATE RISK	May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as practicable.
L	LOW RISK	Usually acceptable to regulators. Where treatment has been required to reduce the risk to this level, ongoing maintenance is required.
VL	VERY LOW RISK	Acceptable. Manage by normal slope maintenance procedures.

Note: (7) The implications for a particular situation are to be determined by all parties to the risk assessment and may depend on the nature of the property at risk; these are only given as a general guide.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

AUSTRALIAN GEOGUIDE LR2 (LANDSLIDES)

What is a Landslide?

Any movement of a mass of rock, debris, or earth, down a slope, constitutes a “landslide”. Landslides take many forms, some of which are illustrated. More information can be obtained from Geoscience Australia, or by visiting its Australian landslide Database at www.ga.gov.au/urban/factsheets/landslide.jsp. Aspects of the impact of landslides on buildings are dealt with in the book “Guideline Document Landslide Hazards” published by the Australian Building Codes Board and referenced in the Building Code of Australia. This document can be purchased over the internet at the Australian Building Codes Board’s website www.abcb.gov.au.

Landslides vary in size. They can be small and localised or very large, sometimes extending for kilometres and involving millions of tonnes of soil or rock. It is important to realise that even a 1 cubic metre boulder of soil, or rock, weighs at least 2 tonnes. If it falls, or slides, it is large enough to kill a person, crush a car, or cause serious structural damage to a house. The material in a landslide may travel downhill well beyond the point where the failure first occurred, leaving destruction in its wake. It may also leave an unstable slope in the ground behind it, which has the potential to fall again, causing the landslide to extend (regress) uphill, or expand sideways. For all these reasons, both “potential” and “actual” landslides must be taken very seriously. They present a real threat to life and property and require proper management.

Identification of landslide risk is a complex task and must be undertaken by a geotechnical practitioner (GeoGuide LR1) with specialist experience in slope stability assessment and slope stabilisation.

What Causes a Landslide?

Landslides occur as a result of local geological and groundwater conditions, but can be exacerbated by inappropriate development (GeoGuide LR8), exceptional weather, earthquakes and other factors. Some slopes and cliffs never seem to change, but are actually on the verge of failing. Others, often moderate slopes (Table 1), move continuously, but so slowly that it is not apparent to a casual observer. In both cases, small changes in conditions can trigger a landslide with serious consequences. Wetting up of the ground (which may involve a rise in groundwater table) is the single most important cause of landslides (GeoGuide LR5). This is why they often occur during, or soon after, heavy rain. Inappropriate development often results in small scale landslides which are very expensive in human terms because of the proximity of housing and people.

Does a Landslide Affect You?

Any slope, cliff, cutting, or fill embankment may be a hazard which has the potential to impact on people, property, roads and services. Some tell-tale signs that might indicate that a landslide is occurring are listed below:

- Open cracks, or steps, along contours
- Groundwater seepage, or springs
- Bulging in the lower part of the slope
- Hummocky ground
- trees leaning down slope, or with exposed roots
- debris/fallen rocks at the foot of a cliff
- tilted power poles, or fences
- cracked or distorted structures

These indications of instability may be seen on almost any slope and are not necessarily confined to the steeper ones (Table 1). Advice should be sought from a geotechnical practitioner if any of them are observed. Landslides do not respect property boundaries. As mentioned above they can “run-out” from above, “regress” from below, or expand sideways, so a landslide hazard affecting your property may actually exist on someone else’s land.

Local councils are usually aware of slope instability problems within their jurisdiction and often have specific development and maintenance requirements. **Your local council is the first place to make enquiries if you are responsible for any sort of development or own or occupy property on or near sloping land or a cliff.**

TABLE 1 – Slope Descriptions

Appearance	Slope Angle	Maximum Gradient	Slope Characteristics
Gentle	0° - 10°	1 on 6	Easy walking.
Moderate	10° - 18°	1 on 3	Walkable. Can drive and manoeuvre a car on driveway.
Steep	18° - 27°	1 on 2	Walkable with effort. Possible to drive straight up or down roughened concrete driveway, but cannot practically manoeuvre a car.
Very Steep	27° - 45°	1 on 1	Can only climb slope by clutching at vegetation, rocks, etc.
Extreme	45° - 64°	1 on 0.5	Need rope access to climb slope.
Cliff	64° - 84°	1 on 0.1	Appears vertical. Can abseil down.
Vertical or Overhang	84° - 90±°	Infinite	Appears to overhang. Abseiler likely to lose contact with the face.

Some typical landslides which could affect residential housing are illustrated below:

Rotational or circular slip failures (Figure 1) - can occur on moderate to very steep soil and weathered rock slopes (Table 1). The sliding surface of the moving mass tends to be deep seated. Tension cracks may open at the top of the slope and bulging may occur at the toe. The ground may move in discrete "steps" separated by long periods without movement. More rapid movement may occur after heavy rain.

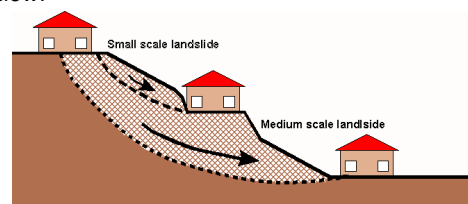


Figure 1

Translational slip failures (Figure 2) - tend to occur on moderate to very steep slopes (Table 1) where soil, or weak rock, overlies stronger strata. The sliding mass is often relatively shallow. It can move, or deform slowly (creep) over long periods of time. Extensive linear cracks and hummocks sometimes form along the contours. The sliding mass may accelerate after heavy rain.

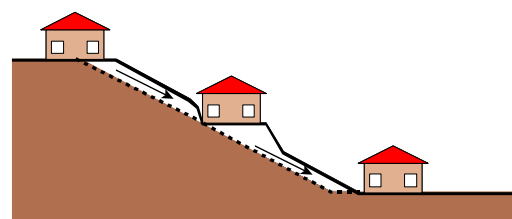


Figure 2

Wedge failures (Figure 3) - normally only occur on extreme slopes, or cliffs (Table 1), where discontinuities in the rock are inclined steeply downwards out of the face.

Rock falls (Figure 3) - tend to occur from cliffs and overhangs (Table 1).

Cliffs may remain, apparently unchanged, for hundreds of years. Collections of boulders at the foot of a cliff may indicate that rock falls are ongoing. Wedge failures and rock falls do not "creep". Familiarity with a particular local situation can instil a false sense of security since failure, when it occurs, is usually sudden and catastrophic.

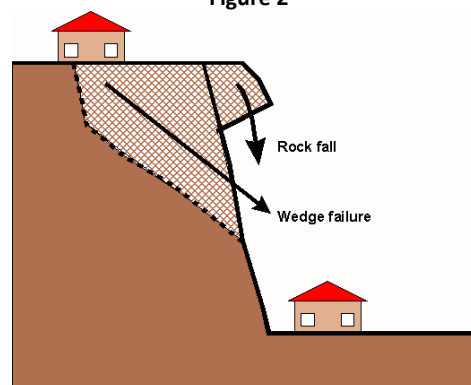


Figure 3

Debris flows and mud slides (Figure 4) - may occur in the foothills of ranges, where erosion has formed valleys which slope down to the plains below. The valley bottoms are often lined with loose eroded material (debris) which can "flow" if it becomes saturated during and after heavy rain. Debris flows are likely to occur with little warning; they travel a long way and often involve large volumes of soil. The consequences can be devastating.

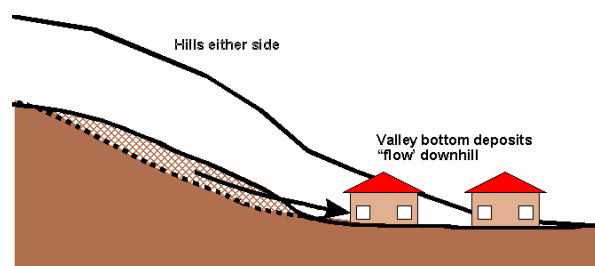


Figure 4

More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 - Introduction
- GeoGuide LR3 - Soil Slopes
- GeoGuide LR4 - Rock Slopes
- GeoGuide LR5 - Water & Drainage
- GeoGuide LR6 - Retaining Walls
- GeoGuide LR7 - Landslide Risk
- GeoGuide LR8 - Hillside Construction
- GeoGuide LR9 - Effluent & Surface Water Disposal
- GeoGuide LR10 - Coastal Landslides
- GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the [Australian Geomechanics Society](#), a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.

AUSTRALIAN GEOGUIDE LR7 (LANDSLIDE RISK)

Concept of Risk

Risk is a familiar term, but what does it really mean? It can be defined as *"a measure of the probability and severity of an adverse effect to health, property, or the environment."* This definition may seem a bit complicated. In relation to landslides, geotechnical practitioners (see GeoGuide LR1) are required to assess risk in terms of the likelihood that a particular landslide will occur and the possible consequences. This is called landslide risk assessment. The consequences of a landslide are many and varied, but our concerns normally focus on loss of, or damage to, property and loss of life.

Landslide Risk Assessment

Some local councils in Australia are aware of the potential for landslides within their jurisdiction and have responded by designating specific **"landslide hazard zones"**. Development in these areas is normally covered by special regulations. If you are contemplating building, or buying an existing house, particularly in a hilly area, or near cliffs, then go first for information to your local council.

Landslide risk assessment must be undertaken by a geotechnical practitioner. It may involve visual inspection, geological mapping, geotechnical investigation and monitoring to identify:

- potential landslides (there may be more than one that could impact on your site);
- the likelihood that they will occur;
- the damage that could result;
- the cost of disruption and repairs; and
- the extent to which lives could be lost.

Risk assessment is a predictive exercise, but since the ground and the processes involved are complex, prediction tends to lack precision. If you commission a landslide risk assessment

for a particular site you should expect to receive a report prepared in accordance with current professional guidelines and in a form that is acceptable to your local council, or planning authority.

Risk to Property

Table 1 indicates the terms used to describe risk to property. Each risk level depends on an assessment of how likely a landslide is to occur and its consequences in dollar terms. "Likelihood" is the chance of it happening in any one year, as indicated in Table 2. "Consequences" are related to the cost of the repairs and temporary loss of use if the landslide occurs. These two factors are combined by the geotechnical practitioner to determine the Qualitative Risk.

TABLE 2 – LIKELIHOOD

Likelihood	Annual Probability
Almost Certain	1:10
Likely	1:100
Possible	1:1,000
Unlikely	1:10,000
Rare	1:100,000
Barely credible	1:1,000,000

The terms "unacceptable", "may be tolerable" etc. in Table 1 indicate how most people react to an assessed risk level. However, some people will always be more prepared, or better able, to tolerate a higher risk level than others.

Some local councils and planning authorities stipulate a maximum tolerable risk level of risk to property for developments within their jurisdictions. In these situations the risk must be assessed by a geotechnical practitioner. If stabilisation works are needed to meet the stipulated requirements these will normally have to be carried out as part of the development, or consent will be withheld.

TABLE 1 – RISK TO PROPERTY

Qualitative Risk		Significance - Geotechnical engineering requirements
Very high	VH	Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low. May be too expensive and not practical. Work likely to cost more than the value of the property.
High	H	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to acceptable level. Work would cost a substantial sum in relation to the value of the property.
Moderate	M	May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as possible.
Low	L	Usually acceptable to regulators. Where treatment has been needed to reduce the risk to this level, ongoing maintenance is required.
Very Low	VL	Acceptable. Manage by normal slope maintenance procedures.

Risk to Life

Most of us have some difficulty grappling with the concept of risk and deciding whether, or not, we are prepared to accept it. However, without doing any sort of analysis, or commissioning a report from an "expert", we all take risks every day. One of them is the risk of being killed in an accident. This is worth thinking about, because it tells us a lot about ourselves and can help to put an assessed risk into a meaningful context. By identifying activities that we either are, or are not, prepared to engage in, we can get some indication of the maximum level of risk that we are prepared to take. This knowledge can help us to decide whether we really are able to accept a particular risk, or to tolerate a particular likelihood of loss, or damage, to our property (Table 2).

In Table 3, data from NSW for the years 1998 to 2002, and other sources, is presented. A risk of 1 in 100,000 means that, in any one year, 1 person is killed for every 100,000 people undertaking that particular activity. The NSW data assumes that the whole population undertakes the activity. That is, we are all at risk of being killed in a fire, or of choking on our food, but it is reasonable to assume that only people who go deep sea fishing run a risk of being killed while doing it.

It can be seen that the risks of dying as a result of falling, using a motor vehicle, or engaging in water-related activities (including bathing) are all greater than 1:100,000 and yet few people actively avoid situations where these risks are present. Some people are averse to flying and yet it represents a lower risk than choking to death on food. The data also indicate that, even when the risk of dying as a consequence of a particular event is very small, it could still happen to any one of us today. If this were not so, there would be no risk at all and clearly that is not the case.

In NSW, the planning authorities consider that 1:1,000,000 is the maximum tolerable risk for domestic housing built near an obvious hazard, such as a chemical factory. Although not specifically considered in the NSW guidelines there is little difference between the hazard presented by a neighbouring factory and a landslide: both have the capacity to destroy life and property and both are always present.

TABLE 3 – RISK TO LIFE

Risk (deaths per participant per year)	Activity/Event Leading to Death (NSW data unless noted)
1:1,000	Deep sea fishing (UK)
1:1,000 to 1:10,000	Motor cycling, horse riding, ultra-light flying (Canada)
1:23,000	Motor vehicle use
1:30,000	Fall
1:70,000	Drowning
1:180,000	Fire/burn
1:660,000	Choking on food
1:1,000,000	Scheduled airlines (Canada)
1:2,300,000	Train travel
1:32,000,000	Lightning strike

More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 - Introduction
- GeoGuide LR3 - Soil Slopes
- GeoGuide LR4 - Rock Slopes
- GeoGuide LR5 - Water & Drainage
- GeoGuide LR6 - Retaining Walls
- GeoGuide LR7 - Landslide Risk
- GeoGuide LR8 - Hillside Construction
- GeoGuide LR9 - Effluent & Surface Water Disposal
- GeoGuide LR10 - Coastal Landslides
- GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the Australian Geomechanics Society, a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.



APPENDIX B

SOME GUIDELINES FOR HILLSIDE CONSTRUCTION



SOME GUIDELINES FOR HILLSIDE CONSTRUCTION


GOOD ENGINEERING PRACTICE		POOR ENGINEERING PRACTICE
ADVICE		
GEOTECHNICAL ASSESSMENT	Obtain advice from a qualified, experienced geotechnical consultant at early stage of planning and before site works.	Prepare detailed plan and start site works before geotechnical advice.
PLANNING		
SITE PLANNING	Having obtained geotechnical advice, plan the development with the risk arising from the identified hazards and consequences in mind.	Plan development without regard for the Risk.
DESIGN AND CONSTRUCTION		
HOUSE DESIGN	Use flexible structures which incorporate properly designed brickwork, timber or steel frames, timber or panel cladding. Consider use of split levels. Use decks for recreational areas where appropriate.	Floor plans which require extensive cutting and filling. Movement intolerant structures.
SITE CLEARING	Retain natural vegetation wherever practicable.	Indiscriminately clear the site.
ACCESS & DRIVEWAYS	Satisfy requirements below for cuts, fills, retaining walls and drainage. Council specifications for grades may need to be modified. Driveways and parking areas may need to be fully supported on piers.	Excavate and fill for site access before geotechnical advice.
EARTHWORKS	Retain natural contours wherever possible.	Indiscriminant bulk earthworks.
CUTS	Minimise depth. Support with engineered retaining walls or batter to appropriate slope. Provide drainage measures and erosion control.	Large scale cuts and benching. Unsupported cuts. Ignore drainage requirements.
FILLS	Minimise height. Strip vegetation and topsoil and key into natural slopes prior to filling. Use clean fill materials and compact to engineering standards. Batter to appropriate slope or support with engineered retaining wall. Provide surface drainage and appropriate subsurface drainage.	Loose or poorly compacted fill, which if it fails, may flow a considerable distance (including onto properties below). Block natural drainage lines. Fill over existing vegetation and topsoil. Include stumps, trees, vegetation, topsoil, boulders, building rubble etc. in fill.
ROCK OUTCROPS & BOULDERS	Remove or stabilise boulders which may have unacceptable risk. Support rock faces where necessary.	Disturb or undercut detached blocks or boulders.
RETAINING WALLS	Engineer design to resist applied soil and water forces. Found on bedrock where practicable. Provide subsurface drainage within wall backfill and surface drainage on slope above. Construct wall as soon as possible after cut/fill operation.	Construct a structurally inadequate wall such as sandstone flagging, brick or unreinforced blockwork. Lack of subsurface drains and weepholes.
FOOTINGS	Found within bedrock where practicable. Use rows of piers or strip footings oriented up and down slope. Design for lateral creep pressures if necessary. Backfill footing excavations to exclude ingress of surface water.	Found on topsoil, loose fill, detached boulders or undercut cliffs.
SWIMMING POOLS	Engineer designed. Support on piers to rock where practicable. Provide with under-drainage and gravity drain outlet where practicable. Design for high soil pressures which may develop on uphill side whilst there may be little or no lateral support on downhill side.	
DRAINAGE SURFACE	Provide at tops of cut and fill slopes. Discharge to street drainage or natural water courses. Provide generous falls to prevent blockage by siltation and incorporate silt traps. Line to minimise infiltration and make flexible where possible. Special structures to dissipate energy at changes of slope and/or direction.	Discharge at top of fills and cuts. Allow water to pond bench areas.
SUBSURFACE	Provide filter around subsurface drain. Provide drain behind retaining walls. Use flexible pipelines with access for maintenance. Prevent inflow of surface water.	Discharge of roof run-off into absorption trenches.
SEPTIC & SULLAGE	Usually requires pump-out or mains sewer systems; absorption trenches may be possible in some areas if risk is acceptable. Storage tanks should be water-tight and adequately founded.	Discharge sullage directly onto and into slopes. Use of absorption trenches without consideration of landslide risk.
EROSION CONTROL & LANDSCAPING	Control erosion as this may lead to instability. Revegetate cleared area.	Failure to observe earthworks and drainage recommendations when landscaping.
DRAWINGS AND SITE VISITS DURING CONSTRUCTION		
DRAWINGS	Building Application drawings should be viewed by a geotechnical consultant.	
SITE VISITS	Site visits by consultant may be appropriate during construction.	
INSPECTION AND MAINTENANCE BY OWNER		
OWNER'S RESPONSIBILITY	Clean drainage systems; repair broken joints in drains and leaks in supply pipes. Where structural distress is evident seek advice. If seepage observed, determine cause or seek advice on consequences.	

This table is extracted from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in *Australian Geomechanics*, Vol 42, No 1, March 2007 which discusses the matter more fully.

AUSTRALIAN GEOGUIDE LR8 (CONSTRUCTION PRACTICE)

Sensible development practices are required when building on hillsides, particularly if the hillside has more than a low risk of instability (GeoGuide LR7). Only building techniques intended to maintain, or reduce, the overall level of landslide risk should be considered. Examples of good hillside construction practice are illustrated below.

EXAMPLES FOR **GOOD** HILLSIDE CONSTRUCTION PRACTICE

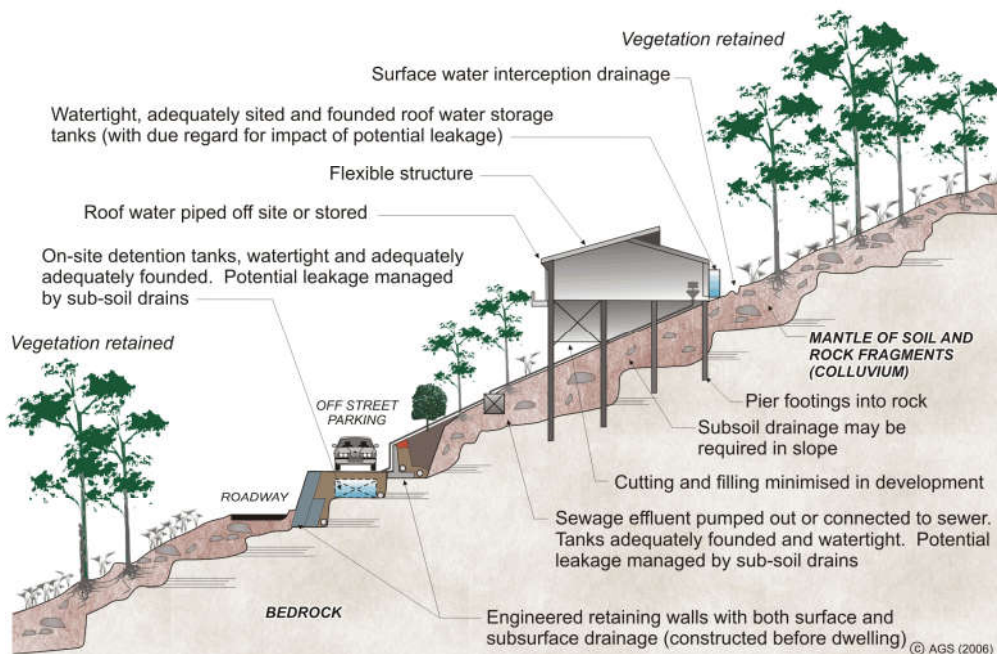

WHY ARE THESE PRACTICES GOOD?

Roadways and parking areas - are paved and incorporate kerbs which prevent water discharging straight into the hillside (GeoGuide LR5).

Cuttings - are supported by retaining walls (GeoGuide LR6).

Retaining walls - are engineer designed to withstand the lateral earth pressures and surcharges expected, and include drains to prevent water pressures developing in the backfill. Where the ground slopes steeply down towards the high side of a retaining wall, the disturbing force (see GeoGuide LR6) can be two or more times that due to level ground. Retaining walls must be designed taking these forces into account.

Sewage - whether treated or not is either taken away in pipes or contained in properly founded tanks so it cannot soak into the ground.

Surface water - from roofs and other hard surfaces is piped away to a suitable discharge point rather than being allowed to infiltrate into the ground. Preferably, the discharge point will be in a natural creek where ground water exits, rather than enters, the ground. Shallow, lined, drains on the surface can fulfill the same purpose (GeoGuide LR5).

Surface loads - are minimised. No fill embankments have been built. The house is a lightweight structure. Foundation loads have been taken down below the level at which a landslide is likely to occur and, preferably, to rock. This sort of construction is probably not applicable to soil slopes (GeoGuide LR3). If you are uncertain whether your site has rock near the surface, or is essentially a soil slope, you should engage a geotechnical practitioner to find out.


Flexible structures - have been used because they can tolerate a certain amount of movement with minimal signs of distress and maintain their functionality.

Vegetation clearance - on soil slopes has been kept to a reasonable minimum. Trees, and to a lesser extent smaller vegetation, take large quantities of water out of the ground every day. This lowers the ground water table, which in turn helps to maintain the stability of the slope. Large scale clearing can result in a rise in water table with a consequent increase in the likelihood of a landslide (GeoGuide LR5). An exception may have to be made to this rule on steep rock slopes where trees have little effect on the water table, but their roots pose a landslide hazard by dislodging boulders.

Possible effects of ignoring good construction practices are illustrated on page 2. Unfortunately, these poor construction practices are not as unusual as you might think and are often chosen because, on the face of it, they will save the developer, or owner, money. You should not lose sight of the fact that the cost and anguish associated with any one of the disasters illustrated, is likely to more than wipe out any apparent savings at the outset.

ADOPT GOOD PRACTICE ON HILLSIDE SITES

EXAMPLES FOR **POOR** HILLSIDE CONSTRUCTION PRACTICE

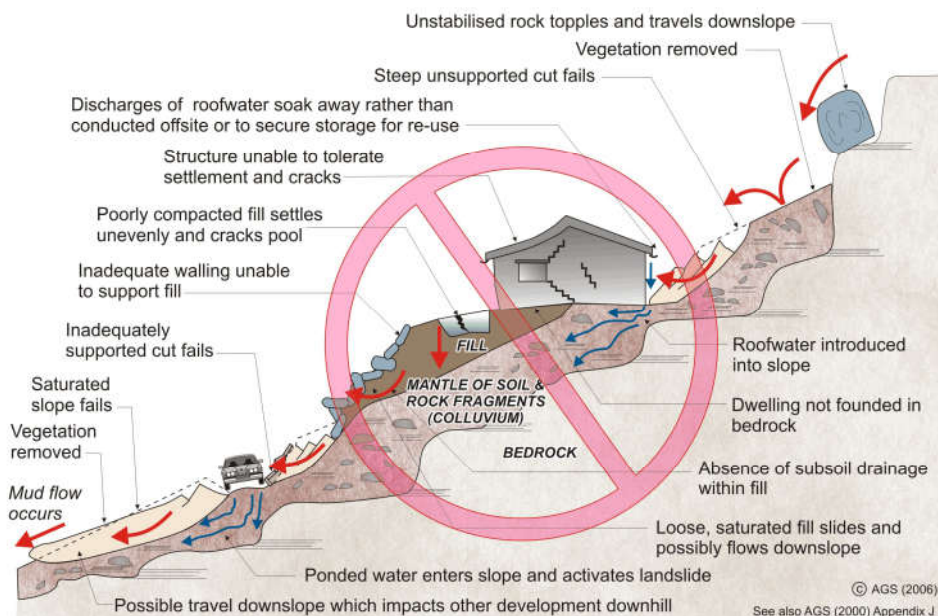

WHY ARE THESE PRACTICES POOR?

Roadways and parking areas - are unsurfaced and lack proper table drains (gutters) causing surface water to pond and soaks into the ground.

Cut and fill - has been used to balance earthworks quantities and level the site leaving unstable cut faces and added large surface loads to the ground. Failure to compact the fill properly has led to settlement, which will probably continue for several years after completion. The house and pool have been built on the fill and have settled with it and cracked. Leakage from the cracked pool and the applied surface loads from the fill have combined to cause landslides.

Retaining walls - have been avoided, to minimise cost, and hand placed rock walls used instead. Without applying engineering design principles, the walls have failed to provide the required support to the ground and have failed, creating a very dangerous situation.

A heavy, rigid, house - has been built on shallow, conventional, footings. Not only has the brickwork cracked because of the resulting ground movements, but it has also become involved in a man-made landslide.

Soak-away drainage - has been used for sewage and surface water run-off from roofs and pavements. This water soaks into the ground and raises the water table (GeoGuide LR5). Subsoil drains that run along the contours should be avoided for the same reason. If felt necessary, subsoil drains should run steeply downhill in a chevron, or herringbone, pattern. This may conflict with the requirements for effluent and surface water disposal (GeoGuide LR9) and if so, you will need to seek professional advice.

Rock debris - from landslides higher up on the slope seems likely to pass through the site. Such locations are often referred to by geotechnical practitioners as "debris flow paths". Rock is normally even denser than ordinary fill, so even quite modest boulders are likely to weigh many tonnes and do a lot of damage once they start to roll. Boulders have been known to travel hundreds of metres downhill leaving behind a trail of destruction.

Vegetation - has been completely cleared, leading to a possible rise in the water table and increased landslide risk (GeoGuide LR5).

DON'T CUT CORNERS ON HILLSIDE SITES - OBTAIN ADVICE FROM A GEOTECHNICAL PRACTITIONER

More information relevant to your particular situation may be found in other Australian GeoGuides:

- | | |
|-----------------------------------|--|
| • GeoGuide LR1 - Introduction | • GeoGuide LR7 - Landslide Risk |
| • GeoGuide LR3 - Soil Slopes | • GeoGuide LR8 - Hillside Construction |
| • GeoGuide LR4 - Rock Slopes | • GeoGuide LR9 - Effluent & Surface Water Disposal |
| • GeoGuide LR5 - Water & Drainage | • GeoGuide LR10 - Coastal Landslides |
| • GeoGuide LR6 - Retaining Walls | • GeoGuide LR11 - Record Keeping |

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the [Australian Geomechanics Society](#), a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.