

**GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER
FORM NO. 1 – To be submitted with Development Application**

Development Application for _____	Name of Applicant _____
Address of site <u>11 ADDISON RD, INCLISIDE</u>	

Declaration made by geotechnical engineer or engineering geologist or coastal engineer (where applicable) as part of a geotechnical report

I, AGI ZENON on behalf of JK GEOTECHNICS
(Insert Name) (Trading or Company Name)

on this the 3 FEBRUARY 2020 certify that I am a geotechnical engineer or engineering geologist or coastal engineer as defined by the Geotechnical Risk Management Policy for Pittwater - 2009 and I am authorised by the above organisation/company to issue this document and to certify that the organisation/company has a current professional indemnity policy of at least \$2million.

Wef/:

Please mark appropriate box

- have prepared the detailed Geotechnical Report referenced below in accordance with the Australia Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- Are willing to technically verify that the detailed Geotechnical Report referenced below has been prepared in accordance with the Australian Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- have examined the site and the proposed development in detail and have carried out a risk assessment in accordance with Section 6.0 of the Geotechnical Risk Management Policy for Pittwater - 2009. We confirm that the results of the risk assessment for the proposed development are in compliance with the Geotechnical Risk Management Policy for Pittwater - 2009 and further detailed geotechnical reporting is not required for the subject site.
- have examined the site and the proposed development/alteration in detail and are/am of the opinion that the Development Application only involves Minor Development/Alteration that does not require a Geotechnical Report or Risk Assessment and hence my/our Report is in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009 requirements.
- have examined the site and the proposed development/alteration is separate from and is not affected by a Geotechnical Hazard and does not require a Geotechnical Report or Risk Assessment and hence my Report is in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009 requirements.
- have provided the coastal process and coastal forces analysis for inclusion in the Geotechnical Report

Geotechnical Report Details:

Report Title: <u>PROPOSED NEW SHED</u>	Report Ref No: _____
Report Date: <u>3 FEB 2020</u>	
Author: <u>A. ZENON</u>	<u>21327 E rpt 4</u>
Author's Company/Organisation: <u>JK GEOTECHNICS</u>	

Documentation which relate to or are relied upon in report preparation:

<u>Survey Plan (up 6304 G01, 1/2, 24/4/13)</u>
<u>Bea + Leithridge</u>

We are aware that the above Geotechnical Report, prepared for the abovementioned site is to be submitted in support of a Development Application for this site and will be relied on by Pittwater Council as the basis for confirming that the Geotechnical Risk Management aspects of the proposed development have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk, as discussed in the Report.

Signature [Signature]

Name AGI ZENON

Chartered Professional Status CPENG FIE ANST

Membership No. 213 2971

Company JK GEOTECHNICS

GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER
FORM NO. 1(a) - Checklist of Requirements For Geotechnical Risk Management Report for Development Application

Development Application for _____	Name of Applicant _____
Address of site <u>11 ADDISON RD</u>	<u>INGLESIDE</u>

The following checklist covers the minimum requirements to be addressed in a Geotechnical Risk Management Geotechnical Report. This checklist is to accompany the Geotechnical Report and its certification (Form No. 1).

Geotechnical Report Details:


Report Title: <u>PROPOSED NEW SITE</u>	Report Ref No: <u>25327 E rpt 4</u>
Report Date: <u>3 FEB 2020</u>	
Author: <u>A. ZENON</u>	
Author's Company/Organisation: <u>JK GEOTECHNICS</u>	

Please mark appropriate box

- Comprehensive site mapping conducted 3/2/2020
(date)
- Mapping details presented on contoured site plan with geomorphic mapping to a minimum scale of 1:200 (as appropriate)
- Subsurface investigation required
 - No Justification Simple shed with impact on landscaping & rock walls.
 - Yes Date conducted
- Geotechnical model developed and reported as an inferred subsurface type-section
- Geotechnical hazards identified
 - Above the site
 - On the site
 - Below the site
 - Beside the site
- Geotechnical hazards described and reported
- Risk assessment conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
 - Consequence analysis
 - Frequency analysis
- Risk calculation
- Risk assessment for property conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
- Risk assessment for loss of life conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
- Assessed risks have been compared to "Acceptable Risk Management" criteria as defined in the Geotechnical Risk Management Policy for Pittwater - 2009
- Opinion has been provided that the design can achieve the "Acceptable Risk Management" criteria provided that the specified recommendations presented in the Report are adopted.
- Design Life Adopted:
 - 100 years
 - Other specify
- Geotechnical Conditions to be applied to all four phases as described in the Geotechnical Risk Management Policy for Pittwater - 2009 have been specified
- Additional action to remove risk where reasonable and practical have been identified and included in the report.
- Risk assessment within Bushfire Asset Protection Zone.

We are aware that Pittwater Council will rely on the Geotechnical Report, to which this checklist applies, as the basis for confirming that the geotechnical risk management aspects of the proposal have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated, and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk as discussed in the Report.

Signature [Signature]
 Name A. ZENON
 Chartered Professional Status C. ENG. F. EAUST
 Membership No. 213 2971
 Company JK GEOTECHNICS

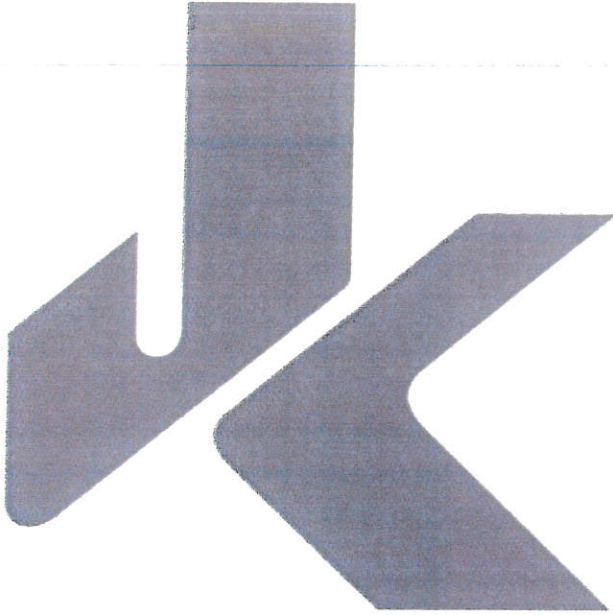

REPORT TO
MATTHEWS FAMILY

ON
GEOTECHNICAL ASSESSMENT
(In Accordance with Pittwater Council Risk
Management Policy)

FOR
PROPOSED NEW SHED

AT
11 ADDISON ROAD, INGLESIDE, NSW

Date: 3 February 2020

Ref: 25327Zrpt4

JKGeotechnics
www.jkgeotechnics.com.au

T: +61 2 9888 5000

JK Geotechnics Pty Ltd

ABN 17 003 550 801





Report prepared by:

Agi Zenon
Principal Consultant I Geotechnical Engineer

For and on behalf of
JK GEOTECHNICS
PO BOX 976
NORTH RYDE BC NSW 1670

DOCUMENT REVISION RECORD

Report Reference	Report Status	Report Date
25327Zrpt4	Final Report	3 February 2020

© Document copyright of JK Geotechnics

This report (which includes all attachments and annexures) has been prepared by JK Geotechnics (JKG) for its Client, and is intended for the use only by that Client.

This Report has been prepared pursuant to a contract between JKG and its Client and is therefore subject to:

- JKG's proposal in respect of the work covered by the Report;
- The limitations defined in the Client's brief to JKG;
- The terms of contract between JKG and the Client, including terms limiting the liability of JKG.

If the Client, or any person, provides a copy of this Report to any third party, such third party must not rely on this Report, except with the express written consent of JKG which, if given, will be deemed to be upon the same terms, conditions, restrictions and limitations as apply by virtue of (a), (b), and (c) above.

Any third party who seeks to rely on this Report without the express written consent of JKG does so entirely at their own risk and to the fullest extent permitted by law, JKG accepts no liability whatsoever, in respect of any loss or damage suffered by any such third party.

At the Company's discretion, JKG may send a paper copy of this report for confirmation. In the event of any discrepancy between paper and electronic versions, the paper version is to take precedence. The USER shall ascertain the accuracy and the suitability of this information for the purpose intended; reasonable effort is made at the time of assembling this information to ensure its integrity. The recipient is not authorised to modify the content of the information supplied without the prior written consent of JKG.



Table of Contents

1	INTRODUCTION	1
2	ASSESSMENT METHODOLOGY	1
3	SUMMARY OF OBSERVATIONS	2
4	SUBSURFACE CONDITIONS	4
5	GEOTECHNICAL ASSESSMENT	4
5.1	Potential Landslide Hazards	4
5.2	Risk Analysis	4
5.3	Risk Assessment	5
6	Comments and Recommendations	6
6.1	Conditions Recommended to Establish the Design Parameters	6
6.2	Conditions Recommended the Detailed Design to be Undertaken for the Construction Certificate	6
6.3	Conditions Recommended During the Construction Period	6
6.4	Conditions Recommended for Ongoing Management of the Site/Structure(s)	6
7	OVERVIEW	7

ATTACHMENTS

Table A: Summary of Risk Assessment to Property

Table B: summary of Risk Assessment to Life

Figure 1: Site Location Plan

Figure 2: Geotechnical Site Plan

Figure 3: Geotechnical Mapping Symbols

Figure 4: Geotechnical Sketch Section A–A

Figure 5: Geotechnical Sketch Section B–B

Figure 6: Geotechnical Sketch Section C–C

Appendix A: Landslide Risk Management Terminology

Appendix B: Some Guidelines for Hillside Construction



1 INTRODUCTION

This report presents the results of our geotechnical assessment of the site of the proposed new shed at 11 Addison Road, Ingleside, NSW. The site location is indicated on attached Figure 1. The assessment was commissioned on 30 January 2020 by Mr Steve Matthews' email on 30 January 2020, based on our proposal of the same date. We inspected the site on 3 February 2020 to assess the existing stability of the site.

We understand from Steve Matthews that the proposed new shed will replace the existing shed over the south-western portion of the site. The new shed will be of steel framed, metal clad construction and will have roughly the same footprint as the existing shed.

We note that we have previously carried out a geotechnical assessment of the site, an assessment of fill batters adjacent to Addison Road, and an inspection of the cut rock face during construction of the house, and the results were presented in our reports (ref 6903W/vm) dated 11 July 1989, (ref 6903W/vm) dated 6 August 1990, and (ref 17249WZfax) dated 30 October 2002, respectively. Subsequently, a geotechnical assessment of the site was undertaken to support a Section 96 for additions and alterations, and the results were presented in our report (ref 25327Zrpt) dated 9 November 2011.

More recently, a new Development Application (DA) was submitted for 'Occupation of Existing Site for the Purpose of an Industry Directly Associated with an Extractive Industry'. To support this DA, a geotechnical assessment of the entire site was carried out and the results were presented in our report (ref 25327Zrpt3) dated 21 June 2013. We subsequently revisited the site to inspect the construction of a new retaining wall along the western site boundary. In our email site report dated 8 June 2016, we confirmed that the wall was satisfactory.

Based on the Pittwater Council website, the central and most of the eastern portion of the site is located within Geotechnical Hazard Zone 1, whilst the extreme eastern and the western ends are not located within a hazard zone. Hazard Zone 1 is the most severe in terms of potential landslip.

This report has been prepared in accordance with the requirements of the Geotechnical Risk Management Policy for Pittwater (2009) as discussed in Section 5 below. Our report is thus preceded with Council Forms 1 and 1a.

2 ASSESSMENT METHODOLOGY

This stability assessment is based upon a detailed inspection of the topographic, surface drainage and geological conditions of the site and its immediate environs. These features were compared to those of other similar lots in neighbouring locations to provide a comparative basis for assessing the risk of instability. The attached Appendix A defines the terminology adopted for the risk assessment together with a flowchart illustrating the Risk Management Process based on the guidelines given in AGS 2007C (Reference 1).



A summary of our observations is presented in Section 3 below. Our specific recommendations are discussed in Section 6 following our geotechnical assessment.

The attached Figure 2 presents a geotechnical sketch plan showing the principal geotechnical features present at the site. Figure 2 is based on the survey plan (ref 6384 G-01, Sheet 1 of 2, dated 24-4-2013) prepared by Bee and Lethbridge Pty Ltd. The survey datum is the Australian Height Datum (AHD). Additional features on Figure 2 have been measured by hand held inclinometer and tape measure techniques and hence are only approximate. Should any of the features be critical to any proposed works, we recommend they be located more accurately using instrument survey techniques. Figure 4, 5, and 6 present typical cross-sections through portions of the site based on the survey data augmented by our mapping observations.

3 SUMMARY OF OBSERVATIONS

We recommend that the summary of observations which follows be read in conjunction with the attached Figures 2 to 6:

- The site is located over a relatively moderately sloping west-facing hillside below Addison Road. The site itself has an approximate 'L' plan shape being about 201m deep (east to west) and by between about 78m and 116m wide (north to south), and has an overall slope of approximately 20°.
- The eastern (upper) portion of the site is occupied by a one and two storey, split level, and duplex style large house with carports and garages at the northern and southern ends. An inground pool and balconies are located to the west. Driveways off Addison Road provide access down to the garages. We know from inspections undertaken during construction that the original house is supported on bedrock.
- The front yard to the east is characterised by gently sloping vegetated benches supported by variable height drystone walls, together with a sub-vertical sandstone cut face of maximum 2m height. Seepage was noted at the base of sandstone cut face along the bedding partings. The area between the existing house and the sandstone cut face comprises a level surface covered by gravel and forms part of the driveway. Figure 4 shows a typical cross-section through this portion of the site.
- The area immediately to the west of the house (in the rear yard) appears to have been levelled by cutting and filling. This portion of the site is retained by a loosely packed drystone wall about 2.8m maximum height and is founded behind the crest of a sandstone cliff line oriented generally north-south. The cliff line varies in height from about 2m to 7m.
- The sandstone, forming the cliff line is relatively massive and, in some places, shows some undercutting along bedding planes and joints, forming overhang features. A relatively large overhang feature is located within the northern part of the cliff line. Figure 5 shows a typical cross section through this



overhang feature. Groundwater seepage was noted at the toe of the cliff line through the intersecting bedding partings and joints. Much of the cliff line toe area had been cleared of undergrowth.

- The hillslope further to the west of the cliff line falls at about 20° and exposes sandstone outcrops and ledges. The exposed sandstone bedrock was assessed to be distinctly weathered and of medium to high strength.
- Natural drainage across the site appears to be concentrated in a gully along the northern boundary, and localised gully erosion of the sandy topsoils is evident along this drainage route. Beyond the southern boundary, there is a major water course or gully. Minor tributary gullies also flow into this water course. A water storage dam constructed apparently by cut and fill is located over this water course beyond the western site boundary.
- The western (lower) portion of the site is divided into two relatively level benches which appeared to be formed by cut and fill. The sub-vertical cut faces at the eastern end of each bench varied in height to about 8m and exposed distinctly weathered sandstone which was assessed to be of medium to high strength.
- The upper bench is predominantly covered by grass and is occupied by a metal shed, office building, carport and demountable shed. An unpaved driveway along the southern site boundary provides access to the office building. An unpaved driveway from the west provides access to the demountable shed. Two water storage tanks and two water filled ponds are also located within this upper bench.
- The lower western bench area is a relatively level gravel surface and is occupied by a metal clad workshop, a timber building and a metal carport along the southern boundary. Two small water storage tanks and a metal shed are located adjacent to the cut face over the mid-eastern section. Some portions of the cut face within this area of the site exposed colluvium and/or gravelly sandy fill over sandstone bedrock. The fill/colluvium is supported by large sandstone and concrete blocks up to 4m high. These retaining walls appeared to be in good condition. The lower bench area is mainly used for storage of heavy earth moving equipment.
- The lower western bench area appears to have been filled over the western end, and the fill is supported above the neighbouring property by a stacked sandstone block wall up to about 3.5m high.
- A gravel road provides access to the south-western corner of the site, off Tumburra Street.



4 SUBSURFACE CONDITIONS

The 1:100,000 geological map of Sydney indicates that the site is underlain by Hawkesbury Sandstone, which in turn is underlain by interbedded sandstone and shale of the Newport Formation, Narrabeen Group.

Based on our walk-over survey, the site is generally underlain by colluvium and/or residual sandy clay/clayey sand and where not exposed at surface, sandstone bedrock is expected at shallow depth. Areas of fill are also present.

The sandstone was generally assessed to be distinctly weathered and of low, medium and high strength.

5 GEOTECHNICAL ASSESSMENT

The site is located over a moderately steep sloping hillside, generally appears well drained and sandstone bedrock outcrops at surface or is expected to be present at relatively shallow depth. Our inspection indicated no evidence of any recent mass soil, and/or rock slope instability or down slope soil creep.

5.1 Potential Landslide Hazards

We consider that the potential landslide hazards associated with the site to be the following:

- A Stability of existing retaining walls over the upper eastern portion of the site.
- B Stability of the existing cliff line.
- C Stability of the bushland hillslope over the central portion of the site.
- D Stability of existing retaining walls over the lower western portion of the site.
- E Stability of the cut faces and batter slopes over the lower western portion of the site.

Some of these potential hazards are indicated in schematic form on attached Figures 4, 5, and 6.

5.2 Risk Analysis

The attached Table A summarises our qualitative assessment of each potential landslide hazard and of the consequences to property should the landslide hazard occur. The data presented in MacGregor *et al* (Reference 2) has been used to assist with this assessment. Based on the above, the qualitative risks to property have been determined. The terminology adopted for this qualitative assessment is in accordance with Table A1 given in Appendix A. Table A indicates that under existing conditions, the assessed risk to property varies between Very Low and Medium, which would be considered 'acceptable' and 'tolerable', respectively, in accordance with the criteria given in Reference 1 and the Pittwater Council Risk Management Policy. However, once the recommendations associated with flattening the slope batter over the western portion of the site are implemented, the risk to property would improve to 'acceptable'.



We have also used the indicative probabilities associated with the assessed likelihood of instability to calculate the risk to life. The temporal, vulnerability, evacuation and spatial factors that have been adopted are given in the attached Table B, together with the resulting risk calculation. Our assessed risk to life for the person most at risk is less than 10^{-6} . This would be considered to be 'acceptable' in relation to the criteria given in Reference 1 and the Pittwater Council Risk Management Policy.

5.3 Risk Assessment

The Pittwater Risk Management Policy requires suitable measures 'to remove risk'. It is recognised that, due to the many complex factors that can affect a site, the subjective nature of a risk analysis, and the imprecise nature of the science of geotechnical engineering, the risk of instability for a site and/or development cannot be completely removed. It is, however, essential that risk be reduced to at least that which could be reasonably anticipated by the community in everyday life and that landowners be made aware of reasonable and practical measures available to reduce risk as far as possible. Hence, where the policy requires that 'reasonable and practical measures have been identified to remove risk', it means that there has been an active process of reducing risk, but it does not require the geotechnical engineer to warrant that risk has been completely removed, only reduced, as removing risk is not currently scientifically achievable.

Similarly, the Pittwater Risk Management Policy requires that the design project life be taken as 100 years unless otherwise justified by the applicant. This requirement provides the context within which the geotechnical risk assessment should be made. The required 100 years baseline broadly reflects the expectations of the community for the anticipated life of a residential structure and hence the timeframe to be considered when undertaking the geotechnical risk assessment and making recommendations as to the appropriateness of a development, and its design and remedial measures that should be taken to control risk. It is recognised that in a 100-year period external factors that cannot reasonably be foreseen may affect the geotechnical risks associated with a site. Hence, the Policy does not seek the geotechnical engineer to warrant the development for a 100-year period, rather to provide a professional opinion that foreseeable geotechnical risks to which the development may be subjected in that timeframe have been reasonably considered.

Our assessment of the probability of failure of existing structural elements such as retaining walls (where applicable) is based upon a visual appraisal of their type and condition at the time of our inspection. Where existing structural elements such as retaining walls will not be replaced, where appropriate we identify the time period at which reassessment of their longevity seems warranted.

In preparing our recommendations given below, we have adopted the above interpretations of the Risk Management Policy requirements. We have also assumed that no activities on surrounding land which may affect the risk on the subject site would be carried out. We have further assumed that all Council's buried services are, and will be regularly maintained to remain, in good condition.



Although portion of the site is located within Council Geotechnical Hazard Zone H1, which is the most severe in terms of potential landslip, we consider that our risk analysis has shown that the site can achieve the 'Acceptable Risk Management' criteria in the Pittwater Policy, provided the recommendations given in Section 6 below are adopted. These recommendations form an integral part of the Landslide Risk Management Process.

6 COMMENTS AND RECOMMENDATIONS

Due to its limited plan extent and location over a relatively flat area remote from a hazard zone, the design and construction of the proposed new shed will have no impact on the landslide risk assessment of the site, nor on existing risk levels. Nevertheless, we have assumed that the shed has been/will be designed and constructed in accordance with good engineering principles. These recommendations address geotechnical issues only and other conditions may be required to address other aspects.

6.1 Conditions Recommended to Establish the Design Parameter

6.1.1 Given the above, no specific design recommendations are provided.

6.2 Conditions Recommended the Detailed Design to be Undertaken for the Construction Certificate

6.2.1 None.

6.3 Conditions Recommended During the Construction Period

6.3.1 None.

6.4 Conditions Recommended for Ongoing Management of the Site/Structure(s)

The following recommendations have been included so that the current and future owners of the subject property are aware of their responsibilities:

6.4.1 All existing surface (including roofs) and subsurface drains must be subject to ongoing and regular maintenance by the property owner.

6.4.2 No cut or fill in excess of 0.5m (eg. for landscaping, buried pipes, retaining walls, etc), is to be carried out on site without prior consent from Pittwater Council.



7 OVERVIEW

It is possible that the subsurface soil, rock or groundwater conditions encountered during construction may be found to be different (or may be interpreted to be different) from those inferred from our surface observations in preparing this report. Also, we have not had the opportunity to observe surface run-off patterns during heavy rainfall and cannot comment directly on this aspect. If conditions appear to be at variance or cause concern for any reason, then we recommend that you immediately contact this office.

This report has been prepared for the particular project described and no responsibility is accepted for the use of any part of this report in any other context or for any other purpose. Copyright in this report is the property of Jeffery and Katauskas Pty Ltd. We have used a degree of care, skill and diligence normally exercised by consulting engineers in similar circumstances and locality. No other warranty expressed or implied is made or intended. Subject to payment of all fees due for the investigation, the client alone shall have a licence to use this report. The report shall not be reproduced except in full.

Reference 1: Australian Geomechanics Society (2007c) *'Practice Note Guidelines for Landslide Risk Management'*, Australian Geomechanics, Vol 42, No 1, March 2007, pp63-114.

Reference 2: MacGregor, P, Walker, B, Fell, R, and Leventhal, A (2007) *'Assessment of Landslide Likelihood in the Pittwater Local Government Area'*, Australian Geomechanics, Vol 42, No 1, March 2007, pp183-196.

Hazard	A: Instability of Existing Retaining Walls over the Upper Eastern Portion of the Site	B: Instability (Mass) of Existing Cliff line	C: Instability of Bush Hillslope over Centre of Site	D: Instability of Existing Retaining Walls over Lower Western Portion of Site	E: Instability of Existing Retaining Walls over Lower Western Portion of Site
	Unlikely	Unlikely	Possible	Unlikely	
	Minor	Minor	Insignificant	Minor	
	Low	Low	Very Low	Low	
	Walls appear to be in good condition	Localised instability will be Possible with 'insignificant' consequences and Very Low risk		Walls appear in good condition	

Hazard	A: Instability of Existing Retaining Walls over the Upper Eastern Portion of the Site	B: Instability (Localised) of Existing Cliff line	C: Instability of Bus and Hillslope over Centre of Site	D: Instability of Existing Retaining Walls over Lower Western Portion of Site	E: Instability of Existing Retaining Walls over Lower Western Portion of Site
	Unlikely	Unlikely	Possible	Unlikely	
Frequency	10 ⁻⁴	10 ⁻⁴	10 ⁻³	10 ⁻⁴	
Persons at Risk	Persons at crest or toe of walls	Persons at crest or toe	Persons on slope	Persons at toe or crest of walls	Persons at toe or crest of walls
Redundancy	1	1	1	2	
Exposure	1 hour/day ie. 0.04	1 hour/week ie. 0.006	1 hour/week ie. 0.006	2 hours/day ie. 0.08	
Exposure Area	0.4	0.6	0.4	0.2	
Probability of Occurrence	3m failure over about 30m length of wall ie. 0.1	4m failure over 20m length ie. 0.2	Say, 5% ie. 0.05	3/120 ie. 0.025	
Probability of Occurrence	0.1	0.5	0.3	0.5	
Probability of Occurrence	1.6x10 ⁻⁸	3.6x10 ⁻⁸	3.6x10 ⁻⁸	2x10 ⁻⁸	
Probability of Occurrence	1.6x10 ⁻⁸	3.6x10 ⁻⁸	3.6x10 ⁻⁸	4.10 ⁻⁸	



AERIAL IMAGE SOURCE: MAPS.AU.NEARMAP.COM

Title: SITE LOCATION PLAN	
Location: 11 ADDISON ROAD, INGLESIDE, NSW	
Report No: 25327Z	Figure: 1
JKGeotechnics	



This plan should be read in conjunction with the JK Geotechnics report.

PLOT DATE: 3/02/2020 2:19:30 PM DWG FILE: Z:\6 GEOTECHNICAL\WF GEOTECHNICAL_JOBS\25000\35327Z INGLESIDE\CA\05337Z.DWG




LOCATION OF PROPOSED NEW SHED.


TOPOGRAPHY

Symbol	Ground Profile		OTHER FEATURES
		convex	Boulder Seepage/spring Swallow hole for runoff Natural water course Open drain, unlined Open drain, lined Feneline Property boundary Dry Stone Wall Major joint in rock face (opening in millimetres) Tension crack (opening in millimetres) Masonry or concrete wall Ponding water Boggy or swampy area
		concave	
		breaks of slope	
		changes of slope	
		sharp	
		rounded	
		Cliff or escarpment or sharp break 40° or more (estimated height in metres)	
		Uniform Slope	
		Concave Slope	
		Convex Slope	
		Top	
		Bottom	
		Hummocky or irregular ground	

EXAMPLE OF USE OF TOPOGRAPHIC SYMBOLS:

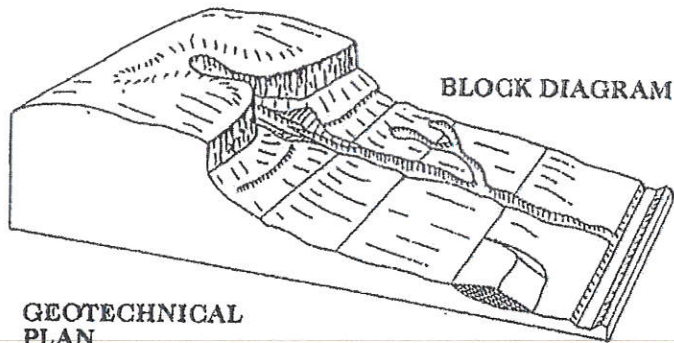


GEOTECHNICAL PLAN

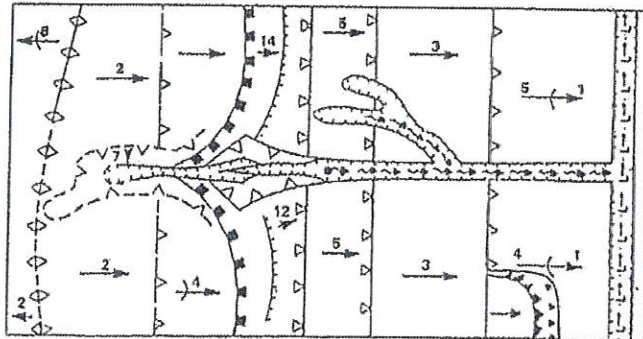

(After Gardiner, V & Dackombe, R.V. (1983), Geomorphological Field Manual; George Allen & Unwin).



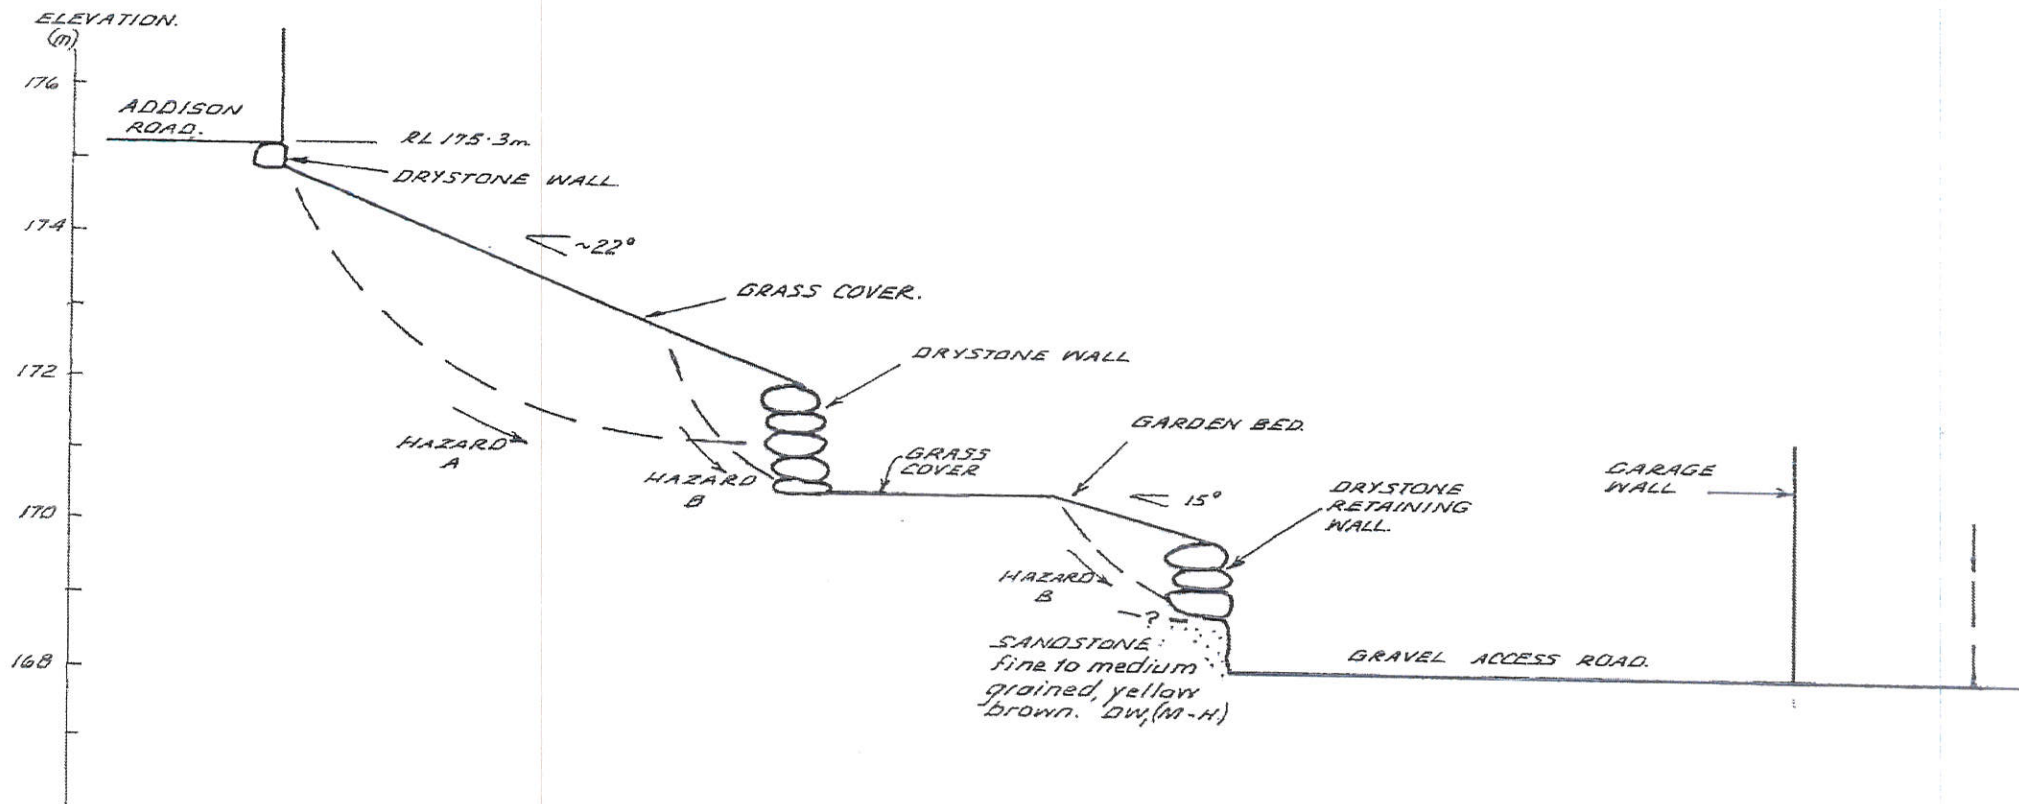

CROSS SECTIONAL SKETCH A-A

SCALE (M)




JKGeotechnics

Report No. 2532724

Figure No. 4



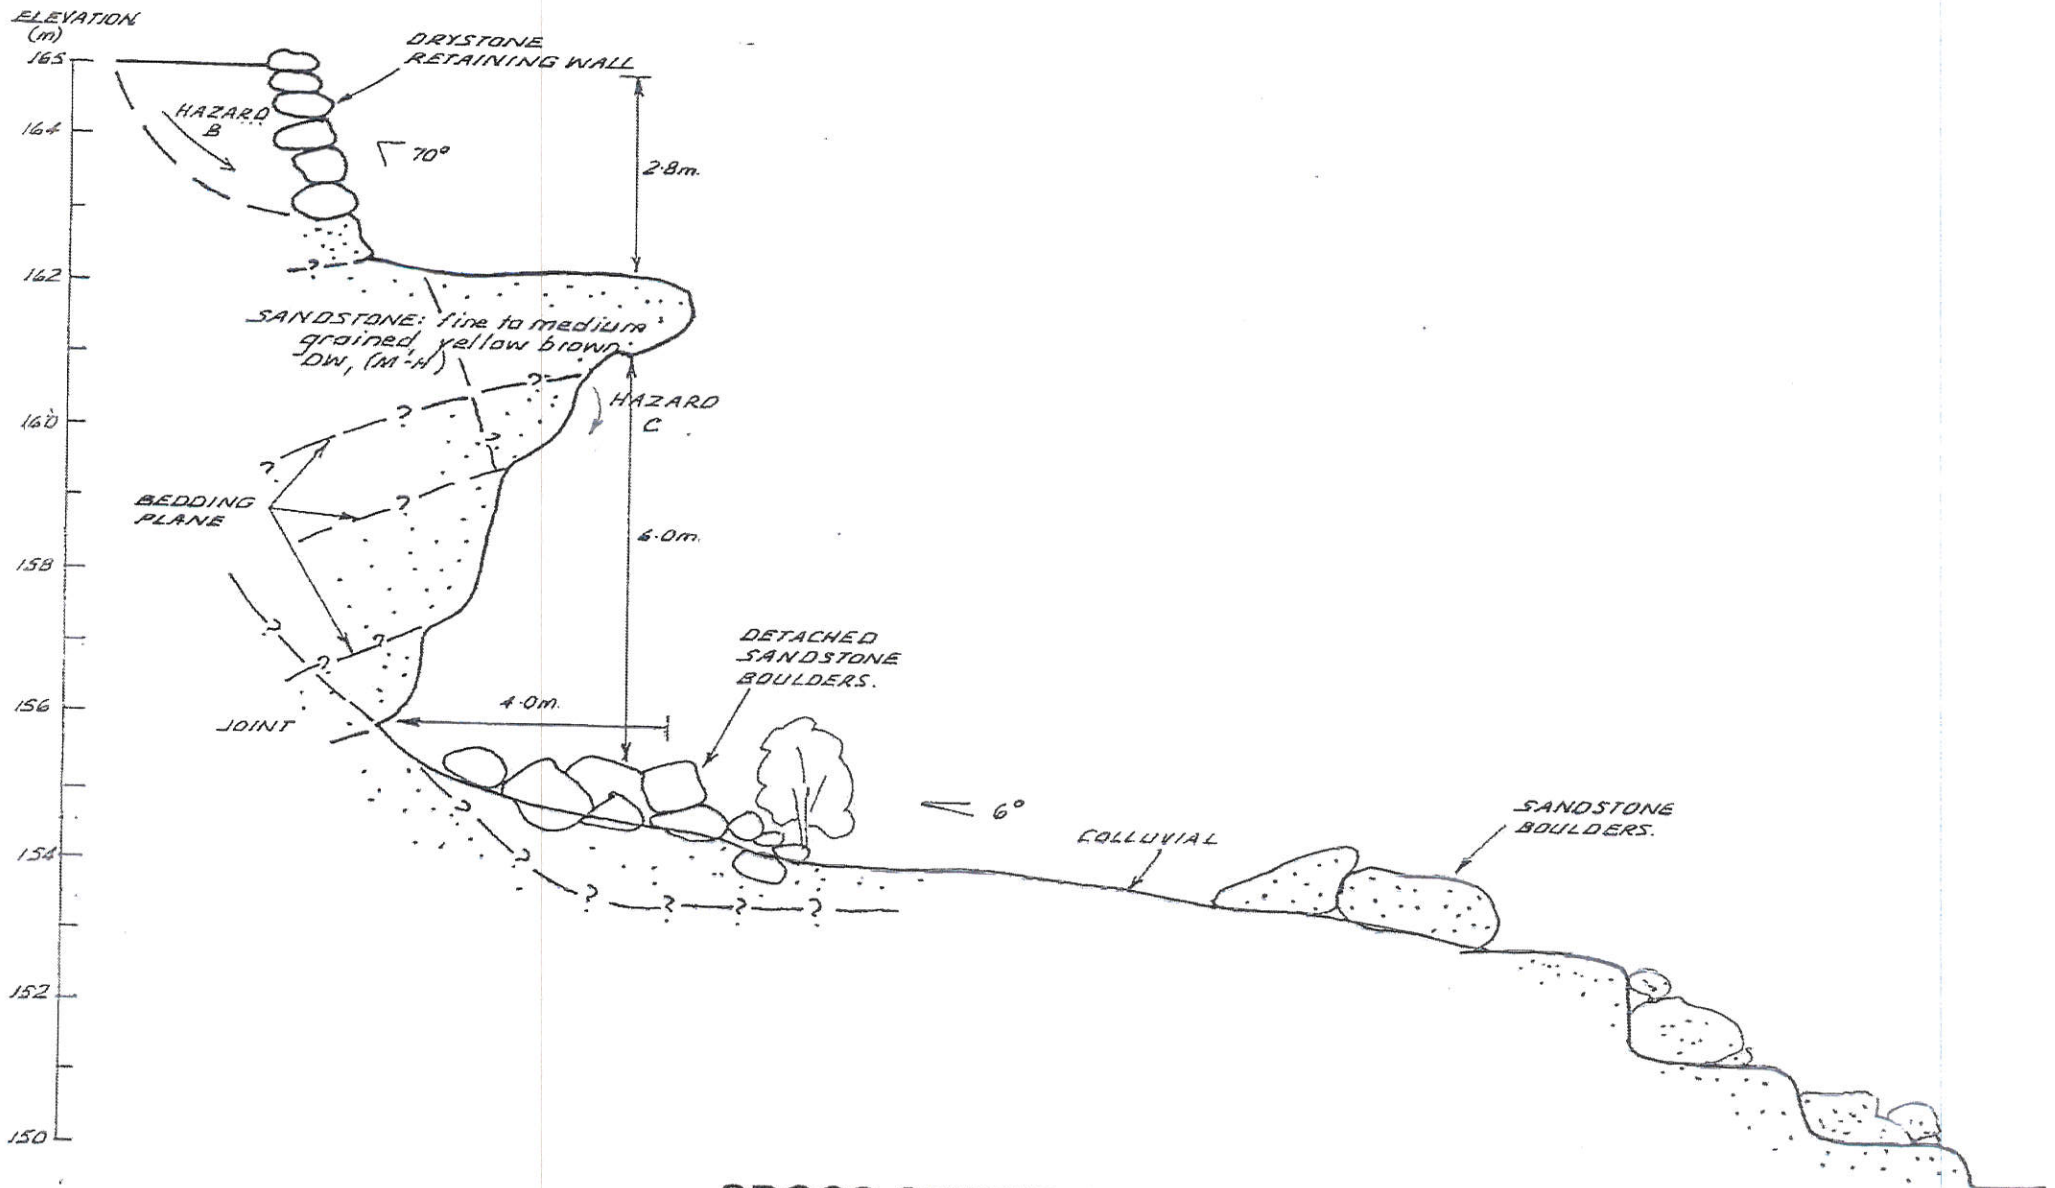

CROSS SECTIONAL SKETCH B-B





JKGeotechnics

Report No. 2532724 Figure No. 5




ELEVATION.
(m)

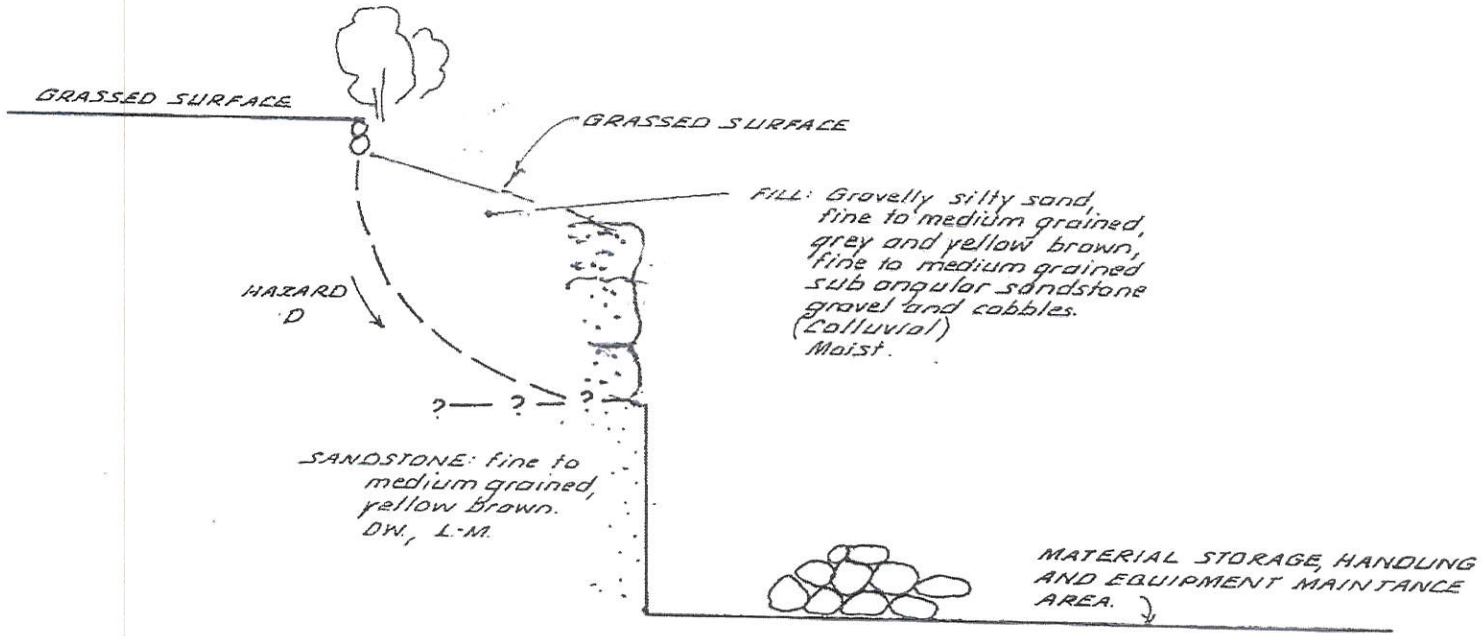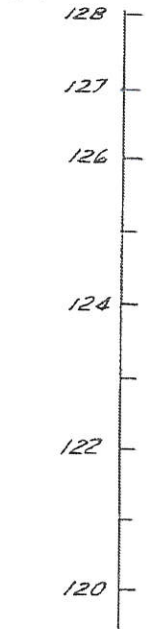

CROSS SECTIONAL SKETCH C-C



JKGeotechnics
Report No. 2532724 Figure No. 6





APPENDIX A

**LANDSLIDE RISK
MANAGEMENT
TERMINOLOGY**



LANDSLIDE RISK MANAGEMENT

Definition of Terms and Landslide Risk

Risk Terminology	Description
Acceptable Risk	A risk for which, for the purposes of life or work, we are prepared to accept as it is with no regard to its management. Society does not generally consider expenditure in further reducing such risks justifiable.
Annual Exceedance Probability (AEP)	The estimated probability that an event of specified magnitude will be exceeded in any year.
Consequence	The outcomes or potential outcomes arising from the occurrence of a landslide expressed qualitatively or quantitatively, in terms of loss, disadvantage or gain, damage, injury or loss of life.
Elements at Risk	The population, buildings and engineering works, economic activities, public services utilities, infrastructure and environmental features in the area potentially affected by landslides.
Frequency	A measure of likelihood expressed as the number of occurrences of an event in a given time. See also 'Likelihood' and 'Probability'.
Hazard	A condition with the potential for causing an undesirable consequence (the landslide). The description of landslide hazard should include the location, volume (or area), classification and velocity of the potential landslides and any resultant detached material, and the likelihood of their occurrence within a given period of time.
Individual Risk to Life	The risk of fatality or injury to any identifiable (named) individual who lives within the zone impacted by the landslide; or who follows a particular pattern of life that might subject him or her to the consequences of the landslide.
Landslide Activity	The stage of development of a landslide; pre failure when the slope is strained throughout but is essentially intact; failure characterised by the formation of a continuous surface of rupture; post failure which includes movement from just after failure to when it essentially stops; and reactivation when the slope slides along one or several pre-existing surfaces of rupture. Reactivation may be occasional (eg. seasonal) or continuous (in which case the slide is 'active').
Landslide Intensity	A set of spatially distributed parameters related to the destructive power of a landslide. The parameters may be described quantitatively or qualitatively and may include maximum movement velocity, total displacement, differential displacement, depth of the moving mass, peak discharge per unit width, or kinetic energy per unit area.
Landslide Risk	The AGS Australian GeoGuide LR7 (AGS, 2007e) should be referred to for an explanation of Landslide Risk.
Landslide Susceptibility	The classification, and volume (or area) of landslides which exist or potentially may occur in an area or may travel or retrogress onto it. Susceptibility may also include a description of the velocity and intensity of the existing or potential landsliding.
Likelihood	Used as a qualitative description of probability or frequency.
Probability	<p>A measure of the degree of certainty. This measure has a value between zero (impossibility) and 1.0 (certainty). It is an estimate of the likelihood of the magnitude of the uncertain quantity, or the likelihood of the occurrence of the uncertain future event.</p> <p>These are two main interpretations:</p> <p>(i) Statistical – frequency or fraction – The outcome of a repetitive experiment of some kind like flipping coins. It includes also the idea of population variability. Such a number is called an 'objective' or relative frequentist probability because it exists in the real world and is in principle measurable by doing the experiment.</p>

Risk Terminology	Description
Probability (continued)	(ii) Subjective probability (degree of belief) – Quantified measure of belief, judgment, or confidence in the likelihood of an outcome, obtained by considering all available information honestly, fairly, and with a minimum of bias. Subjective probability is affected by the state of understanding of a process, judgment regarding an evaluation, or the quality and quantity of information. It may change over time as the state of knowledge changes.
Qualitative Risk Analysis	An analysis which uses word form, descriptive or numeric rating scales to describe the magnitude of potential consequences and the likelihood that those consequences will occur.
Quantitative Risk Analysis	An analysis based on numerical values of the probability, vulnerability and consequences and resulting in a numerical value of the risk.
Risk	A measure of the probability and severity of an adverse effect to health, property or the environment. Risk is often estimated by the product of probability x consequences. However, a more general interpretation of risk involves a comparison of the probability and consequences in a non-product form.
Risk Analysis	The use of available information to estimate the risk to individual, population, property, or the environment, from hazards. Risk analyses generally contain the following steps: scope definition, hazard identification and risk estimation.
Risk Assessment	The process of risk analysis and risk evaluation.
Risk Control or Risk Treatment	The process of decision-making for managing risk and the implementation or enforcement of risk mitigation measures and the re-evaluation of its effectiveness from time to time, using the results of risk assessment as one input.
Risk Estimation	The process used to produce a measure of the level of health, property or environmental risks being analysed. Risk estimation contains the following steps: frequency analysis, consequence analysis and their integration.
Risk Evaluation	The stage at which values and judgments enter the decision process, explicitly or implicitly, by including consideration of the importance of the estimated risks and the associated social, environmental and economic consequences, in order to identify a range of alternatives for managing the risks.
Risk Management	The complete process of risk assessment and risk control (or risk treatment).
Societal Risk	The risk of multiple fatalities or injuries in society as a whole: one where society would have to carry the burden of a landslide causing a number of deaths, injuries, financial, environmental and other losses.
Susceptibility	See 'Landslide Susceptibility'.
Temporal Spatial Probability	The probability that the element at risk is in the area affected by the landsliding, at the time of the landslide.
Tolerable Risk	A risk within a range that society can live with so as to secure certain net benefits. It is a range of risk regarded as non-negligible and needing to be kept under review and reduced further if possible.
Vulnerability	The degree of loss to a given element or set of elements within the area affected by the landslide hazard. It is expressed on a scale of 0 (no loss) to 1 (total loss). For property, the loss will be the value of the damage relative to the value of the property; for persons, it will be the probability that a particular life (the element at risk) will be lost, given the person(s) is affected by the landslide.

NOTE: Reference should be made to Figure A1 which shows the inter-relationship of many of these terms and the relevant portion of Landslide Risk Management.

Reference should also be made to the paper referenced below for Landslide Terminology and more detailed discussion of the above terminology.

This appendix is an extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

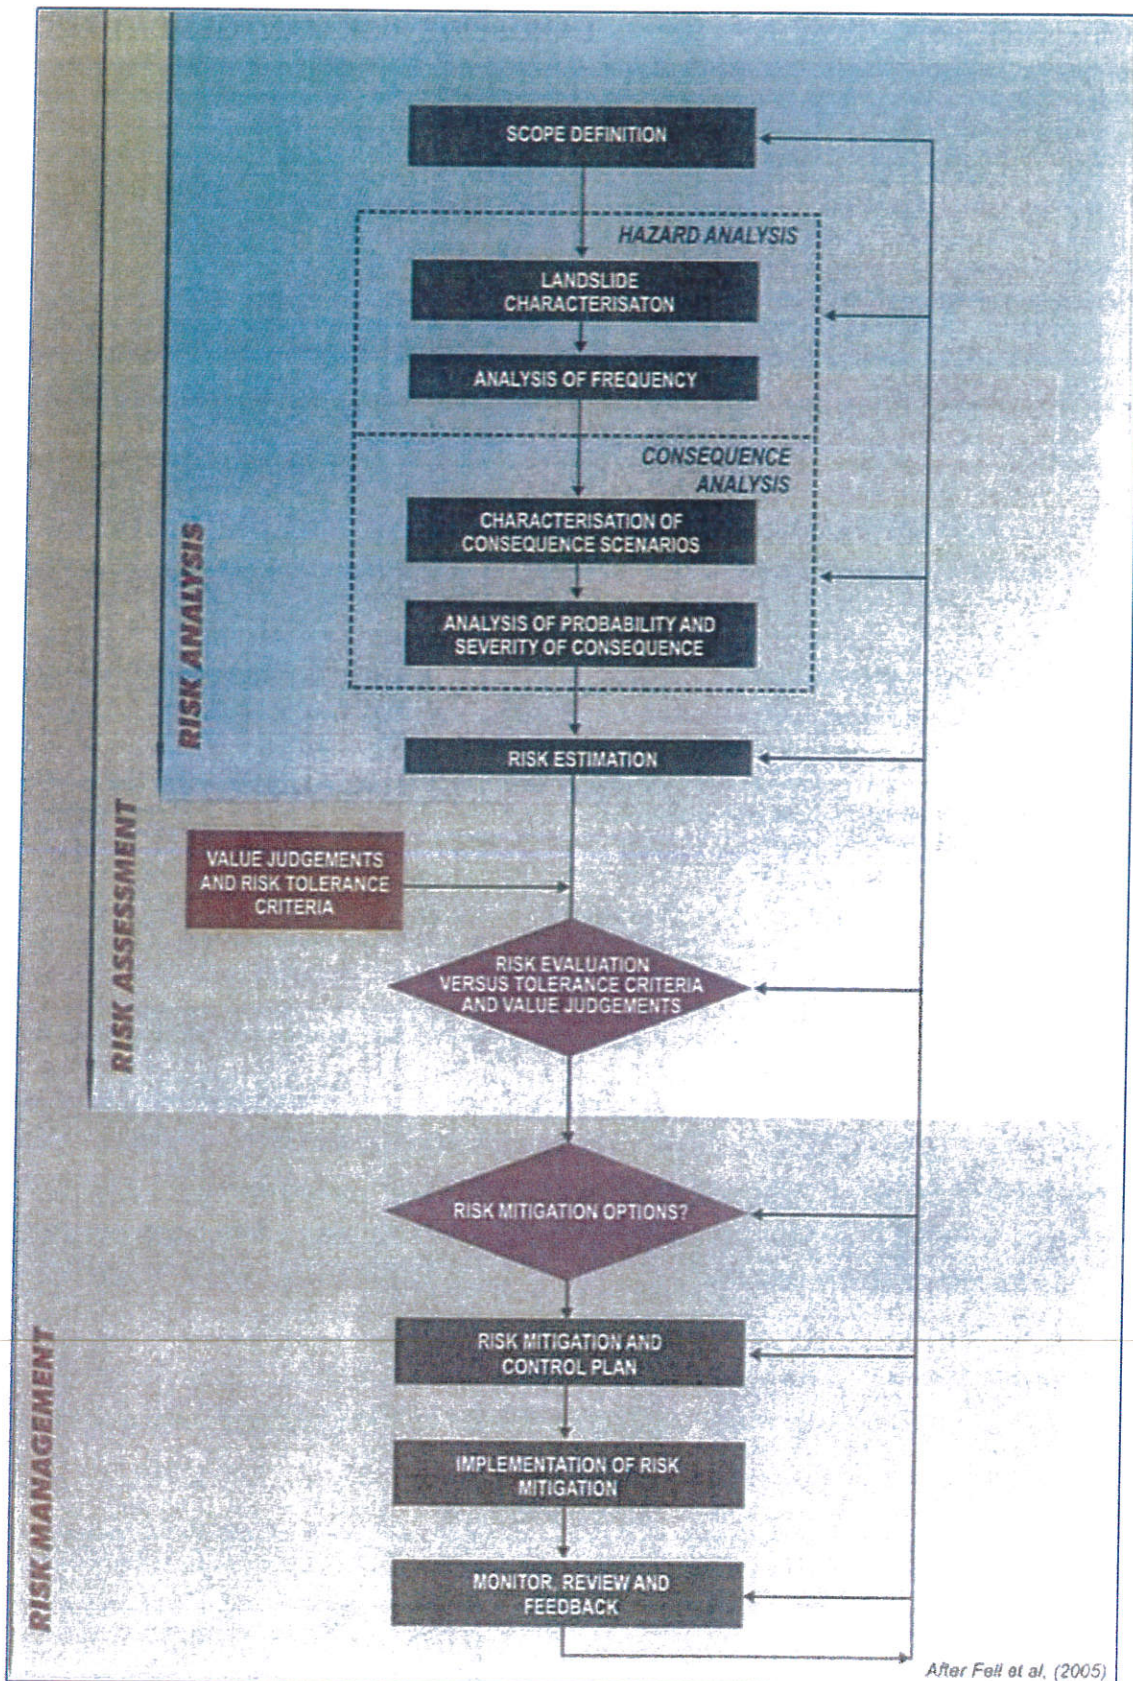


FIGURE A1: Flowchart for Landslide Risk Management.

This figure is an extract from GUIDELINE FOR LANDSLIDE SUSCEPTIBILITY, HAZARD AND RISK ZONING FOR LAND USE PLANNING, as presented in Australian Geomechanics Vol 42, No 1, March 2007, which discusses the matter more fully.



**TABLE A1: LANDSLIDE RISK ASSESSMENT
QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY**

QUALITATIVE MEASURES OF LIKELIHOOD

Approximate Annual Probability		Implied Indicative Landslide Recurrence Interval	Description	Descriptor	Level
Indicative Value	Notional Boundary				
10 ⁻¹	5×10 ⁻²	10 years	The event is expected to occur over the design life.	ALMOST CERTAIN	A
10 ⁻²		20 years			
10 ⁻³	5×10 ⁻³	100 years	The event will probably occur under adverse conditions over the design life.	LIKELY	B
		200 years			
10 ⁻⁴	5×10 ⁻⁴	1000 years	The event could occur under adverse conditions over the design life.	POSSIBLE	C
		2000 years			
10 ⁻⁵	5×10 ⁻⁵	10,000 years	The event might occur under very adverse circumstances over the design life.	UNLIKELY	D
		20,000 years			
10 ⁻⁶	5×10 ⁻²	100,000 years	The event is conceivable but only under exceptional circumstances over the design life.	RARE	E
		200,000 years			
		1,000,000 years	The event is inconceivable or fanciful over the design life.	BARELY CREDIBLE	F

Note: (1) The table should be used from left to right; use Approximate Annual Probability or Description to assign Descriptor, not *vice versa*.

QUALITATIVE MEASURES OF CONSEQUENCES TO PROPERTY

Approximate cost of Damage		Description	Descriptor	Level
Indicative Value	Notional Boundary			
200%	100%	Structure(s) completely destroyed and/or large scale damage requiring major engineering works for stabilisation. Could cause at least one adjacent property major consequence damage.	CATASTROPHIC	1
60%		Extensive damage to most of structure, and/or extending beyond site boundaries requiring significant stabilisation works. Could cause at least one adjacent property medium consequence damage.		
20%	40%	Moderate damage to some of structure, and/or significant part of site requiring large stabilisation works. Could cause at least one adjacent property minor consequence damage.	MAJOR	2
5%	10%	Limited damage to part of structure, and/or part of site requiring some reinstatement stabilisation works.	MEDIUM	3
0.5%	1%	Little damage. (Note for high probability event (Almost Certain), this category may be subdivided at a notional boundary of 0.1%. See Risk Matrix.)	MINOR	4
			INSIGNIFICANT	5

Notes: (2) The Approximate Cost of Damage is expressed as a percentage of market value, being the cost of the improved value of the unaffected property which includes the land plus the unaffected structures.

(3) The Approximate Cost is to be an estimate of the direct cost of the damage, such as the cost of reinstatement of the damaged portion of the property (land plus structures), stabilisation works required to render the site to tolerable risk level for the landslide which has occurred and professional design fees, and consequential costs such as legal fees, temporary accommodation. It does not include additional stabilisation works to address other landslides which may affect the property.

(4) The table should be used from left to right; use Approximate Cost of Damage or Description to assign Descriptor, not *vice versa*.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.



**TABLE A1: LANDSLIDE RISK ASSESSMENT
QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY (continued)**

QUALITATIVE RISK ANALYSIS MATRIX – LEVEL OF RISK TO PROPERTY

LIKELIHOOD		CONSEQUENCES TO PROPERTY (With Indicative Approximate Cost of Damage)				
	Indicative Value of Approximate Annual Probability	1: CATASTROPHIC 200%	2: MAJOR 60%	3: MEDIUM 20%	4: MINOR 5%	5: INSIGNIFICANT 0.5%
A - ALMOST CERTAIN	10 ⁻¹	VH	VH	VH	H	M or L (5)
B - LIKELY	10 ⁻²	VH	VH	H	M	L
C - POSSIBLE	10 ⁻³	VH	H	M	M	VL
D - UNLIKELY	10 ⁻⁴	H	M	L	L	VL
E - RARE	10 ⁻⁵	M	L	L	VL	VL
F - BARELY CREDIBLE	10 ⁻⁶	L	VL	VL	VL	VL

Notes: (5) Cell A5 may be subdivided such that a consequence of less than 0.1% is Low Risk.

(6) When considering a risk assessment it must be clearly stated whether it is for existing conditions or with risk control measures which may not be implemented at the current time.

RISK LEVEL IMPLICATIONS

Risk Level		Example Implications (7)
VH	VERY HIGH RISK	Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low; may be too expensive and not practical. Work likely to cost more than value of the property.
H	HIGH RISK	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to Low. Work would cost a substantial sum in relation to the value of the property.
M	MODERATE RISK	May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as practicable.
L	LOW RISK	Usually acceptable to regulators. Where treatment has been required to reduce the risk to this level, ongoing maintenance is required.
VL	VERY LOW RISK	Acceptable. Manage by normal slope maintenance procedures.

Note: (7) The implications for a particular situation are to be determined by all parties to the risk assessment and may depend on the nature of the property at risk; these are only given as a general guide.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.



AUSTRALIAN GEOGUIDE LR2 (LANDSLIDES)

What is a Landslide?

Any movement of a mass of rock, debris, or earth, down a slope, constitutes a “landslide”. Landslides take many forms, some of which are illustrated. More information can be obtained from Geoscience Australia, or by visiting its Australian landslide Database at www.ga.gov.au/urban/factsheets/landslide.jsp. Aspects of the impact of landslides on buildings are dealt with in the book “Guideline Document Landslide Hazards” published by the Australian Building Codes Board and referenced in the Building Code of Australia. This document can be purchased over the internet at the Australian Building Codes Board’s website www.abcb.gov.au.

Landslides vary in size. They can be small and localised or very large, sometimes extending for kilometres and involving millions of tonnes of soil or rock. It is important to realise that even a 1 cubic metre boulder of soil, or rock, weighs at least 2 tonnes. If it falls, or slides, it is large enough to kill a person, crush a car, or cause serious structural damage to a house. The material in a landslide may travel downhill well beyond the point where the failure first occurred, leaving destruction in its wake. It may also leave an unstable slope in the ground behind it, which has the potential to fall again, causing the landslide to extend (regress) uphill, or expand sideways. For all these reasons, both “potential” and “actual” landslides must be taken very seriously. They present a real threat to life and property and require proper management.

Identification of landslide risk is a complex task and must be undertaken by a geotechnical practitioner (GeoGuide LR1) with specialist experience in slope stability assessment and slope stabilisation.

What Causes a Landslide?

Landslides occur as a result of local geological and groundwater conditions, but can be exacerbated by inappropriate development (GeoGuide LR8), exceptional weather, earthquakes and other factors. Some slopes and cliffs never seem to change, but are actually on the verge of failing. Others, often moderate slopes (Table 1), move continuously, but so slowly that it is not apparent to a casual observer. In both cases, small changes in conditions can trigger a landslide with serious consequences. Wetting up of the ground (which may involve a rise in groundwater table) is the single most important cause of landslides (GeoGuide LR5). This is why they often occur during, or soon after, heavy rain. Inappropriate development often results in small scale landslides which are very expensive in human terms because of the proximity of housing and people.

Does a Landslide Affect You?

Any slope, cliff, cutting, or fill embankment may be a hazard which has the potential to impact on people, property, roads and services. Some tell-tale signs that might indicate that a landslide is occurring are listed below:

- Open cracks, or steps, along contours
- Groundwater seepage, or springs
- Bulging in the lower part of the slope
- Hummocky ground
- trees leaning down slope, or with exposed roots
- debris/fallen rocks at the foot of a cliff
- tilted power poles, or fences
- cracked or distorted structures

These indications of instability may be seen on almost any slope and are not necessarily confined to the steeper ones (Table 1). Advice should be sought from a geotechnical practitioner if any of them are observed. Landslides do not respect property boundaries. As mentioned above they can “run-out” from above, “regress” from below, or expand sideways, so a landslide hazard affecting your property may actually exist on someone else’s land.

Local councils are usually aware of slope instability problems within their jurisdiction and often have specific development and maintenance requirements. **Your local council is the first place to make enquiries if you are responsible for any sort of development or own or occupy property on or near sloping land or a cliff.**

TABLE 1 – Slope Descriptions

Appearance	Slope Angle	Maximum Gradient	Slope Characteristics
Gentle	0° - 10°	1 on 6	Easy walking.
Moderate	10° - 18°	1 on 3	Walkable. Can drive and manoeuvre a car on driveway.
Steep	18° - 27°	1 on 2	Walkable with effort. Possible to drive straight up or down roughened concrete driveway, but cannot practically manoeuvre a car.
Very Steep	27° - 45°	1 on 1	Can only climb slope by clutching at vegetation, rocks, etc.
Extreme	45° - 64°	1 on 0.5	Need rope access to climb slope.
Cliff	64° - 84°	1 on 0.1	Appears vertical. Can abseil down.
Vertical or Overhang	84° - 90±°	Infinite	Appears to overhang. Abseiler likely to lose contact with the face.

Some typical landslides which could affect residential housing are illustrated below:

Rotational or circular slip failures (Figure 1) - can occur on moderate to very steep soil and weathered rock slopes (Table 1). The sliding surface of the moving mass tends to be deep seated. Tension cracks may open at the top of the slope and bulging may occur at the toe. The ground may move in discrete "steps" separated by long periods without movement. More rapid movement may occur after heavy rain.

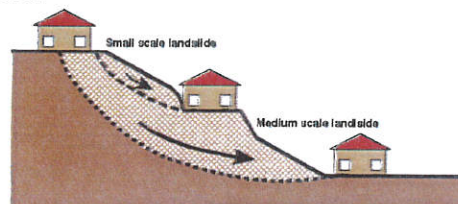


Figure 1

Translational slip failures (Figure 2) - tend to occur on moderate to very steep slopes (Table 1) where soil, or weak rock, overlies stronger strata. The sliding mass is often relatively shallow. It can move, or deform slowly (creep) over long periods of time. Extensive linear cracks and hummocks sometimes form along the contours. The sliding mass may accelerate after heavy rain.

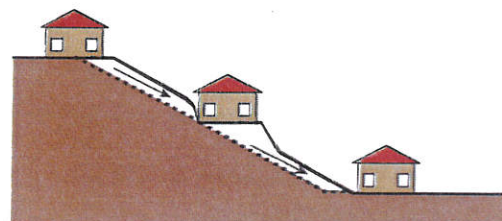


Figure 2

Wedge failures (Figure 3) - normally only occur on extreme slopes, or cliffs (Table 1), where discontinuities in the rock are inclined steeply downwards out of the face.

Rock falls (Figure 3) - tend to occur from cliffs and overhangs (Table 1).

Cliffs may remain, apparently unchanged, for hundreds of years. Collections of boulders at the foot of a cliff may indicate that rock falls are ongoing. Wedge failures and rock falls do not "creep". Familiarity with a particular local situation can instil a false sense of security since failure, when it occurs, is usually sudden and catastrophic.

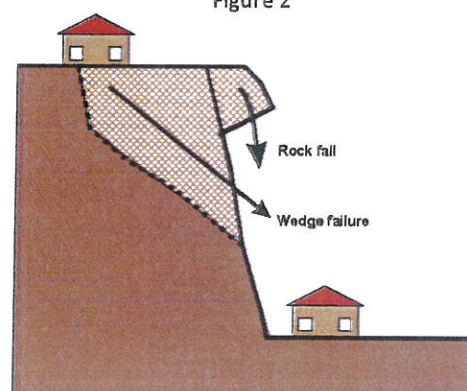


Figure 3

Debris flows and mud slides (Figure 4) - may occur in the foothills of ranges, where erosion has formed valleys which slope down to the plains below. The valley bottoms are often lined with loose eroded material (debris) which can "flow" if it becomes saturated during and after heavy rain. Debris flows are likely to occur with little warning; they travel a long way and often involve large volumes of soil. The consequences can be devastating.

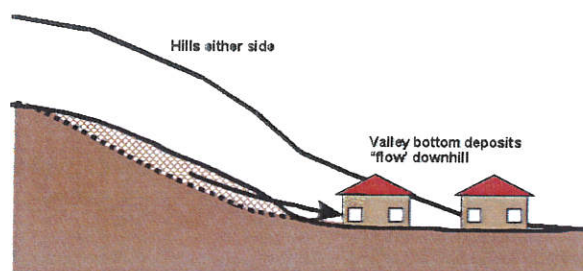


Figure 4

More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 - Introduction
- GeoGuide LR3 - Soil Slopes
- GeoGuide LR4 - Rock Slopes
- GeoGuide LR5 - Water & Drainage
- GeoGuide LR6 - Retaining Walls
- GeoGuide LR7 - Landslide Risk
- GeoGuide LR8 - Hillside Construction
- GeoGuide LR9 - Effluent & Surface Water Disposal
- GeoGuide LR10 - Coastal Landslides
- GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the [Australian Geomechanics Society](#), a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.



AUSTRALIAN GEOGUIDE LR7 (LANDSLIDE RISK)

Concept of Risk

Risk is a familiar term, but what does it really mean? It can be defined as "a measure of the probability and severity of an adverse effect to health, property, or the environment." This definition may seem a bit complicated. In relation to landslides, geotechnical practitioners (see GeoGuide LR1) are required to assess risk in terms of the likelihood that a particular landslide will occur and the possible consequences. This is called landslide risk assessment. The consequences of a landslide are many and varied, but our concerns normally focus on loss of, or damage to, property and loss of life.

Landslide Risk Assessment

Some local councils in Australia are aware of the potential for landslides within their jurisdiction and have responded by designating specific "landslide hazard zones". Development in these areas is normally covered by special regulations. If you are contemplating building, or buying an existing house, particularly in a hilly area, or near cliffs, then go first for information to your local council.

Landslide risk assessment must be undertaken by a geotechnical practitioner. It may involve visual inspection, geological mapping, geotechnical investigation and monitoring to identify:

- potential landslides (there may be more than one that could impact on your site);
- the likelihood that they will occur;
- the damage that could result;
- the cost of disruption and repairs; and
- the extent to which lives could be lost.

Risk assessment is a predictive exercise, but since the ground and the processes involved are complex, prediction tends to lack precision. If you commission a landslide risk assessment

for a particular site you should expect to receive a report prepared in accordance with current professional guidelines and in a form that is acceptable to your local council, or planning authority.

Risk to Property

Table 1 indicates the terms used to describe risk to property. Each risk level depends on an assessment of how likely a landslide is to occur and its consequences in dollar terms. "Likelihood" is the chance of it happening in any one year, as indicated in Table 2. "Consequences" are related to the cost of the repairs and temporary loss of use if the landslide occurs. These two factors are combined by the geotechnical practitioner to determine the Qualitative Risk.

TABLE 2 – LIKELIHOOD

Likelihood	Annual Probability
Almost Certain	1:10
Likely	1:100
Possible	1:1,000
Unlikely	1:10,000
Rare	1:100,000
Barely credible	1:1,000,000

The terms "unacceptable", "may be tolerable" etc. in Table 1 indicate how most people react to an assessed risk level. However, some people will always be more prepared, or better able, to tolerate a higher risk level than others.

Some local councils and planning authorities stipulate a maximum tolerable risk level of risk to property for developments within their jurisdictions. In these situations the risk must be assessed by a geotechnical practitioner. If stabilisation works are needed to meet the stipulated requirements these will normally have to be carried out as part of the development, or consent will be withheld.

TABLE 1 – RISK TO PROPERTY

Qualitative Risk		Significance - Geotechnical engineering requirements
Very high	VH	Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low. May be too expensive and not practical. Work likely to cost more than the value of the property.
High	H	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to acceptable level. Work would cost a substantial sum in relation to the value of the property.
Moderate	M	May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as possible.
Low	L	Usually acceptable to regulators. Where treatment has been needed to reduce the risk to this level, ongoing maintenance is required.
Very Low	VL	Acceptable. Manage by normal slope maintenance procedures.



Risk to Life

Most of us have some difficulty grappling with the concept of risk and deciding whether, or not, we are prepared to accept it. However, without doing any sort of analysis, or commissioning a report from an "expert", we all take risks every day. One of them is the risk of being killed in an accident. This is worth thinking about, because it tells us a lot about ourselves and can help to put an assessed risk into a meaningful context. By identifying activities that we either are, or are not, prepared to engage in, we can get some indication of the maximum level of risk that we are prepared to take. This knowledge can help us to decide whether we really are able to accept a particular risk, or to tolerate a particular likelihood of loss, or damage, to our property (Table 2).

In Table 3, data from NSW for the years 1998 to 2002, and other sources, is presented. A risk of 1 in 100,000 means that, in any one year, 1 person is killed for every 100,000 people undertaking that particular activity. The NSW data assumes that the whole population undertakes the activity. That is, we are all at risk of being killed in a fire, or of choking on our food, but it is reasonable to assume that only people who go deep sea fishing run a risk of being killed while doing it.

It can be seen that the risks of dying as a result of falling, using a motor vehicle, or engaging in water-related activities (including bathing) are all greater than 1:100,000 and yet few people actively avoid situations where these risks are present. Some people are averse to flying and yet it represents a lower risk than choking to death on food. The data also indicate that, even when the risk of dying as a consequence of a particular event is very small, it could still happen to any one of us today. If this were not so, there would be no risk at all and clearly that is not the case.

In NSW, the planning authorities consider that 1:1,000,000 is the maximum tolerable risk for domestic housing built near an obvious hazard, such as a chemical factory. Although not specifically considered in the NSW guidelines there is little difference between the hazard presented by a neighbouring factory and a landslide: both have the capacity to destroy life and property and both are always present.

TABLE 3 – RISK TO LIFE

Risk (deaths per participant per year)	Activity/Event Leading to Death (NSW data unless noted)
1:1,000	Deep sea fishing (UK)
1:1,000 to 1:10,000	Motor cycling, horse riding, ultra-light flying (Canada)
1:23,000	Motor vehicle use
1:30,000	Fall
1:70,000	Drowning
1:180,000	Fire/burn
1:660,000	Choking on food
1:1,000,000	Scheduled airlines (Canada)
1:2,300,000	Train travel
1:32,000,000	Lightning strike

More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 - Introduction
- GeoGuide LR3 - Soil Slopes
- GeoGuide LR4 - Rock Slopes
- GeoGuide LR5 - Water & Drainage
- GeoGuide LR6 - Retaining Walls
- GeoGuide LR7 - Landslide Risk
- GeoGuide LR8 - Hillside Construction
- GeoGuide LR9 - Effluent & Surface Water Disposal
- GeoGuide LR10 - Coastal Landslides
- GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the [Australian Geomechanics Society](#), a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.



APPENDIX B

SOME GUIDELINES FOR HILLSIDE CONSTRUCTION



SOME GUIDELINES FOR HILLSIDE CONSTRUCTION


ADVICE	GOOD ENGINEERING PRACTICE	POOR ENGINEERING PRACTICE
GEO TECHNICAL ASSESSMENT	Obtain advice from a qualified, experienced geotechnical consultant at early stage of planning and before site works.	Prepare detailed plan and start site works before geotechnical advice.
PLANNING		
SITE PLANNING	Having obtained geotechnical advice, plan the development with the risk arising from the identified hazards and consequences in mind.	Plan development without regard for the Risk.
DESIGN AND CONSTRUCTION		
HOUSE DESIGN	Use flexible structures which incorporate properly designed brickwork, timber or steel frames, timber or panel cladding. Consider use of split levels. Use decks for recreational areas where appropriate.	Floor plans which require extensive cutting and filling. Movement intolerant structures.
SITE CLEARING	Retain natural vegetation wherever practicable.	Indiscriminately clear the site.
ACCESS & DRIVEWAYS	Satisfy requirements below for cuts, fills, retaining walls and drainage. Council specifications for grades may need to be modified. Driveways and parking areas may need to be fully supported on piers.	Excavate and fill for site access before geotechnical advice.
EARTHWORKS	CUTS	Indiscriminant bulk earthworks. Large scale cuts and benching. Unsupported cuts. Ignore drainage requirements.
	FILLS	Loose or poorly compacted fill, which if it fails, may flow a considerable distance (including onto properties below). Block natural drainage lines. Fill over existing vegetation and topsoil. Include stumps, trees, vegetation, topsoil, boulders, building rubble etc. in fill.
ROCK OUTCROPS & BOULDERS	Remove or stabilise boulders which may have unacceptable risk. Support rock faces where necessary.	Disturb or undercut detached blocks or boulders.
RETAINING WALLS	Engineer design to resist applied soil and water forces. Found on bedrock where practicable. Provide subsurface drainage within wall backfill and surface drainage on slope above. Construct wall as soon as possible after cut/fill operation.	Construct a structurally inadequate wall such as sandstone flagging, brick or unreinforced blockwork. Lack of subsurface drains and weepholes.
FOOTINGS	Found within bedrock where practicable. Use rows of piers or strip footings oriented up and down slope. Design for lateral creep pressures if necessary. Backfill footing excavations to exclude ingress of surface water.	Found on topsoil, loose fill, detached boulders or undercut cliffs.
SWIMMING POOLS	Engineer designed. Support on piers to rock where practicable. Provide with under-drainage and gravity drain outlet where practicable. Design for high soil pressures which may develop on uphill side whilst there may be little or no lateral support on downhill side.	
DRAINAGE	SURFACE	Discharge at top of fills and cuts. Allow water to pond bench areas.
	SUBSURFACE	Discharge of roof run-off into absorption trenches.
SEPTIC & SULLAGE	Provide filter around subsurface drain. Provide drain behind retaining walls. Use flexible pipelines with access for maintenance. Prevent inflow of surface water. Usually requires pump-out or mains sewer systems; absorption trenches may be possible in some areas if risk is acceptable. Storage tanks should be water-tight and adequately founded.	Discharge sullage directly onto and into slopes. Use of absorption trenches without consideration of landslide risk.
EROSION CONTROL & LANDSCAPING	Control erosion as this may lead to instability. Revegetate cleared area.	Failure to observe earthworks and drainage recommendations when landscaping.
DRAWINGS AND SITE VISITS DURING CONSTRUCTION		
DRAWINGS	Building Application drawings should be viewed by a geotechnical consultant.	
SITE VISITS	Site visits by consultant may be appropriate during construction.	
INSPECTION AND MAINTENANCE BY OWNER		
OWNER'S RESPONSIBILITY	Clean drainage systems; repair broken joints in drains and leaks in supply pipes. Where structural distress is evident seek advice. If seepage observed, determine cause or seek advice on consequences.	

This table is extracted from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in *Australian Geomechanics*, Vol 42, No 1, March 2007 which discusses the matter more fully.

AUSTRALIAN GEOGUIDE LR8 (CONSTRUCTION PRACTICE)

Sensible development practices are required when building on hillsides, particularly if the hillside has more than a low risk of instability (GeoGuide LR7). Only building techniques intended to maintain, or reduce, the overall level of landslide risk should be considered. Examples of good hillside construction practice are illustrated below.

EXAMPLES FOR GOOD HILLSIDE CONSTRUCTION PRACTICE

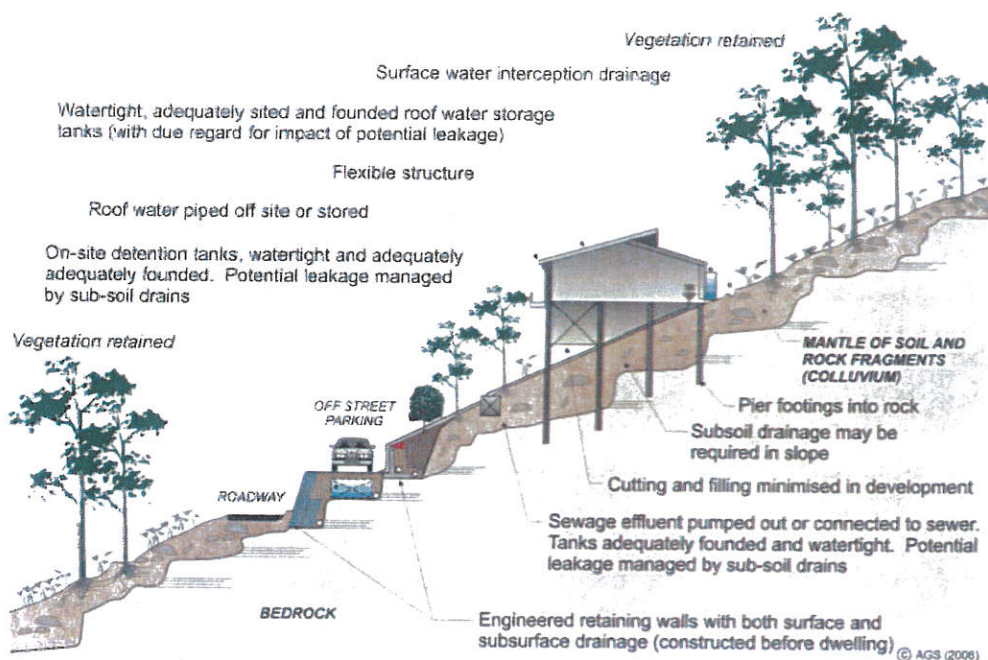

WHY ARE THESE PRACTICES GOOD?

Roadways and parking areas - are paved and incorporate kerbs which prevent water discharging straight into the hillside (GeoGuide LR5).

Cuttings - are supported by retaining walls (GeoGuide LR6).

Retaining walls - are engineer designed to withstand the lateral earth pressures and surcharges expected, and include drains to prevent water pressures developing in the backfill. Where the ground slopes steeply down towards the high side of a retaining wall, the disturbing force (see GeoGuide LR6) can be two or more times that due to level ground. Retaining walls must be designed taking these forces into account.

Sewage - whether treated or not is either taken away in pipes or contained in properly founded tanks so it cannot soak into the ground.

Surface water - from roofs and other hard surfaces is piped away to a suitable discharge point rather than being allowed to infiltrate into the ground. Preferably, the discharge point will be in a natural creek where ground water exits, rather than enters, the ground. Shallow, lined, drains on the surface can fulfill the same purpose (GeoGuide LR5).

Surface loads - are minimised. No fill embankments have been built. The house is a lightweight structure. Foundation loads have been taken down below the level at which a landslide is likely to occur and, preferably, to rock. This sort of construction is probably not applicable to soil slopes (GeoGuide LR3). If you are uncertain whether your site has rock near the surface, or is essentially a soil slope, you should engage a geotechnical practitioner to find out.


Flexible structures - have been used because they can tolerate a certain amount of movement with minimal signs of distress and maintain their functionality.

Vegetation clearance - on soil slopes has been kept to a reasonable minimum. Trees, and to a lesser extent smaller vegetation, take large quantities of water out of the ground every day. This lowers the ground water table, which in turn helps to maintain the stability of the slope. Large scale clearing can result in a rise in water table with a consequent increase in the likelihood of a landslide (GeoGuide LR5). An exception may have to be made to this rule on steep rock slopes where trees have little effect on the water table, but their roots pose a landslide hazard by dislodging boulders.

Possible effects of ignoring good construction practices are illustrated on page 2. Unfortunately, these poor construction practices are not as unusual as you might think and are often chosen because, on the face of it, they will save the developer, or owner, money. You should not lose sight of the fact that the cost and anguish associated with any one of the disasters illustrated, is likely to more than wipe out any apparent savings at the outset.

ADOPT GOOD PRACTICE ON HILLSIDE SITES

EXAMPLES FOR **POOR** HILLSIDE CONSTRUCTION PRACTICE

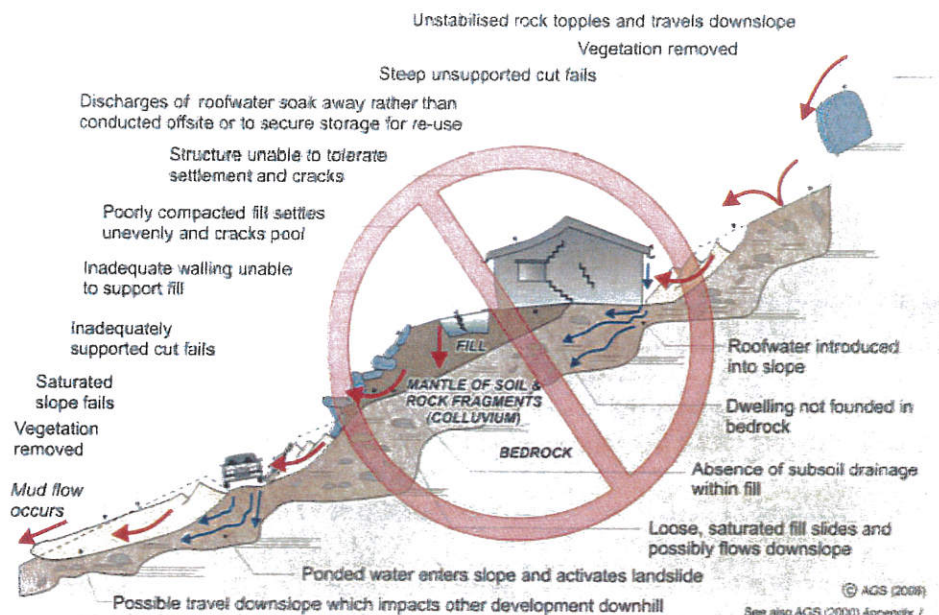

WHY ARE THESE PRACTICES POOR?

Roadways and parking areas - are unsurfaced and lack proper table drains (gutters) causing surface water to pond and soaks into the ground.

Cut and fill - has been used to balance earthworks quantities and level the site leaving unstable cut faces and added large surface loads to the ground. Failure to compact the fill properly has led to settlement, which will probably continue for several years after completion. The house and pool have been built on the fill and have settled with it and cracked. Leakage from the cracked pool and the applied surface loads from the fill have combined to cause landslides.

Retaining walls - have been avoided, to minimise cost, and hand placed rock walls used instead. Without applying engineering design principles, the walls have failed to provide the required support to the ground and have failed, creating a very dangerous situation.

A heavy, rigid, house - has been built on shallow, conventional, footings. Not only has the brickwork cracked because of the resulting ground movements, but it has also become involved in a man-made landslide.

Soak-away drainage - has been used for sewage and surface water run-off from roofs and pavements. This water soaks into the ground and raises the water table (GeoGuide LR5). Subsoil drains that run along the contours should be avoided for the same reason. If felt necessary, subsoil drains should run steeply downhill in a chevron, or herringbone, pattern. This may conflict with the requirements for effluent and surface water disposal (GeoGuide LR9) and if so, you will need to seek professional advice.

Rock debris - from landslides higher up on the slope seems likely to pass through the site. Such locations are often referred to by geotechnical practitioners as "debris flow paths". Rock is normally even denser than ordinary fill, so even quite modest boulders are likely to weigh many tonnes and do a lot of damage once they start to roll. Boulders have been known to travel hundreds of metres downhill leaving behind a trail of destruction.

Vegetation - has been completely cleared, leading to a possible rise in the water table and increased landslide risk (GeoGuide LR5).

DON'T CUT CORNERS ON HILLSIDE SITES - OBTAIN ADVICE FROM A GEOTECHNICAL PRACTITIONER

More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 - Introduction
- GeoGuide LR3 - Soil Slopes
- GeoGuide LR4 - Rock Slopes
- GeoGuide LR5 - Water & Drainage
- GeoGuide LR6 - Retaining Walls
- GeoGuide LR7 - Landslide Risk
- GeoGuide LR8 - Hillside Construction
- GeoGuide LR9 - Effluent & Surface Water Disposal
- GeoGuide LR10 - Coastal Landslides
- GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the [Australian Geomechanics Society](#), a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.