



Geotechnical Assessment

Project: Alterations & Additions
2/1 Lister Avenue, Seaforth NSW

Prepared for:
Mr & Mrs Vescio

Ref: AG 25134
9 April 2025



WHAT TO DO WITH THIS REPORT

While your geotechnical assessment report may be a statutory requirement from council in support of your development application, it also contains information important to the structural design and construction methodology of your project. Therefore, it is critical that all relevant parties are provided with a copy of this report.

We suggest you give a copy of your geotechnical assessment report to:

- | | |
|--|---|
| <input type="checkbox"/> Your Architect/Building Designer | <input type="checkbox"/> Your Structural/Stormwater/Civil Engineer |
| <input type="checkbox"/> Your Certifier | <input type="checkbox"/> Your Project Manager |
| <input type="checkbox"/> Your Excavation Contractor | <input type="checkbox"/> Your Builder |

We would also suggest that if any of your project team have questions regarding the contents of this report, that we be contacted for clarification.

NEXT CRITICAL STAGES

Keep in mind that you will need AscentGeo again at different stages of your project. This may include:

- ☐ **Review or endorsement of structural plans/architectural plans for a Construction Certificate**
- ☐ **Foundation/Footing inspection during construction**
- ☐ **Excavation hold point inspection, usually at hold points not exceeding 1.5m drops**
- ☐ **Final inspection and certification for an Occupation Certificate upon completion of works**

GENERAL ADVICE

If after reading this report you have any questions, are unsure what to do next or when you need to get in touch, please reach out to us.

Given AscentGeo can't be on site the whole time, we recommend that you or/and your builder take a lot of progress photos, especially during excavation. Many of the potential problems that may pop up can be resolved if we have clear photos of the work that's been done.

A lot can change on site during a construction project: some of these changes are normal and innocuous, while others can be symptoms of larger or more serious issues. For this reason, it's important to contact us to discuss any changes you notice on site that you aren't sure about. This could include but not be limited to changes to ground or surface water, movement of structures, and settlement of paths or landscaping elements.



We're here to help.

The AscentGeo Team

Geotechnical Assessment

For Alterations & Additions at

2/1 Lister Avenue, Seaforth NSW

Document Status			Approved for Issue	
Version	Author		Reviewer	Date
1	<div> Josh Watts BSc(Hons) MSc GeoEng MAIG</div>		<div> Ben Morgan BScGeol MAIG RPGeo</div>	09.04.2025
Document Distribution				
Version	Copies	Format	To	Date
1	1	PDF	R&R Building Design	09.04.2025
1	1	PDF	Mr & Mrs Vescio	09.04.2025

Limitations

This report has been prepared for Mr & Mrs Vescio, c/- R&R Building Design, in accordance with AscentGeo's fee proposal dated 26 March 2025.

The report is provided for the exclusive use of the property owner and their nominated agents for the specific development and purpose as described in the report. This report must not be used for purposes other than those outlined in the report or applied to any other projects.

The information contained within this report is considered accurate at the time of issue with regard to the current conditions on site as identified by AscentGeo and the documentation provided by others.

The report should be read in its entirety and should not be separated from its attachments or supporting notes. It should not have sections removed or included in other documents without the express approval of AscentGeo.

Contents

1	Overview	3
1.1	Background	3
1.2	Proposed Development	3
1.3	Relevant Instruments	3
2	Site Description	4
2.1	Summary	4
2.2	Site Description	5
2.3	Geology and Geological Interpretation	5
2.4	Fieldwork	5
3	Geotechnical Assessment	6
3.1	Geological Model	6
3.2	Site Classification	7
3.3	Groundwater	7
3.4	Surface Water	8
3.5	Slope Instability	8
3.6	Geotechnical Hazards and Risk Analysis	8
3.7	Conclusion and Recommendations	9
4	References	15
5	Appendices	
Appendix A:	Site plan/ground test locations and geological cross section	
Appendix B:	Site photos	
Appendix C:	Engineering logs	
Appendix D:	General notes	
	CSIRO Publishing, 2012. 'Foundation Maintenance and Footing Performance: A Homeowners Guide', Sheet BTF-18.	
	Australian GeoGuide LR8, 2007. 'Examples of Good/Bad Hillside Construction Practice'.	
	Australian Geomechanics, 2007. 'Practice Note Guidelines for Landslide Management', Appendix C: Qualitative Terminology.	
Appendix E:	Map of Geotechnical Areas – Manly (NBC)	

1 Overview

1.1 Background

This report presents the findings of a geotechnical assessment carried out at 2/1 Lister Avenue, Seaforth (the 'Site'), by AscentGeo. This geotechnical assessment has been prepared to meet Northern Beaches Council lodgement requirements for a Development Application (DA), as well as informing detailed structural design and construction methodology.

1.2 Proposed Development

The proposed development will take place on Lot 2 in SP36205, being 2/1 Lister Avenue, Seaforth.

Details of the proposed development are outlined in a series of architectural drawings prepared by R&R Building Design, project number 241230/DA, drawing numbers DA1 –DA13, DA 16, DA 17, dated 20 March 2025.

The works comprise the following:

- Partial demolition of the existing property, and demolition of the pergola and landscaping elements
- Footings preparation
- Construction of two-storey extension, 'Plungie' (plunge pool), terrace and carport
- Associated hard and soft landscaping.

1.3 Relevant Instruments

This geotechnical assessment has been prepared in accordance with the following relevant guidelines and standards:

- Northern Beaches Council – Manly Local Environment Plan (MLEP) 2013 and Manly Development Control Plan (MDCP) 2013
- Australian Geomechanics Society's 'Landslide Risk Management Guidelines' (AGS 2007)
- Australian Standard 1726–2017 Geotechnical Site Investigations
- Australian Standard 2870–2011 Residential Slabs and Footings
- Australian Standard 1289.6.3.2–1997 Methods of Testing Soils for Engineering Purposes
- Australian Standard 3798–2007 Guidelines on Earthworks for Commercial and Residential Developments.

2 Site Description

2.1 Summary

A summary of site conditions identified at the time of our assessment is provided in Table 1.

Table 1. Summary of site conditions

Parameter	Description
Site visit	Josh Watts, Engineering Geologist – 01/04/2025
Site address	2/1 Lister Avenue, Seaforth – Lot 2 in SP36205
Site area m ² (approx.)	859m ² (by calc.)
Existing development	Single-storey brick house with pergola, carport and bricked patio.
Slope Aspect	Northerly
Average gradient	~5 degrees.
Vegetation	Lawn areas. Small to large shrubs and trees.
Retaining structures	<p>The northern side of the lawn area is supported by a timber wall, measuring approximately 0.6m high. The walls appeared in good condition at the time of the investigation.</p> <p>The southwestern corner of the site is supported to neighbouring properties by a timber wall (0.30m high) with a brick constructed wall on top (0.30m high). Both walls appeared to be in good condition at the time of the investigation.</p>
Neighbouring environment	Residentially developed to the east, south, west and partially to the north. Lister Avenue is located to the north.

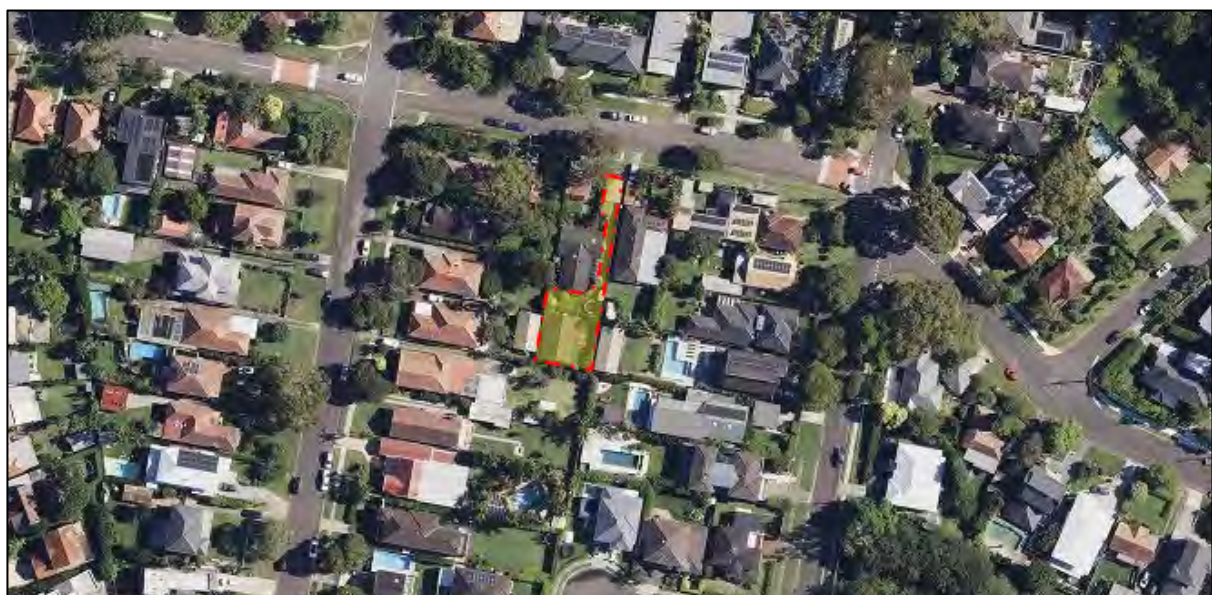


Figure 1. Site location – 2/1 Lister Avenue, Seaforth NSW (© SIX Maps NSW Gov)

2.2 Site Description

The subject site is situated in a residential area, has an irregular shape and is bounded by residential dwellings to the east, south, west and partially to the north of the site. Lister Avenue runs along the front (northern) boundary of the site. The site is on minimally sloping ground with a gradient of ~5 degrees, with northeasterly aspect (roughly falling to its front). Appendix A shows the site plan.

The existing building at the site is a single-storey brick house with a detached carport, pergola, brick patio and grassed front yard and patioed rear/ side yard. The front garden is supported to the north by a 0.6m high timber wall. Neighbouring buildings are mostly single and double storey dwellings.

No outcropping bedrock was observed onsite or on the adjacent properties.

Photographs presented in Appendix B show the general conditions of the site on the day of the site visit conducted by AscentGeo.

2.3 Geology and Geological Interpretation

The Geological Survey of New South Wales (GSNSW) Seamless Geology Project Version 2.4, May 2024, accessed via MinView, indicates that the site is underlain by Middle Triassic Hawkesbury Sandstone (Tuth). The Hawkesbury rock is typically comprised of medium to coarse-grained quartz sandstones, minor shale and laminite lenses.

The soil profile consists of shallow uncontrolled fill and silty topsoil (O & A Horizons), silty sand (B Horizon) and weathered sandstone bedrock (C Horizon). Based on our observations and the results of testing on site, we would typically expect very low to medium strength, moderately to slightly weathered sandstone bedrock to be found within 0.5m to 1.3m below current surface levels across the area of the proposed works and potentially deeper where filling has been carried out.

Note: The local geology is comprised predominantly of sandstone. The sandstone bedrock is often found in benched terraces, subsequently ground conditions on site may alter significantly across short distances. This variability should be anticipated and accounted for in the design and construction of any new foundations.

2.4 Fieldwork

A site visit and investigation was undertaken on the 1 April 2025, which included a geotechnically focused visual assessment of the property and its surrounds; geotechnical mapping; photographic documenting; and a limited subsurface investigation including hand auger borehole and dynamic cone penetrometer (DCP) testing.

Hand Auger Borehole Testing

Five (5) hand auger boreholes (BH01 to BH05) tests were drilled at the approximate locations shown on the site plan (Appendix A) to visually identify the subsurface material. Due to the presence of a suspected service, three boreholes were undertaken in the location of the proposed swimming pool. Engineering logs of the hand auger boreholes are presented in Appendix C.

Dynamic Cone Penetrometer (DCP) Testing

Five (5) DCP tests were carried out to assess the in situ relative density of the shallow soils and the depth to weathered rock. These tests were carried out in accordance with the Australian Standard for ground testing: AS 1289.6.3.2–1997 'Methods of testing soils for engineering purposes'. Test locations were constrained by existing structures, sandstone floaters, hard surfaces and the presence of utilities.

The location of these tests is shown on the site plan in Appendix A and a summary of the test results is presented in Table 2, with the full details in the engineering logs in Appendix C.

Table 2. Summary of DCP test results

Test	Summary
DCP 1	Refusal @ 0.75m. Bouncing on assumed sandstone bedrock. Brownish grey sand on moist tip.
DCP 2	Refusal @ 1.30m. Bouncing on assumed sandstone bedrock. Orangish brown sand on wet tip.
DCP 3	Refusal @ 0.55m. Bouncing on assumed sandstone bedrock. Orangish brown sand on wet tip.
DCP 4	Refusal @ 0.60m. Bouncing on assumed sandstone bedrock. Greyish brown sand on wet tip.
DCP 5	Refusal @ 1.10m. Bouncing on assumed sandstone bedrock. Grey sand on wet tip.

Note: The equipment chosen to undertake ground investigations provides the most cost-effective method for understanding the subsurface conditions given site access constraints. Our interpretation of the subsurface conditions is limited to the results of testing undertaken and the known geology in the area. While care is taken to identify the subsurface conditions on site, variation between the interpreted model presented herein and the actual conditions on site may occur. Should actual ground conditions vary from those anticipated, we recommend that the geotechnical consultant at AscentGeo is informed as soon as possible to advise if modifications to our recommendations are required.

3 Geotechnical Assessment

3.1 Geological Model

Based on the results of our site assessment, ground testing, geological mapping and our experience in the area, the subsurface conditions encountered on site may be summarised as follows in Table 3.

Table 3. Interpreted geological model

Unit	Material	Comments
1	Topsoil / Fill	Sandy topsoil and fill material. Unit 1 is inferred to be uncontrolled and poorly compacted.
2	Silty Sand	Fine to medium grained silty sand of the natural profile.
3	Sandstone	Medium strength or greater sandstone bedrock (Class III+*) expected to be found below the weathered crust (Class IV-V*).

* Pells, PJN, Mostyn, G & Walker, F, 1998 (Dec). 'Foundations on sandstone and shale in the Sydney region'. *Australian Geomechanics Journal*, vol. 33, no. 3, pp. 17–29.

3.2 Site Classification

Due to the the proximity to the large trees, the Site is classified as “P” in accordance with AS 2870–2011. A classification of “A” may be adopted for footings taken to competent sandstone bedrock.

Table 4. Site classification table for residential slabs and footings (AS 2870-2011)

Site Classification	Soil description	Expected range of movement
A	Most sand and rock sites with little or no ground movement from moisture changes.	
S	Slight reactive clay sites, which may experience only slight ground movement from moisture changes.	0–20mm
M	Moderately reactive clay or silt sites, which may experience moderate ground movement from moisture changes.	20–40mm
H1	Highly reactive clay sites, which may experience high ground movement from moisture changes.	40–60mm
H2	Highly reactive clay sites, which may experience very high ground movement from moisture changes.	60–75mm
E	Extremely reactive sites, which may experience extreme ground movement from moisture changes.	>75mm
P	May consist of any of the above soil types, but in combination with site conditions produce undesirable foundations. P sites may also include fill, soft soils, mine subsidence, collapsing soils, prior or potential landslip, soils subject to erosion, reactive sites subject to abnormal moisture conditions, or sites which cannot be classified otherwise.	

3.3 Groundwater

Minor groundwater was encountered during testing, this is likely as a result of normal seepage following recent heavy rainfalls.

Whilst dedicated groundwater monitoring was not within the scope of this assessment, due to the site elevation and position of the site relative to the slope and the underlying geology, no significant standing water table is expected to influence the site. The groundwater regime is not expected to be significantly affected by the proposed works, and it is considered unnecessary to undertake preconstruction or construction stage groundwater monitoring.

Groundwater seepage during and after periods of inclement weather should be anticipated through permeable soil layers, close to the interface with weathered rock and from joints and discontinuities deeper in the weathered rock. Appropriate ground support measures should be utilised in soils

overlying rock to manage any localised groundwater inflows and prevent ground loss due to saturated/fluidised sands.

There is a potential for natural intermittent perched groundwater to develop above shallow bedrock and/or above any other low permeability impervious horizons, such as clays in overlying soils or siltstone/shale bands in rock.

3.4 Surface Water

Overland or surface flows entering the site from the adjoining areas were not identified at the time of our inspection; however, normal overland runoff could enter the site from adjacent areas during heavy or extended rainfall. Appropriate surface water diversions should be implemented to prevent overland runoff entering the site from adjacent areas during heavy or extended rainfall.

3.5 Slope Instability

A landslide hazard assessment of the existing slope has been undertaken in general accordance with Australian Geomechanics Society's 'Practice Note Guidelines for Landslide Risk Management', published in March 2007.

- No evidence of significant soil creep, tension cracks or landslip instability were identified across the site or on adjacent properties as viewed from the subject site at the time of our inspection.
- The site is mapped as **G4** landslide risk/geotechnical hazard with reference to Schedule 1 – Map C – Potential Geotechnical Landslip Hazard Areas, Manly DCP, Northern Beaches Council (**Appendix D**).

3.6 Geotechnical Hazards and Risk Analysis

No significant geotechnical hazards were identified above, beside or below the subject site, including but not limited to the immediately adjoining residential properties, and the road reserve.

The scope of the proposed excavations on site, and the local geology make this site susceptible to instability during the proposed construction works. Careful control of all site works will be required during the installation of any required retention systems, excavations, and the construction of the proposed structures to maintain the stability of the block, and adjacent land.

Based on observation made during our site assessment, the following geological/geotechnical hazards have been identified in relation to the proposed works:

- **Hazard One:** Failure of the proposed excavations.

Table 5. Risk analysis summary

HAZARDS	HAZARD ONE
TYPE	Failure of the proposed excavations
LIKELIHOOD	'Possible' (10^{-3})
CONSEQUENCES TO PROPERTY	'Minor' (5%)
RISK TO PROPERTY	'Moderate' (2×10^{-3})
RISK TO LIFE	4.5×10^{-4} /annum
COMMENTS	Following implementation of the recommendations outlined in Section 3.6, the above risk levels would reduce to 'Acceptable' levels within the site.

3.7 Conclusion and Recommendations

The proposed development is considered to be suitable for the site. The existing conditions and proposed development are considered to constitute an '**ACCEPTABLE**' risk to life and a '**LOW**' risk to property *provided that the recommendations outlined in Table 6 are adhered to during design and construction.*

Table 6. Geotechnical recommendations

Recommendation	Description
Soil Excavation	<p>Minor soil excavation will be required for the construction of the swimming pool and to establish new footings across the site. It is anticipated that these excavations will encounter shallow uncontrolled fill and silty topsoil, silty-clayey sand, and weathered sandstone bedrock. The excavation of soil, sand and extremely weathered sandstone rock should be possible with the use of bucket excavators and rippers, or for piered footings, traditional auger attachments.</p> <p>Temporary batter slopes may be considered where setbacks from existing structures and property boundaries permits. For shallow excavations (<1.0m), provided the residual soil is battered back to a minimum of 35 degrees, they should remain stable without support for a short period until permanent support is in place. Unsupported batter slopes in sandy soil will be prone to erosion in inclement weather.</p> <p>If permanent batters are proposed, the unsupported batter must not be steeper than 30 degrees and should be protected from erosion by geotextile fabric pinned to the slope and planted with soil binding vegetation.</p>

Recommendation	Description															
Rock Excavation	<p>All excavation recommendations as outlined below should be read in conjunction with Safe Work Australia’s <i>Code of Practice: Excavation Work</i>, published in October 2018.</p> <p>It is essential that any excavation through rock that cannot be readily achieved with a bucket excavator or ripper should be carried out initially using a rock saw to minimise the vibration impact and disturbance on the adjoining properties, existing structures and any previously installed supporting systems. Any rock breaking must be carried out only after the rock has been sawed, and in short bursts (2–5 seconds), to prevent the vibration amplifying. The break in the rock from the saw must be between the rock to be broken and the closest adjoining structure.</p> <p>Vertical or sub-vertical excavation through weathered bedrock should stand unsupported until permanent supporting structures are installed. Careful inspection of cut faces at hold points not exceeding 1.5m drops by AscentGeo should be carried out to ensure no significant geological defects such as clay seems, joints or fractures are present in the rock, and to advise if any temporary supporting measures such as rock bolts are required.</p> <p>All excavated material is to be removed from the site in accordance with current Office of Environment and Heritage (OEH) regulations.</p>															
Vibrations	<p>The Australian Standard AS 2670.1–2001 ‘Evaluation of human exposure to whole-body vibration General requirements. Part 1: General requirements’, suggests a daytime limit of 5mm/s component PPV for human comfort is acceptable. In general, vibration criteria for human disturbance are more stringent than vibration criteria for effects on building contents and building structural damage. Hence, compliance with the more stringent limits dictated for human exposure, would ensure that compliance is also achieved for the other two categories. Furthermore, it is noted that this approach satisfies the requirements of Appendix J of AS 2187.2–2006 ‘Explosives – storage and use’, which also limits PPV to 5mm/s for residential settings.</p> <p>As such, we would suggest that the recommendations for method and/or equipment presented in the table below be adopted to maintain an allowable vibration limit of 5mm/s PPV.</p> <table><tr><th></th><th colspan="2">Maximum Peak Particle Velocity 5mm/sec</th></tr><tr><th>Distance from adjoining structure (m)</th><th>Equipment</th><th>Operating Limit (% of Maximum Capacity)</th></tr><tr><td>1.5 – 2.5</td><td>Hand operated jackhammer only</td><td>100</td></tr><tr><td>2.5 – 5.0</td><td>300kg rock hammer</td><td>50</td></tr><tr><td>5.0 – 10.0</td><td>300kg rock hammer or 600kg rock hammer</td><td>100 (300kg) or 50 (600kg)</td></tr></table>		Maximum Peak Particle Velocity 5mm/sec		Distance from adjoining structure (m)	Equipment	Operating Limit (% of Maximum Capacity)	1.5 – 2.5	Hand operated jackhammer only	100	2.5 – 5.0	300kg rock hammer	50	5.0 – 10.0	300kg rock hammer or 600kg rock hammer	100 (300kg) or 50 (600kg)
	Maximum Peak Particle Velocity 5mm/sec															
Distance from adjoining structure (m)	Equipment	Operating Limit (% of Maximum Capacity)														
1.5 – 2.5	Hand operated jackhammer only	100														
2.5 – 5.0	300kg rock hammer	50														
5.0 – 10.0	300kg rock hammer or 600kg rock hammer	100 (300kg) or 50 (600kg)														

Recommendation	Description																														
	<p>It may be necessary to move to smaller rock hammers or to rotary grinders or rock saws if vibrations limits cannot be met. (Manufactures of the plant should be contacted for information regarding peak vibration output.)</p> <p>The propagation of vibrations can be mitigated by pulsing the use of rock hammers, i.e., short bursts, utilising line sawing along boundaries.</p> <p>It is essential that at all times excavation equipment must be operated by experienced personnel, according to the manufacturer’s instructions and in a manner consistent with minimising vibration effects.</p>																														
Excavation Support	<p>From the drawings provided, it is understood that excavations of approximately 1.8m will be required to accommodate the plunge pool. The excavations are expected to encounter fill/ topsoil/ clayey sand and sandstone bedrock.</p> <p>Temporary support of the soil materials will be required to prevent soil loss across the eastern boundary. This is expected to be managed with temporary shoring to be installed by the builder. The permanent retaining walls of the swimming pool/ extension should be installed as soon as practical following the completion of the excavation.</p> <p>Where excavations do not extend to site boundaries and recommended batter angles are achieved, significant excavation support is not anticipated, provided exposed soil batters are covered to prevent excessive moisture infiltration or evaporation.</p> <p>Vertical or subvertical excavation through competent sandstone bedrock should stand unsupported permanently. Where permanent sandstone excavations are required, drainage channels should be installed at the base of the excavations to adequately discharge any natural seepage that may occur.</p>																														
Retaining Structures	<p>Retention systems should be designed by a qualified structural engineer in accordance with Australian Standard AS 4678 using the following geotechnical parameters:</p> <table><tr><th colspan="3"></th><th colspan="3">Earth Pressure Coefficients</th></tr><tr><th>(Unit) Material</th><th>Bulk Unit Weight (kN/m³)</th><th>Friction Angle (°)</th><th>Active K_a</th><th>At Rest K₀</th><th>Passive K_p</th></tr><tr><td>(Unit 1) Fill / Topsoil</td><td>18</td><td>29</td><td>0.38</td><td>0.60</td><td>2.00</td></tr><tr><td>(Unit 2) Sand</td><td>19</td><td>30</td><td>0.33</td><td>0.50</td><td>3.00</td></tr><tr><td>(Unit 3) Sandstone Class IV</td><td>23</td><td>35</td><td>0.25</td><td>0.40</td><td>4.00</td></tr></table>				Earth Pressure Coefficients			(Unit) Material	Bulk Unit Weight (kN/m ³)	Friction Angle (°)	Active K _a	At Rest K ₀	Passive K _p	(Unit 1) Fill / Topsoil	18	29	0.38	0.60	2.00	(Unit 2) Sand	19	30	0.33	0.50	3.00	(Unit 3) Sandstone Class IV	23	35	0.25	0.40	4.00
			Earth Pressure Coefficients																												
(Unit) Material	Bulk Unit Weight (kN/m ³)	Friction Angle (°)	Active K _a	At Rest K ₀	Passive K _p																										
(Unit 1) Fill / Topsoil	18	29	0.38	0.60	2.00																										
(Unit 2) Sand	19	30	0.33	0.50	3.00																										
(Unit 3) Sandstone Class IV	23	35	0.25	0.40	4.00																										

Recommendation	Description
	<p>Retention systems should be designed to prevent hydrostatic pressure from developing behind the wall. As such, retaining walls to be constructed as part of the site works are to incorporate back wall subsoil drainage pipes, and are to be backfilled with suitable free-draining materials wrapped in a non-woven geotextile fabric (i.e., Bidim A34 or similar) to prevent the clogging of the drainage with fine-grained sediment.</p> <p>Design of appropriate retention systems should consider potential surcharges from sloping land above the wall, soil creep, adjacent structures and footings, and construction related activities such as compaction of fill, traffic of vehicles and construction plant.</p>
Footings	<p>It is currently unclear whether the existing footings of the dwelling will be reused in this development. If reuse is proposed, it is recommended that test pits be excavated by the builder to confirm the foundation materials supporting the existing footings. Any footings not taken sandstone bedrock are to be deepened onto the sandstone bedrock.</p> <p>We recommend that all new footings are taken to and founded directly upon the underlying sandstone bedrock (Unit 3) using piers as required.</p> <p>The allowable bearing pressure for footings taken to competent weathered sandstone bedrock of at least low strength is 800kPa. Higher allowable bearing capacities may be achievable subject to inspection and certification of excavated footings by AscentGeo.</p> <p>Alternatively, foundations for the proposed carport could be placed within the natural medium dense sand (anticipated to be encountered at a minimum depth of 0.60mbgl, based upon the DCP results within this area), with an allowable bearing pressure of 100kPa.</p> <p>Pier footings should be of sufficient diameter to enable effective base cleaning to be carried out during construction. Small diameter piers that cannot be cleaned should be designed for shaft friction, resulting in a longer rock socket.</p> <p>To mitigate the risk of differential settlement, it is essential that all footings are founded on material of similar consistency. This may require the deepening or the relocation of some footings.</p> <p>It is essential that the foundation materials of all footing excavations be inspected and approved before steel reinforcement and concrete is placed. This inspection should be scheduled while excavation plant and operators are still on site, and before steel reinforcement has been fixed or the concrete booked.</p>
Fills	<p>Any fill that may be required is to comprise local sand, clay, and weathered rock. Existing organic topsoil is to be cleared in preparation for the introduction of fill.</p>

Recommendation	Description
	<p>Any new fill material is to be placed in layers not more than 250mm thick and compacted to not less than 95% of Standard Optimum Dry Density at plus or minus 2% of Standard Optimum Moisture Content. If supporting pavements or slabs, any new fill must be compacted to not less than 98% of Standard Optimum Dry Density at plus or minus 2% of Standard Optimum Moisture Content for the uppermost 300mm.</p> <p>All new fill placement is to be carried out in accordance with AS 3798–2007 ‘Guidelines on earthworks for commercial and residential developments’.</p> <p>Fill should not be placed on the site outside of the lateral extent of new engineered retaining walls. The retaining walls should be in place prior to the placement of new fill, with suitable permanent and effective drainage of backfill.</p>
Sediment and Erosion Control	<p>Appropriate design and construction methods shall be required during site works to minimise erosion and provide sediment control. In particular, siltation fencing, and barriers will be required and are to be designed by others.</p>
Stormwater Disposal	<p>The effective management of ground and surface water on site may be the most important factor in the long-term performance of built structures, and the stability of the block more generally.</p> <p>It is essential that gutters, downpipes, drains, pipes, and connections are appropriately sized, functioning effectively, and discharging appropriately via non-erosive discharge.</p> <p>All stormwater collected from hard surfaces is to be collected and piped directly to the council stormwater network through any storage tanks or on-site detention that may be required by the regulating authorities, and in accordance with all relevant Australian Standards and the detailed stormwater management plan by others.</p> <p>Saturation of soils is one of the key triggers for many landslide events and a significant factor in destabilisation of structures over time. As such, the review and design of stormwater systems must consider climate change and the increased potential for periods of concentrated heavy rainfall.</p>
Inspections	<p>It is essential that the foundation materials of all footing excavations be visually assessed and approved by AscentGeo before steel reinforcement and concrete is placed.</p> <p>Failure to engage AscentGeo for the required foundation material inspections will negate our ability to provide final geotechnical sign off or certification.</p>

Recommendation	Description
Conditions Relating to Design and Construction Monitoring	<p>To comply with Northern Beaches Council conditions and/or Private Certifier requirements it may be necessary at the following stages for AscentGeo to:</p> <ul style="list-style-type: none">• Review the geotechnical content of all structural designs prior to the issue of Construction Certificate• Complete the abovementioned foundation material inspections during construction to ensure compliance to design with respect to stability and geotechnical design parameters• At Occupation Certificate stage (project completion), AscentGeo must have inspected and certified excavations and foundation materials. A final site inspection may be required at this stage.

Should you have any queries regarding this report, please do not hesitate to contact the author of this report, undersigned.

For and on behalf of **AscentGeo**,



Josh Watts BSc(Hons) MSc GeoEng MAIG
Engineering Geologist



Ben Morgan BScGeol MAIG RPGeo
Managing Director | Engineering Geologist



4 References

Australian Geomechanics Society Landslide Taskforce, Landslide Practice Note Working Group 2007 (Mar). 'Practice Note Guidelines for Landslide Risk Management 2007'. *Australian Geomechanics Journal*, vol. 42, no. 1, pp. 63–114.

Colquhoun, G.P. Hughes, K.S. Deyssing, L. Ballard, J.C. Phillips G. Troedson, A.L. Folkes C.B. Fitzherbert J.A. The Geological Survey of New South Wales (GSNSW) Seamless Geology Project Version 2.4, May 2024. State of New South Wales and Department of Regional NSW 2024. Accessed via MinView

NSW Department of Finance, Services and Innovation, Spatial Information Viewer, maps.six.nsw.gov.au.

Northern Beaches Council, Online mapping, Manly Landslide Risk Map (MLEP 2011).

Pells, PJN, Mostyn, G & Walker, F, 1998 (Dec). 'Foundations on sandstone and shale in the Sydney region'. *Australian Geomechanics Journal*, vol. 33, no. 3, pp. 17–29.

Pells, P.J.N., Mostyn, G. & Walker, B.F. (Dec. 1998), Foundations on Sandstone and Shale in the Sydney Region. Australian Geomechanics, Sydney.

Safe Work Australia, 2018 (Oct), *Code of Practice: Excavation Work*, Safe Work Australia.

Standards Australia 1997, *Methods of Testing Soils for Engineering Purposes*, AS1289.6.3.2:1997, Standards Australia, NSW.

Standards Australia 2001, *Evaluation of human exposure to whole-body vibration. Part 1: General requirements*, AS2670.1:2001, Standards Australia, NSW.

Standards Australia 2002, *Earth-retaining structures*, AS4678:2002, Standards Australia, NSW.

Standards Australia 2007, *Guidelines for Earthworks for Commercial and Residential Developments*. AS3798:2007, Standards Australia, NSW.

Standards Australia 2011, *Residential Slabs and Footings*, AS2870:2011, Standards Australia, NSW.

Standards Australia 2017, *Geotechnical Site Investigations*, AS1726:2017, Standards Australia, NSW.

Appendix A

Site plans




LEGEND



DCP LOCATIONS



BOREHOLE LOCATIONS

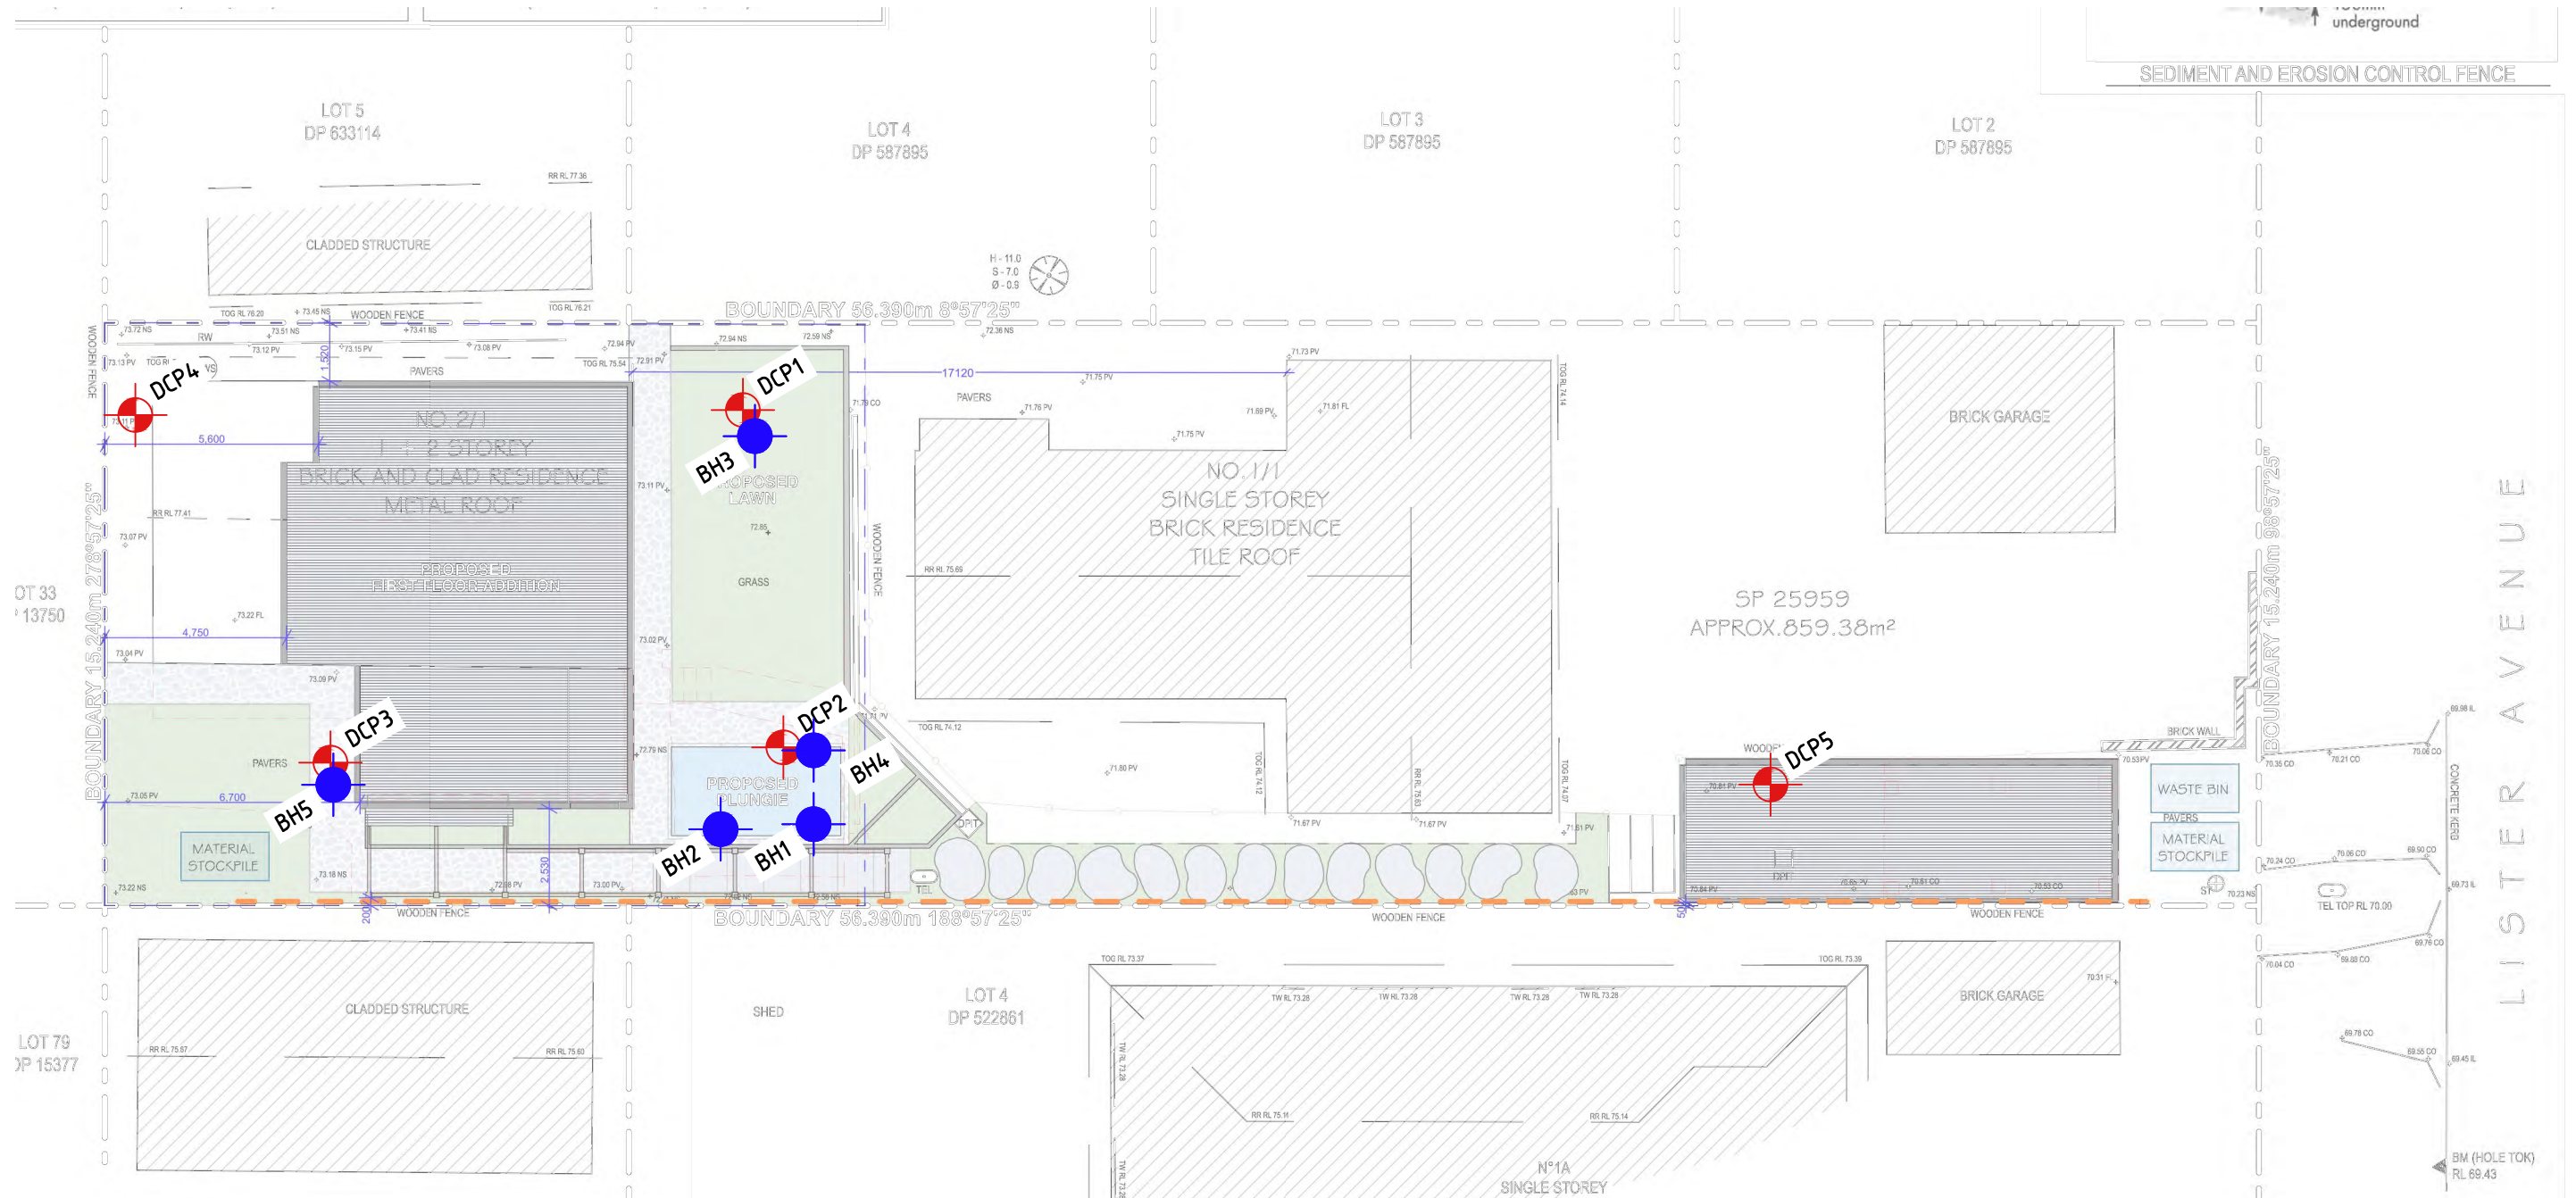

SITE PLAN/GROUND TEST LOCATIONS
SCALE NTS

REV	DATE	REVISION DESCRIPTION	REV BY	CHKD
A	03.04.25	PRELIMINARY ISSUE	VT	BM



ABN: 71 621 428 402
www.ascentgeo.com.au
(02) 9913 3179
admin@ascentgeo.com.au
1457 Pittwater Road
North Narrabeen NSW 2101

CLIENT:
**MR & MRS VESCIO, C/-
R&R BUILDING DESIGN**
COPYRIGHT:
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE
PROPERTY OF ASCENT GEOTECHNICAL CONSULTING.
COPYING OF THIS MATERIAL IN WHOLE OR IN PART WITHOUT
THE WRITTEN PERMISSION OF ASCENT GEOTECHNICAL
CONSULTING CONSTITUTES AN INFRINGEMENT OF COPYRIGHT
LAWS.

**SITE PLAN/GROUND TEST LOCATIONS
AT 2/1 LISTER AVENUE
SEAFORTH NSW**

DATE: 03/04/2025
SCALE: AS SHOWN @ A3
DRAWING TITLE:
SITE PLAN
DRAWING NO:
AG 25134- S1

Appendix B

Site photos



Photo 1: Front of residence and location of plunge pool.



Photo 2: Patioed side yard.



Photo 3: Patioed carport area.



Photo 4: Western boundary.

Appendix C

Bore Logs | DCP Test Results

Easting : 337311.09

Location : 1A Lister Ave, Seaforth NSW 2092, Australia

Job Number : AG 25134

Northing : 6260001.83


Logged By : JW





Client : Mr & Mrs Vescio

Total Depth : 0.4 m

Date : 01/04/2025

Project : Alterations & Additions

Drilling Method	Water	Depth (m)	Soil Origin	Material Description	Classification Code	Graphic Log	Consistency	Moisture	Observations
			Fill	Organic Sandy Clay (OH): soft, medium plasticity, fine to medium grained sand, brown, w < pl.	OH		S	w < PL	
				BH01 Terminated at 0.4m (Borehole terminated due to the presence of a potential underground service.)					

Method	Water	Consistency	Moisture	In Situ Testing	Laboratory Results
EX excavator	<div>  complete water loss </div>	<div>  Level during drilling </div>	<div> VS Very soft </div>	<div> PP pen penetrometer </div>	<div> UC undrained unconsol cohesion </div>
BH backhoe bucket	<div>  Water inflow </div>	<div> S Soft </div>	<div> M Moist </div>	<div> VS vane shear </div>	<div> UF undrained unconsol friction angle </div>
NE natural exposure	<div>  water level </div>	<div> P partial water loss </div>	<div> F Firm </div>	<div> dynamic </div>	<div> MC moisture content </div>
EE existing xcavation		<div> N none encountered </div>	<div> PL plastic limit </div>	<div> cone </div>	<div> DD dry density </div>
RP ripper			<div> LL liquid limit </div>	<div> DCP penetrometer </div>	<div> LL liquid limit </div>
	USC Classification	VS Very stiff	Soil Samples		<div> PL plastic limit </div>
	GW well graded gravels	<div> H Hard </div>	<div> B bulk </div>		<div> LS linear shrinkage </div>
	GP poorly graded gravels	<div> VL Very loose </div>	<div> D disturbed </div>		<div> CC undrained console cohesion </div>
	GM silty gravel	<div> L Loose </div>	<div> U(63) U(63) push tube </div>		<div> CF undrained console friction angle </div>
	GC clayey gravel	<div> MD Medium dense </div>	<div> U(50) U(50) push tube </div>		<div> FH falling head permeability </div>
	ML inorg silts low plastic	<div> D Dense </div>	<div> WS water </div>		<div> CH constan head permeability </div>
	MH inorg clay high plastic	<div> VD Very dense </div>			<div> CBR californian bearing ratio </div>
	OL org silts low plastic				
	OH org silts high plastic				
	SW well graded sands				
	SP poorly graded sands				
	SM silty sands				
	SC clayey sands				
	CL inorg clay low plastic				
	CI inorg clay med plastic				
	CH inorg clay high plastic				
	Pt peat of high org soils				

Easting : 337311.09

Location : 1A Lister Ave, Seaforth NSW 2092, Australia

Job Number : AG 25134

Northing : 6260001.83


Logged By : JW





Client : Mr & Mrs Vescio

Total Depth : 0.4 m

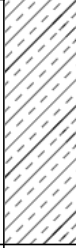Date : 01/04/2025

Project : Alterations & Additions

Drilling Method	Water	Depth (m)	Soil Origin	Material Description	Classification Code	Graphic Log	Consistency	Moisture	Observations
			Fill	Organic Sandy Clay (OH): soft, medium plasticity, fine to medium grained sand, brown, w < pl.	OH		S	w < PL	
				BH02 Terminated at 0.4m (Borehole terminated due to the presence of a potential underground service.)					

Method	Water	Consistency	Moisture	In Situ Testing	Laboratory Results
EX excavator	 complete water less  Water inflow  water level	 Level during drilling P partial water loss N none encountered	VS Very soft S Soft F Firm St Stiff VSt Very stiff H Hard	D Dry M Moist W Wet PL plastic limit LL liquid limit	PP pen penetrometer VS vane shear DCP dynamic cone penetrometer
BH backhoe bucket					
NE natural exposure					
EE existing xcavation					
RP ripper					
	USC Classification GW well graded gravels GP poorly graded gravels GM silty gravel GC clayey gravel ML inorg silts low plastic MH inorg clay high plastic OL org silts low plastic OH org silts high plastic	SW well graded sands SP poorly graded sands SM silty sands SC clayey sands CL inorg clay low plastic CI inorg clay med plastic CH inorg clay high plastic Pt peat of high org soils	Density VL Very loose L Loose MD Medium dense D Dense VD Very dense	B bulk D disturbed U(63) U(63) push tube U(50) U(50) push tube WS water	UC undrained unconsol cohesion UF undrained unconsol friction angle MC moisture content DD dry density LL liquid limit PL plastic limit LS linear shrinkage CC undrained console cohesion CF undrained console friction angle FH falling head permeability CH constan head permeability CBR californian bearing ratio

Easting : 337311.09

Location : 1A Lister Ave, Seaforth NSW 2092, Australia

Job Number : AG 25134

Northing : 6260001.83



Logged By : JW





Client : Mr & Mrs Vescio

Total Depth : 0.75 m

Date : 01/04/2025

Project : Alterations & Additions

Drilling Method	Water	Depth (m)	Soil Origin	Material Description	Classification Code	Graphic Log	Consistency	Moisture	Observations
		0.3	Fill	Organic Sandy Clay (OH): soft, medium plasticity, fine to medium grained sand, brown, w < pl.	OH		S	w < PL	
			Natural	Clayey Sand (SC): loose, poorly graded, fine, medium and coarse grained, low plasticity clay, grey, with silt, wet.	SC		L	W	
				BH03 Terminated at 0.75m (Auger grinding on assumed sandstone bedrock.)					

Method	Water	Consistency	Moisture	In Situ Testing	Laboratory Results
EX excavator	 complete water loss  Level during drilling	VS Very soft	D Dry	PP pen penetrometer	UC undrained unconsol cohesion
BH backhoe bucket	 Water inflow P partial water loss	S Soft	M Moist	VS vane shear	UF undrained unconsol friction angle
NE natural exposure	 water level N none encountered	F Firm	W Wet	dynamic cone penetrometer	MC moisture content
EE existing xcavation	USC Classification	St Stiff	PL plastic limit		DD dry density
RP ripper	GW well graded gravels SW well graded sands GP poorly graded gravels SP poorly graded sands GM silty gravel SM silty sands GC clayey gravel SC clayey sands ML inorg silts low plastic CL inorg clay low plastic MH inorg clay high plastic CI inorg clay med plastic OL org silts low plastic CH inorg clay high plastic OH org silts high plastic Pt peat of high org soils	VSt Very stiff	LL liquid limit		LL liquid limit
		H Hard			PL plastic limit
		Density	Soil Samples		LS linear shrinkage
		VL Very loose	B bulk		CC undrained console cohesion
		L Loose	D disturbed		CF undrained console friction angle
		MD Medium dense	U(63) U(63) push tube		FH falling head permeability
		D Dense	U(50) U(50) push tube		CH constan head permeability
		VD Very dense	WS water		CBR californian bearing ratio

Easting : 337311.09

Location : 1A Lister Ave, Seaforth NSW 2092, Australia

Job Number : AG 25134

Northing : 6260001.83




Logged By : JW





Client : Mr & Mrs Vescio

Total Depth : 1.3 m

Date : 01/04/2025

Project : Alterations & Additions

Drilling Method	Water	Depth (m)	Soil Origin	Material Description	Classification Code	Graphic Log	Consistency	Moisture	Observations
		0.3	Fill	Organic Sandy Clay (OH): soft, medium plasticity, fine to medium grained sand, brown, w < pl.	OH		S	w < PL	
		0.8	Natural	Clayey Sand (SC): loose, poorly graded, fine, medium and coarse grained, low plasticity clay, grey, with silt, wet.	SC		L	W	
		1	Natural	Clayey Sand (SC): medium dense, poorly graded, fine, medium and coarse grained, medium plasticity clay, light grey, with silt, moist.	SC		MD	M	
				BH04 Terminated at 1.3m (Auger grinding on assumed sandstone bedrock.)					

Method	Water		Consistency	Moisture	In Situ Testing		Laboratory Results	
EX excavator	 complete water less	 Level during drilling	VS Very soft	D Dry	PP pen penetrometer	UC undrained unconsol cohesion		
BH backhoe bucket	 Water inflow	P partial water loss	S Soft	M Moist	VS vane shear	UF undrained unconsol friction angle		
NE natural exposure	 water level	N none encountered	F Firm	W Wet		MC moisture content		
EE existing xcavation	USC Classification		St Stiff	PL plastic limit	DCP dynamic cone penetrometer	DD dry density		
VSt Very stiff			LL liquid limit	LL liquid limit				
RP ripper	GW well graded gravels SW well graded sands GP poorly graded gravels SP poorly graded sands GM silty gravel SM silty sands GC clayey gravel SC clayey sands ML inorg silts low plastic CL inorg clay low plastic MH inorg clay high plastic CI inorg clay med plastic OL org silts low plastic CH inorg clay high plastic OH org silts high plastic Pt peat of high org soils		H Hard	Soil Samples		PL plastic limit		
Density			B bulk			LS linear shrinkage		
			VL Very loose	D disturbed		CC undrained console cohesion		
			L Loose	U(63) U(63) push tube		CF undrained console friction angle		
			MD Medium dense	U(50) U(50) push tube		FH falling head permeability		
			D Dense	WS water		CH constan head permeability		
			VD Very dense			CBR californian bearing ratio		

Easting : 337311.09

Location : 1A Lister Ave, Seaforth NSW 2092, Australia

Job Number : AG 25134

Northing : 6260001.83













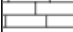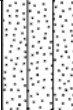


Logged By : JW

Client : Mr & Mrs Vescio

Total Depth : 0.6 m

Date : 07/04/2025

Project : Alterations & Additions

Drilling Method	Water	Depth (m)	Soil Origin	Material Description	Classification Code	Graphic Log	Consistency	Moisture	Observations																																																																																																																																		
		0.06	Non-soil	Non-soil Pavers.	PAV																																																																																																																																						
		0.25	Fill	Silty Sand (SM): poorly graded, fine, medium and coarse grained, orange, moist, (BLINDING).	SM			M																																																																																																																																			
			Natural	Clayey Sand (SC): loose, fine, medium and coarse grained, low plasticity clay, grey, moist.	SC		L	M																																																																																																																																			
				BH05 refusal at 0.6m (Auger grinding on assumed sandstone bedrock.)																																																																																																																																							
<table><tr><td colspan="2">Method</td><td colspan="2">Water</td><td>Consistency</td><td>Moisture</td><td>In Situ Testing</td><td colspan="3">Laboratory Results</td></tr><tr><td>EX</td><td>excavator</td><td> complete water less</td><td> Level during drilling</td><td>VS</td><td>Very soft</td><td>PP</td><td>pen penetrometer</td><td>UC</td><td>undrained unconsol cohesion</td></tr><tr><td>BH</td><td>backhoe bucket</td><td> Water inflow</td><td>P partial water loss</td><td>S</td><td>Soft</td><td></td><td></td><td>UF</td><td>undrained unconsol friction angle</td></tr><tr><td>NE</td><td>natural exposure</td><td> water level</td><td>N none encountered</td><td>F</td><td>Firm</td><td>VS</td><td>vane shear</td><td>MC</td><td>moisture content</td></tr><tr><td>EE</td><td>existing xcavation</td><td colspan="2">USC Classification</td><td>St</td><td>Stiff</td><td></td><td>dynamic cone penetrometer</td><td>DD</td><td>dry density</td></tr><tr><td>RP</td><td>ripper</td><td>GW well graded gravels</td><td>SW well graded sands</td><td>VSt</td><td>Very stiff</td><td>DCP</td><td></td><td>LL</td><td>liquid limit</td></tr><tr><td></td><td></td><td>GP poorly graded gravels</td><td>SP poorly graded sands</td><td>H</td><td>Hard</td><td></td><td></td><td>PL</td><td>plastic limit</td></tr><tr><td></td><td></td><td>GM silty gravel</td><td>SM silty sands</td><td colspan="2">Density</td><td></td><td></td><td>LS</td><td>linear shrinkage</td></tr><tr><td></td><td></td><td>GC clayey gravel</td><td>SC clayey sands</td><td>VL</td><td>Very loose</td><td>B</td><td>bulk</td><td>CC</td><td>undrained console cohesion</td></tr><tr><td></td><td></td><td>ML inorg silts low plastic</td><td>CL inorg clay low plastic</td><td>L</td><td>Loose</td><td>D</td><td>disturbed</td><td>CF</td><td>undrained console friction angle</td></tr><tr><td></td><td></td><td>MH inorg clay high plastic</td><td>CI inorg clay med plastic</td><td>MD</td><td>Medium dense</td><td>U(63)</td><td>U(63) push tube</td><td>FH</td><td>falling head permeability</td></tr><tr><td></td><td></td><td>OL org silts low plastic</td><td>CH inorg clay high plastic</td><td>D</td><td>Dense</td><td>U(50)</td><td>U(50) push tube</td><td>CH</td><td>constan head permeability</td></tr><tr><td></td><td></td><td>OH org sills high plastic</td><td>Pt peat of high org soils</td><td>VD</td><td>Very dense</td><td>WS</td><td>water</td><td>CBR</td><td>californian bearing ratio</td></tr></table>										Method		Water		Consistency	Moisture	In Situ Testing	Laboratory Results			EX	excavator	 complete water less	 Level during drilling	VS	Very soft	PP	pen penetrometer	UC	undrained unconsol cohesion	BH	backhoe bucket	 Water inflow	P partial water loss	S	Soft			UF	undrained unconsol friction angle	NE	natural exposure	 water level	N none encountered	F	Firm	VS	vane shear	MC	moisture content	EE	existing xcavation	USC Classification		St	Stiff		dynamic cone penetrometer	DD	dry density	RP	ripper	GW well graded gravels	SW well graded sands	VSt	Very stiff	DCP		LL	liquid limit			GP poorly graded gravels	SP poorly graded sands	H	Hard			PL	plastic limit			GM silty gravel	SM silty sands	Density				LS	linear shrinkage			GC clayey gravel	SC clayey sands	VL	Very loose	B	bulk	CC	undrained console cohesion			ML inorg silts low plastic	CL inorg clay low plastic	L	Loose	D	disturbed	CF	undrained console friction angle			MH inorg clay high plastic	CI inorg clay med plastic	MD	Medium dense	U(63)	U(63) push tube	FH	falling head permeability			OL org silts low plastic	CH inorg clay high plastic	D	Dense	U(50)	U(50) push tube	CH	constan head permeability			OH org sills high plastic	Pt peat of high org soils	VD	Very dense	WS	water	CBR	californian bearing ratio
Method		Water		Consistency	Moisture	In Situ Testing	Laboratory Results																																																																																																																																				
EX	excavator	 complete water less	 Level during drilling	VS	Very soft	PP	pen penetrometer	UC	undrained unconsol cohesion																																																																																																																																		
BH	backhoe bucket	 Water inflow	P partial water loss	S	Soft			UF	undrained unconsol friction angle																																																																																																																																		
NE	natural exposure	 water level	N none encountered	F	Firm	VS	vane shear	MC	moisture content																																																																																																																																		
EE	existing xcavation	USC Classification		St	Stiff		dynamic cone penetrometer	DD	dry density																																																																																																																																		
RP	ripper	GW well graded gravels	SW well graded sands	VSt	Very stiff	DCP		LL	liquid limit																																																																																																																																		
		GP poorly graded gravels	SP poorly graded sands	H	Hard			PL	plastic limit																																																																																																																																		
		GM silty gravel	SM silty sands	Density				LS	linear shrinkage																																																																																																																																		
		GC clayey gravel	SC clayey sands	VL	Very loose	B	bulk	CC	undrained console cohesion																																																																																																																																		
		ML inorg silts low plastic	CL inorg clay low plastic	L	Loose	D	disturbed	CF	undrained console friction angle																																																																																																																																		
		MH inorg clay high plastic	CI inorg clay med plastic	MD	Medium dense	U(63)	U(63) push tube	FH	falling head permeability																																																																																																																																		
		OL org silts low plastic	CH inorg clay high plastic	D	Dense	U(50)	U(50) push tube	CH	constan head permeability																																																																																																																																		
		OH org sills high plastic	Pt peat of high org soils	VD	Very dense	WS	water	CBR	californian bearing ratio																																																																																																																																		

Dynamic Cone Penetration Test Report

Client:		Mr & Mrs Vescio				Job No:		AG 25134	
Project:		Alterations & Additions				Date:		1/4/2025	
Location:		2/1 Lister Avenue, Seaforth				Operator:		JW	
Test Procedure:		AS 1289.6.3.2 – 1997							
Test Data									
Test No: DCP 1		Test No: DCP 2		Test No: DCP 3		Test No: DCP 4		Test No: DCP 5	
Test Location: Refer to Site Plan		Test Location: Refer to Site Plan		Test Location: Refer to Site Plan		Test Location: Refer to Site Plan		Test Location: Refer to Site Plan	
RL:		RL:		RL:		RL:		RL:	
Soil Classification: P		Soil Classification: P		Soil Classification: P		Soil Classification: P		Soil Classification: P	
Depth (m)	Blows	Depth (m)	Blows	Depth (m)	Blows	Depth (m)	Blows	Depth (m)	Blows
0.0 – 0.3	3	0.0 – 0.3	2	0.0 – 0.3	3	0.0 – 0.3	4	0.0 – 0.3	6
0.3 – 0.6	8	0.3 – 0.6	2	0.3 – 0.6	15 – Rs	0.3 – 0.6	16 – Rs	0.3 – 0.6	10
0.6 – 0.9	15 – Rs	0.6 – 0.9	8	0.6 – 0.9		0.6 – 0.9		0.6 – 0.9	11
0.9 – 1.2		0.9 – 1.2	15	0.9 – 1.2		0.9 – 1.2		0.9 – 1.2	16 – Rs
1.2 – 1.5		1.2 – 1.5	16 – Rs	1.2 – 1.5		1.2 – 1.5		1.2 – 1.5	
1.5 – 1.8		1.5 – 1.8		1.5 – 1.8		1.5 – 1.8		1.5 – 1.8	
1.8 – 2.1		1.8 – 2.1		1.8 – 2.1		1.8 – 2.1		1.8 – 2.1	
2.1 – 2.4		2.1 – 2.4		2.1 – 2.4		2.1 – 2.4		2.1 – 2.4	
2.4 – 2.7		2.4 – 2.7		2.4 – 2.7		2.4 – 2.7		2.4 – 2.7	
2.7 – 3.0		2.7 – 3.0		2.7 – 3.0		2.7 – 3.0		2.7 – 3.0	
3.0 – 3.3		3.0 – 3.3		3.0 – 3.3		3.0 – 3.3		3.0 – 3.3	
3.3 – 3.6		3.3 – 3.6		3.3 – 3.6		3.3 – 3.6		3.3 – 3.6	
3.6 – 3.9		3.6 – 3.9		3.6 – 3.9		3.6 – 3.9		3.6 – 3.9	
3.9 – 4.2		3.9 – 4.2		3.9 – 4.2		3.9 – 4.2		3.9 – 4.2	
4.2 – 4.5		4.2 – 4.5		4.2 – 4.5		4.2 – 4.5		4.2 – 4.5	
4.5 – 4.8		4.5 – 4.8		4.5 – 4.8		4.5 – 4.8		4.5 – 4.8	
DCP 1: Refusal @ 0.75m Bouncing on assumed sandstone bedrock. Brownish grey sand on moist tip.		DCP 2: Refusal @ 1.30m Bouncing on assumed sandstone bedrock. Orangish brown sand on wet tip.		DCP 3: Refusal @ 0.55m Bouncing on assumed sandstone bedrock. Orangish brown sand on wet tip.		DCP 4: Refusal @ 0.60m Bouncing on assumed sandstone bedrock. Greyish brown sand on wet tip.		DCP 5: Refusal @ 1.10m Bouncing on assumed sandstone bedrock. Grey sand on wet tip.	
Remarks: Available test locations limited by existing hard surfaces and possible buried services . Tip of DCP cone noted to commonly be wet on extraction.						Weight:		9 kg	
						Drop:		510 mm	
						Rod Diameter:		16 mm	

Rs = Solid ring/Hammer bouncing

Pr = Practical Refusal. Rods progressively slowly through weathered bedrock.

D = Equipment dropping under own weight

Appendix D

Information Sheets

General Notes About This Report

INTRODUCTION

These notes have been prepared by Ascent Geotechnical Consulting Pty Ltd (Ascent) to help our Clients interpret and understand the limitations of this report. Not all sections below are necessarily relevant to all reports.

SCOPE OF SERVICES

This report has been prepared in accordance with the scope of services set out in Ascent's proposal under Ascent's Terms and Conditions, or as otherwise agreed with the Client. The scope of work may have been limited by a range of factors including time, budget, access and/or site constraints.

RELIANCE ON INFORMATION PROVIDED

In preparing the report, Ascent has necessarily relied upon information provided by the Client and/or their Agents. Such data may include surveys, analyses, designs, maps and design plans. Ascent has not verified the accuracy or completeness of the data except as stated in this report.

GEOTECHNICAL AND ENVIRONMENTAL REPORTING

Geotechnical and environmental reporting relies on the interpretation of factual information, based on judgment and opinion, and is far less exact than other engineering or design disciplines.

Geotechnical and environmental reports are prepared for a specific purpose, development, and site, as described in the report, and may not contain sufficient information for other purposes, developments, or sites (including adjacent sites), other than that described in the report.

SUBSURFACE CONDITIONS

Subsurface conditions can change with time and can vary between test locations. For example, the actual interface between the materials may be far more gradual or abrupt than indicated.

Therefore, actual conditions in areas not sampled may differ from those predicted, since no subsurface investigation, no matter how comprehensive, can reveal all subsurface details and anomalies.

Construction operations at or adjacent to the site and natural events such as floods, earthquakes or groundwater fluctuations can also affect subsurface conditions, and thus the continuing adequacy of a geotechnical report. Ascent should be kept informed of any such events, and should be retained to identify variances, conduct additional tests if required, and recommend solutions to problems encountered on site.

GROUNDWATER

Groundwater levels indicated on borehole and test pit logs are recorded at specific times. Depending on ground permeability, measured levels may or may not reflect actual levels if measured over a longer time period. Also, groundwater levels and seepage inflows may fluctuate with seasonal and environmental variations and construction activities.

INTERPRETATION OF DATA

Data obtained from nominated discrete locations, subsequent laboratory testing and empirical or external sources are interpreted by trained professionals in order to provide an opinion about overall site conditions, their likely impact with respect to the report purpose and recommended actions in accordance with any relevant industry standards, guidelines or procedures.

SOIL AND ROCK DESCRIPTIONS

Soil and rock descriptions are based on AS 1726 – 1993, using visual and tactile assessment, except at discrete locations where field and / or laboratory tests have been carried out. Refer to the accompanying soil and rock terms sheet for further information.

COPYRIGHT AND REPRODUCTION

The contents of this document are and remain the intellectual property of Ascent. This document should only be used for the purpose for which it was commissioned and should not be used for other projects, or by a third party without written permission from Ascent.

This report shall not be reproduced either totally or in part without the permission of Ascent. Where information from this report is to be included in contract documents or engineering specification for the project, the entire report should be included in order to minimise the likelihood of misinterpretation.

FURTHER ADVICE

Ascent would be pleased to further discuss how any of the above issues could affect a specific project. We would also be pleased to provide further advice or assistance including:

- Assessment of suitability of designs and construction techniques;
- Contract documentation and specification;
- Construction advice (foundation assessments, excavation support).

Abbreviations, Notes & Symbols

SUBSURFACE INVESTIGATION

METHOD

Borehole Logs

AS#	Auger screwing (#-bit)
AD#	Auger drilling (#-bit)
B	Blank bit
V	V-bit
T	TC-bit
HA	Hand auger
R	Roller/tricone
W	Washbore
AH	Air hammer
AT	Air track
LB	Light bore push tube
MC	Macro core push tube
DT	Dual core push tube

Excavation Logs

BH	Backhoe/excavator bucket
NE	Natural exposure
HE	Hand excavation
X	Existing excavation

Cored Borehole Logs

NMLC	NMLC core drilling
NQ/HQ	Wireline core drilling

SUPPORT

Borehole Logs

C	Casing
M	Mud

Excavation Logs

S	Shoring
B	Benching

SAMPLING

B	Bulk sample
D	Disturbed sample
U#	Thin-walled tube sample (#mmdiameter)
ES	Environmental sample
EW	Environmental water sample

FIELD TESTING

PP	Pocket penetrometer (kPa)
DCP	Dynamic cone penetrometer
PSP	Perth sand penetrometer
SPT	Standard penetration test
PBT	Plate bearing test
s_u	Vane shear strength peak/residual (kPa) and vane size (mm)
N*	SPT (blows per 300mm)
Nc	SPT with solid cone
R	Refusal

*denotes sample taken

BOUNDARIES

————	Known
-----	Probable
.....	Possible

SOIL

MOISTURE CONDITION

D	Dry
M	Moist
W	Wet
Wp	Plastic Limit
WL	Liquid Limit
MC	Moisture Content

CONSISTENCY

VS	Very Soft
S	Soft
F	Firm
St	Stiff
VSt	Very Stiff
H	Hard
Fb	Friable

DENSITY INDEX

VL	Very Loose
L	Loose
MD	Medium Dense
D	Dense
VD	Very Dense

USCS SYMBOLS

GW	Well graded gravels and gravel-sand mixtures, little or no fines
GP	Poorly graded gravels and gravel-sand mixtures, little or no fines
GM	Silty gravels, gravel-sand-silt mixtures
GC	Clayey gravels, gravel-sand-clay mixtures

SW	Well graded sands and gravelly sands, little or no fines
SP	Poorly graded sands and gravelly sands, little or no fines
SM	Silty sand, sand-silt mixtures
SC	Clayey sand, sand-clay mixtures
ML	Inorganic silts of low plasticity, very fine sands, rock flour, silty or clayey fine sands
CL	Inorganic clays of low to medium plasticity, gravelly clays, sandy clays, silty clays
OL	Organic silts and organic silty clays of low plasticity
MH	Inorganic silts of high plasticity
CH	Inorganic clays of high plasticity
OH	Organic clays of medium to high plasticity
PT	Peat muck and other highly organic soils

ROCK

WEATHERING

RS	Residual Soil
XW	Extremely Weathered
HW	Highly Weathered
MW	Moderately Weathered
DW*	Distinctly Weathered
SW	Slightly Weathered
FR	Fresh

*covers both HW & MW

STRENGTH

EL	Extremely Low
VL	Very Low
L	Low
M	Medium
H	High
VH	Very High
EH	Extremely High

ROCK QUALITY DESIGNATION (%)

= $\frac{\text{sum of intact core pieces} > 100\text{mm}}{\text{total length of section being evaluated}} \times 100$

CORE RECOVERY (%)

= $\frac{\text{core recovered}}{\text{core lift}} \times 100$

NATURAL FRACTURES

Type

JT	Joint
BP	Bedding plane
SM	Seam
FZ	Fractured zone
SZ	Shear zone
VN	Vein

Infill or Coating

Cn	Clean
St	Stained
Vn	Veneer
Co	Coating
Cl	Clay
Ca	Calcite
Fe	Iron oxide
Mi	Micaceous
Qz	Quartz

Shape

pl	Planar
cu	Curved
un	Undulose
st	Stepped
ir	Irregular

Roughness

pol	Polished
slk	Slickensided
smo	Smooth
rou	Rough

Soil & Rock Terms

SOIL

MOISTURE CONDITION

Term	Description
Dry	Looks and feels dry. Cohesive and cemented soils are hard, friable or powdery. Uncemented granular soils run freely through the hand.
Moist	Feels cool and darkened in colour. Cohesive soils can be moulded. Granular soils tend to cohere.
Wet	As for moist, but with free water forming on hands when handled.

For cohesive soils, moisture content may also be described in relation to plastic limit (W_p) or liquid limit (W_L). [$>>$ much greater than, $>$ greater than, $<$ less than, $<<$ much less than].

CONSISTENCY

Term	c (kPa)	Term	c (kPa)
	^u		^u
Very Soft	< 12	Very Stiff	100 - 200
Soft	12 - 25	Hard	> 200
Firm	25 - 50	Friable	-
Stiff	50 - 100		

DENSITY INDEX

Term	I_D (%)	Term	I_D (%)
Very Loose	< 15	Dense	65 - 8
Loose	15 - 35	Very Dense	> 85
Medium Dense	35 - 65		

PARTICLE SIZE

Name	Subdivision	Size (mm)
Boulders		> 200
Cobbles		63 - 200
Gravel	coarse	20 - 63
	medium	6 - 20
	fine	2.36 - 6
Sand	coarse	0.6 - 2.36
	medium	0.2 - 0.6
	fine	0.075 - 0.2
Silt & Clay		< 0.075

MINOR COMPONENTS

Term	Proportion by Mass coarse grained	fine grained
Trace	$\leq 5\%$	$\leq 15\%$
Some	5 - 2%	15 - 30%

SOIL ZONING

Layers	Continuous exposures
Lenses	Discontinuous layers of lenticular shape
Pockets	Irregular inclusions of different material

SOIL CEMENTING

Weakly	Easily broken up by hand
Moderately	Effort is required to break up the soil by hand

SOIL STRUCTURE

Massive	Coherent, with any partings both vertically and horizontally spaced at greater than 100mm
Weak	Peds indistinct and barely observable on pit face. When disturbed approx. 30% consist of peds smaller than 100mm
Strong	Peds are quite distinct in undisturbed soil. When disturbed $>60\%$ consists of peds smaller than 100mm

ROCK

SEDIMENTARY ROCK TYPE DEFINITIONS

Rock Type	Definition (more than 50% of rock consists of....)
Conglomerate	... gravel sized ($> 2\text{mm}$) fragments
Sandstone	... sand sized (0.06 to 2mm) grains
Siltstone	... silt sized ($<0.06\text{mm}$) particles, rock is not laminated
Claystone	... clay, rock is not laminated
Shale	... silt or clay sized particles, rock is laminated

STRENGTH

Term	I_s50 (MPa)	Term	I_s50 (MPa)
Extremely Low	< 0.03	High	1 - 3
Very Low	0.03 - 0.1	Very High	3 - 10
Low	0.1 - 0.3	Extremely High	> 10
Medium	0.3 - 1		

WEATHERING

Term	Description
Residual Soil	Soil developed on extremely weathered rock; the mass structure and substance fabric are no longer evident
Extremely Weathered	Rock is weathered to such an extent that it has 'soil' properties, i.e. it either disintegrates or can be remoulded, in water. Fabric of original rock is still visible
Highly Weathered	Rock strength usually highly changed by weathering; rock may be highly discoloured
Moderately Weathered	Rock strength usually moderately changed by weathering; rock may be moderately discoloured
Distinctly Weathered	See 'Highly Weathered' or 'Moderately Weathered'
Slightly Weathered	Rock is slightly discoloured but shows little or no change of strength from fresh rock
Fresh	Rock shows no signs of decomposition or staining

NATURAL FRACTURES

Type	Description
Joint	A discontinuity or crack across which the rock has little or no tensile strength. May be open or closed
Bedding plane	Arrangement in layers of mineral grains of similar sizes or composition
Seam	Seam with deposited soil (infill), extremely weathered insitu rock (XW), or disoriented usually angular fragments of the host rock (crushed)
Shear zone	Zone with roughly parallel planar boundaries, of rock material intersected by closely spaced (generally $< 50\text{mm}$) joints and /or microscopic fracture (cleavage) planes
Vein	Intrusion of any shape dissimilar to the adjoining rock mass. Usually igneous




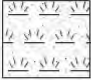















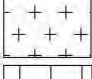

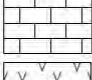






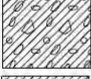


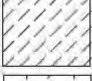
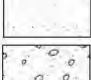



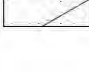

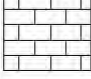
Shape	Description
Planar	Consistent orientation
Curved	Gradual change in orientation
Undulose	Wavy surface
Stepped	One or more well defined steps
Irregular	Many sharp changes in orientation

Infill or Coating	Description
Clean	No visible coating or discolouring
Stained	No visible coating but surfaces are discoloured
Veneer	A visible coating of soil or mineral, too thin to measure; may be patchy
Coating	Visible coating $\leq 1\text{mm}$ thick. Ticker soil material described as seam

Roughness	Description
Polished	Shiny smooth surface
Slickensided	Grooved or striated surface, usually polished
Smooth	Smooth to touch. Few or no surface irregularities
Rough	Many small surface irregularities (amplitude generally $< 1\text{mm}$). Feels like fine to coarse sandpaper

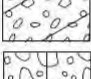Note: soil and rock descriptions are generally in accordance with AS1726-1993 Geotechnical Site Investigations

Graphic Symbols Index

Soil		Rock		Water Measurements	
	Fill		Sandstone		Level at time of drilling
	Peat, Topsoil		Shale		Level after drilling
	Clay		Clayey Shale		Inflow
	Silty Clay		Siltstone		Outflow
	Gravelly Clay		Conglomerate		
	Sandy Clay		Claystone		
	Silt		Dolerite, Basalt		
	Sandy Silt		Granite		
	Clayey Silt		Limestone		
	Gravelly Silt		Tuff		
	Gravel		Coarse grained Metamorphic		
	Sandy Gravel		Medium grained Metamorphic		
	Clayey Gravel		Fine grained Metamorphic		
	Silty Gravel		Coal		
	Sand				
	Gravelly Sand	Other			
	Silty Sand		Asphalt		
	Clayey Sand		Concrete		
			Brick		

Foundation Maintenance and Footing Performance: A Homeowner's Guide



CSIRO

BTF 18
replaces
Information
Sheet 10/91

Buildings can and often do move. This movement can be up, down, lateral or rotational. The fundamental cause of movement in buildings can usually be related to one or more problems in the foundation soil. It is important for the homeowner to identify the soil type in order to ascertain the measures that should be put in place in order to ensure that problems in the foundation soil can be prevented, thus protecting against building movement.

This Building Technology File is designed to identify causes of soil-related building movement, and to suggest methods of prevention of resultant cracking in buildings.

Soil Types

The types of soils usually present under the topsoil in land zoned for residential buildings can be split into two approximate groups – granular and clay. Quite often, foundation soil is a mixture of both types. The general problems associated with soils having granular content are usually caused by erosion. Clay soils are subject to saturation and swell/shrink problems.

Classifications for a given area can generally be obtained by application to the local authority, but these are sometimes unreliable and if there is doubt, a geotechnical report should be commissioned. As most buildings suffering movement problems are founded on clay soils, there is an emphasis on classification of soils according to the amount of swell and shrinkage they experience with variations of water content. The table below is Table 2.1 from AS 2870, the Residential Slab and Footing Code.

Causes of Movement

Settlement due to construction

There are two types of settlement that occur as a result of construction:

- Immediate settlement occurs when a building is first placed on its foundation soil, as a result of compaction of the soil under the weight of the structure. The cohesive quality of clay soil mitigates against this, but granular (particularly sandy) soil is susceptible.
- Consolidation settlement is a feature of clay soil and may take place because of the expulsion of moisture from the soil or because of the soil's lack of resistance to local compressive or shear stresses. This will usually take place during the first few months after construction, but has been known to take many years in exceptional cases.

These problems are the province of the builder and should be taken into consideration as part of the preparation of the site for construction. Building Technology File 19 (BTF 19) deals with these problems.

Erosion

All soils are prone to erosion, but sandy soil is particularly susceptible to being washed away. Even clay with a sand component of say 10% or more can suffer from erosion.

Saturation

This is particularly a problem in clay soils. Saturation creates a bog-like suspension of the soil that causes it to lose virtually all of its bearing capacity. To a lesser degree, sand is affected by saturation because saturated sand may undergo a reduction in volume – particularly imported sand fill for bedding and blinding layers. However, this usually occurs as immediate settlement and should normally be the province of the builder.

Seasonal swelling and shrinkage of soil

All clays react to the presence of water by slowly absorbing it, making the soil increase in volume (see table below). The degree of increase varies considerably between different clays, as does the degree of decrease during the subsequent drying out caused by fair weather periods. Because of the low absorption and expulsion rate, this phenomenon will not usually be noticeable unless there are prolonged rainy or dry periods, usually of weeks or months, depending on the land and soil characteristics.

The swelling of soil creates an upward force on the footings of the building, and shrinkage creates subsidence that takes away the support needed by the footing to retain equilibrium.

Shear failure

This phenomenon occurs when the foundation soil does not have sufficient strength to support the weight of the footing. There are two major post-construction causes:

- Significant load increase.
- Reduction of lateral support of the soil under the footing due to erosion or excavation.
- In clay soil, shear failure can be caused by saturation of the soil adjacent to or under the footing.

GENERAL DEFINITIONS OF SITE CLASSES

Class	Foundation
A	Most sand and rock sites with little or no ground movement from moisture changes
S	Slightly reactive clay sites with only slight ground movement from moisture changes
M	Moderately reactive clay or silt sites, which can experience moderate ground movement from moisture changes
H	Highly reactive clay sites, which can experience high ground movement from moisture changes
E	Extremely reactive sites, which can experience extreme ground movement from moisture changes
A to P	Filled sites
P	Sites which include soft soils, such as soft clay or silt or loose sands; landslip; mine subsidence; collapsing soils; soils subject to erosion; reactive sites subject to abnormal moisture conditions or sites which cannot be classified otherwise

Tree root growth

Trees and shrubs that are allowed to grow in the vicinity of footings can cause foundation soil movement in two ways

- Roots that grow under footings may increase in cross-sectional size, exerting upward pressure on footings.
- Roots in the vicinity of footings will absorb much of the moisture in the foundation soil, causing shrinkage or subsidence.

Unevenness of Movement

The types of ground movement described above usually occur unevenly throughout the building's foundation soil. Settlement due to construction tends to be uneven because of:

- Differing compaction of foundation soil prior to construction.
- Differing moisture content of foundation soil prior to construction.

Movement due to non-construction causes is usually more uneven still. Erosion can undermine a footing that traverses the flow or can create the conditions for shear failure by eroding soil adjacent to a footing that runs in the same direction as the flow.

Saturation of clay foundation soil may occur where subfloor walls create a dam that makes water pond. It can also occur wherever there is a source of water near footings in clay soil. This leads to a severe reduction in the strength of the soil which may create local shear failure.

Seasonal swelling and shrinkage of clay soil affects the perimeter of the building first, then gradually spreads to the interior. The swelling process will usually begin at the uphill extreme of the building, or on the weather side where the land is flat. Swelling gradually reaches the interior soil as absorption continues. Shrinkage usually begins where the sunk heat is greatest.

Effects of Uneven Soil Movement on Structures

Erosion and saturation

Erosion removes the support from under footings, tending to create subsidence of the part of the structure under which it occurs. Brickwork walls will resist the stress created by this removal of support by bridging the gap or cantilevering until the bricks or the mortar bedding fail. Older masonry has little resistance. Evidence of failure varies according to circumstances and symptoms may include:

- Step cracking in the mortar beds in the body of the wall or above/below openings such as doors or windows.
- Vertical cracking in the bricks (usually but not necessarily in line with the vertical beds or perpend).

Isolated piers affected by erosion or saturation of foundations will eventually lose contact with the bearers they support and may tilt or fall over. The floors that have lost this support will become bouncy, sometimes rattling ornaments etc.

Seasonal swelling/shrinkage in clay

Swelling foundation soil due to rainy periods first lifts the most exposed extremities of the footing system, then the remainder of the perimeter footings while gradually permeating inside the building footprint to lift internal footings. This swelling first tends to create a dish effect, because the external footings are pushed higher than the internal ones.

The first noticeable symptom may be that the floor appears slightly dished. This is often accompanied by some doors binding on the floor or the door head, together with some cracking of cornice mitres. In buildings with timber flooring supported by bearers and joists, the floor can be bouncy. Externally there may be visible dishing of the hip or ridge lines.

As the moisture absorption process completes its journey to the innermost areas of the building, the internal footings will rise. If the spread of moisture is roughly even, it may be that the symptoms will temporarily disappear, but it is more likely that swelling will be uneven, creating a difference rather than a disappearance in symptoms. In buildings with timber flooring supported by bearers and joists, the isolated piers will rise more easily than the strip footings or piers under walls, creating noticeable doming of flooring.

Trees can cause shrinkage and damage



As the weather pattern changes and the soil begins to dry out, the external footings will be first affected, beginning with the locations where the sun's effect is strongest. This has the effect of lowering the external footings. The doming is accentuated and cracking reduces or disappears where it occurred because of dishing, but other cracks open up. The roof lines may become convex.

Doming and dishing are also affected by weather in other ways. In areas where warm, wet summers and cooler dry winters prevail, water migration tends to be toward the interior and doming will be accentuated, whereas where summers are dry and winters are cold and wet, migration tends to be toward the exterior and the underlying propensity is toward dishing.

Movement caused by tree roots

In general, growing roots will exert an upward pressure on footings, whereas soil subject to drying because of tree or shrub roots will tend to remove support from under footings by inducing shrinkage.

Complications caused by the structure itself

Most forces that the soil causes to be exerted on structures are vertical – i.e. either up or down. However, because these forces are seldom spread evenly around the footings, and because the building resists uneven movement because of its rigidity, forces are exerted from one part of the building to another. The net result of all these forces is usually rotational. This resultant force often complicates the diagnosis because the visible symptoms do not simply reflect the original cause. A common symptom is binding of doors on the vertical member of the frame.

Effects on full masonry structures

Brickwork will resist cracking where it can. It will attempt to span areas that lose support because of subsided foundations or raised points. It is therefore usual to see cracking at weak points, such as openings for windows or doors.

In the event of construction settlement, cracking will usually remain unchanged after the process of settlement has ceased.

With local shear or erosion, cracking will usually continue to develop until the original cause has been remedied, or until the subsidence has completely neutralised the affected portion of footing and the structure has stabilised on other footings that remain effective.

In the case of swell/shrink effects, the brickwork will in some cases return to its original position after completion of a cycle, however it is more likely that the rotational effect will not be exactly reversed, and it is also usual that brickwork will settle in its new position and will resist the forces trying to return it to its original position. This means that in a case where swelling takes place after construction and cracking occurs, the cracking is likely to at least partly remain after the shrink segment of the cycle is complete. Thus, each time the cycle is repeated, the likelihood is that the cracking will become wider until the sections of brickwork become virtually independent.

With repeated cycles, once the cracking is established, if there is no other complication, it is normal for the incidence of cracking to stabilise, as the building has the articulation it needs to cope with the problem. This is by no means always the case, however, and monitoring of cracks in walls and floors should always be treated seriously.

Upheaval caused by growth of tree roots under footings is not a simple vertical shear stress. There is a tendency for the root to also exert lateral forces that attempt to separate sections of brickwork after initial cracking has occurred.

The normal structural arrangement is that the inner leaf of brickwork in the external walls and at least some of the internal walls (depending on the roof type) comprise the load-bearing structure on which any upper floors, ceilings and the roof are supported. In these cases, it is internally visible cracking that should be the main focus of attention, however there are a few examples of dwellings whose external leaf of masonry plays some supporting role, so this should be checked if there is any doubt. In any case, externally visible cracking is important as a guide to stresses on the structure generally, and it should also be remembered that the external walls must be capable of supporting themselves.

Effects on framed structures

Timber or steel framed buildings are less likely to exhibit cracking due to swell/shrink than masonry buildings because of their flexibility. Also, the doming/dishing effects tend to be lower because of the lighter weight of walls. The main risks to framed buildings are encountered because of the isolated pier footings used under walls. Where erosion or saturation cause a footing to fall away, this can double the span which a wall must bridge. This additional stress can create cracking in wall linings, particularly where there is a weak point in the structure caused by a door or window opening. It is, however, unlikely that framed structures will be so stressed as to suffer serious damage without first exhibiting some or all of the above symptoms for a considerable period. The same warning period should apply in the case of upheaval. It should be noted, however, that where framed buildings are supported by strip footings there is only one leaf of brickwork and therefore the externally visible walls are the supporting structure for the building. In this case, the subfloor masonry walls can be expected to behave as full brickwork walls.

Effects on brick veneer structures

Because the load-bearing structure of a brick veneer building is the frame that makes up the interior leaf of the external walls plus perhaps the internal walls, depending on the type of roof, the building can be expected to behave as a framed structure, except that the external masonry will behave in a similar way to the external leaf of a full masonry structure.

Water Service and Drainage

Where a water service pipe, a sewer or stormwater drainage pipe is in the vicinity of a building, a water leak can cause erosion, swelling or saturation of susceptible soil. Even a minuscule leak can be enough to saturate a clay foundation. A leaking tap near a building can have the same effect. In addition, trenches containing pipes can become watercourses even though backfilled, particularly where broken rubble is used as fill. Water that runs along these trenches can be responsible for serious erosion, interstrata seepage into subfloor areas and saturation.

Pipe leakage and trench water flows also encourage tree and shrub roots to the source of water, complicating and exacerbating the problem.

Poor roof plumbing can result in large volumes of rainwater being concentrated in a small area of soil:

- Incorrect falls in roof guttering may result in overflows, as may gutters blocked with leaves etc.

- Corroded guttering or downpipes can spill water to ground.
- Downpipes not positively connected to a proper stormwater collection system will direct a concentration of water to soil that is directly adjacent to footings, sometimes causing large-scale problems such as erosion, saturation and migration of water under the building.

Seriousness of Cracking

In general, most cracking found in masonry walls is a cosmetic nuisance only and can be kept in repair or even ignored. The table below is a reproduction of Table C1 of AS 2870.

AS 2870 also publishes figures relating to cracking in concrete floors, however because wall cracking will usually reach the critical point significantly earlier than cracking in slabs, this table is not reproduced here.

Prevention/Cure

Plumbing

Where building movement is caused by water service, roof plumbing, sewer or stormwater failure, the remedy is to repair the problem. It is prudent, however, to consider also rerouting pipes away from the building where possible, and relocating taps to positions where any leakage will not direct water to the building vicinity. Even where gully traps are present, there is sometimes sufficient spill to create erosion or saturation, particularly in modern installations using smaller diameter PVC fixtures. Indeed, some gully traps are not situated directly under the taps that are installed to charge them, with the result that water from the tap may enter the backfilled trench that houses the sewer piping. If the trench has been poorly backfilled, the water will either pond or flow along the bottom of the trench. As these trenches usually run alongside the footings and can be at a similar depth, it is not hard to see how any water that is thus directed into a trench can easily affect the foundation's ability to support footings or even gain entry to the subfloor area.

Ground drainage

In all soils there is the capacity for water to travel on the surface and below it. Surface water flows can be established by inspection during and after heavy or prolonged rain. If necessary, a graded drain system connected to the stormwater collection system is usually an easy solution.

It is, however, sometimes necessary when attempting to prevent water migration that testing be carried out to establish watertable height and subsoil water flows. This subject is referred to in BTF 19 and may properly be regarded as an area for an expert consultant.

Protection of the building perimeter

It is essential to remember that the soil that affects footings extends well beyond the actual building line. Watering of garden plants, shrubs and trees causes some of the most serious water problems.

For this reason, particularly where problems exist or are likely to occur, it is recommended that an apron of paving be installed around as much of the building perimeter as necessary. This paving

CLASSIFICATION OF DAMAGE WITH REFERENCE TO WALLS

Description of typical damage and required repair	Approximate crack width limit (see Note 3)	Damage category
Hairline cracks	<0.1 mm	0
Fine cracks which do not need repair	<1 mm	1
Cracks noticeable but easily filled. Doors and windows stick slightly	<5 mm	2
Cracks can be repaired and possibly a small amount of wall will need to be replaced. Doors and windows stick. Service pipes can fracture. Weathertightness often impaired	5–15 mm (or a number of cracks 3 mm or more in one group)	3
Extensive repair work involving breaking-out and replacing sections of walls, especially over doors and windows. Window and door frames distort. Walls lean or bulge noticeably, some loss of bearing in beams. Service pipes disrupted	15–25 mm but also depend on number of cracks	4



should extend outwards a minimum of 900 mm (more in highly reactive soil) and should have a minimum fall away from the building of 1:60. The finished paving should be no less than 100 mm below brick vent bases.

It is prudent to relocate drainage pipes away from this paving, if possible, to avoid complications from future leakage. If this is not practical, earthenware pipes should be replaced by PVC and backfilling should be of the same soil type as the surrounding soil and compacted to the same density.

Except in areas where freezing of water is an issue, it is wise to remove taps in the building area and relocate them well away from the building – preferably not uphill from it (see BTF 19).

It may be desirable to install a grated drain at the outside edge of the paving on the uphill side of the building. If subsoil drainage is needed this can be installed under the surface drain.

Condensation

In buildings with a subfloor void such as where bearers and joists support flooring, insufficient ventilation creates ideal conditions for condensation, particularly where there is little clearance between the floor and the ground. Condensation adds to the moisture already present in the subfloor and significantly slows the process of drying out. Installation of an adequate subfloor ventilation system, either natural or mechanical, is desirable.

Warning: Although this Building Technology File deals with cracking in buildings, it should be said that subfloor moisture can result in the development of other problems, notably:

- Water that is transmitted into masonry, metal or timber building elements causes damage and/or decay to those elements.
- High subfloor humidity and moisture content create an ideal environment for various pests, including termites and spiders.
- Where high moisture levels are transmitted to the flooring and walls, an increase in the dust mite count can ensue within the living areas. Dust mites, as well as dampness in general, can be a health hazard to inhabitants, particularly those who are abnormally susceptible to respiratory ailments.

The garden

The ideal vegetation layout is to have lawn or plants that require only light watering immediately adjacent to the drainage or paving edge, then more demanding plants, shrubs and trees spread out in that order.

Overwatering due to misuse of automatic watering systems is a common cause of saturation and water migration under footings. If it is necessary to use these systems, it is important to remove garden beds to a completely safe distance from buildings.

Existing trees

Where a tree is causing a problem of soil drying or there is the existence or threat of upheaval of footings, if the offending roots are subsidiary and their removal will not significantly damage the tree, they should be severed and a concrete or metal barrier placed vertically in the soil to prevent future root growth in the direction of the building. If it is not possible to remove the relevant roots without damage to the tree, an application to remove the tree should be made to the local authority. A prudent plan is to transplant likely offenders before they become a problem.

Information on trees, plants and shrubs

State departments overseeing agriculture can give information regarding root patterns, volume of water needed and safe distance from buildings of most species. Botanic gardens are also sources of information. For information on plant roots and drains, see Building Technology File 17.

Excavation

Excavation around footings must be properly engineered. Soil supporting footings can only be safely excavated at an angle that allows the soil under the footing to remain stable. This angle is called the angle of repose (or friction) and varies significantly between soil types and conditions. Removal of soil within the angle of repose will cause subsidence.

Remediation

Where erosion has occurred that has washed away soil adjacent to footings, soil of the same classification should be introduced and compacted to the same density. Where footings have been undermined, augmentation or other specialist work may be required. Remediation of footings and foundations is generally the realm of a specialist consultant.

Where isolated footings rise and fall because of swell/shrink effect, the homeowner may be tempted to alleviate floor bounce by filling the gap that has appeared between the bearer and the pier with blocking. The danger here is that when the next swell segment of the cycle occurs, the extra blocking will push the floor up into an accentuated dome and may also cause local shear failure in the soil. If it is necessary to use blocking, it should be by a pair of fine wedges and monitoring should be carried out fortnightly.

This BTF was prepared by John Lewer FAIB, MIAMA, Partner, Construction Diagnosis.

The information in this and other issues in the series was derived from various sources and was believed to be correct when published.

The information is advisory. It is provided in good faith and not claimed to be an exhaustive treatment of the relevant subject.

Further professional advice needs to be obtained before taking any action based on the information provided.

Distributed by

CSIRO PUBLISHING PO Box 1139, Collingwood 3066, Australia

Freecall 1800 645 051 Tel (03) 9662 7666 Fax (03) 9662 7555 www.publish.csiro.au

Email: publishing.sales@csiro.au

© CSIRO 2003. Unauthorised copying of this Building Technology file is prohibited

EXAMPLES OF **GOOD** HILLSIDE PRACTICE



EXAMPLES OF **POOR** HILLSIDE PRACTICE



PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT 2007 APPENDIX C: LANDSLIDE RISK ASSESSMENT QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY

QUALITATIVE MEASURES OF LIKELIHOOD

Approximate Annual Probability		Implied Indicative Landslide Recurrence Interval	Description	Descriptor	Level
Indicative Value	Notional Boundary				
10 ⁻¹	5x10 ⁻²	10 years	The event is expected to occur over the design life.	ALMOST CERTAIN LIKELY	A
10 ⁻²	5x10 ⁻³	100 years			B
10 ⁻³	5x10 ⁻⁴	1000 years	20 years	POSSIBLE UNLIKELY	C
10 ⁻⁴	5x10 ⁻⁵	10,000 years	200 years		D
10 ⁻⁵	5x10 ⁻⁶	100,000 years	20,000 years	RARE BARELY CREDIBLE	E
10 ⁻⁶		1,000,000 years	200,000 years		F

Note: (1) The table should be used from left to right; use Approximate Annual Probability or Description to assign Descriptor, not *vice versa*.

QUALITATIVE MEASURES OF CONSEQUENCES TO PROPERTY

Approximate Cost of Damage		Description	Descriptor	Level
Indicative Value	Notional Boundary			
200%	100%	Structure(s) completely destroyed and/or large scale damage requiring major engineering works for stabilisation. Could cause at least one adjacent property major consequence damage.	CATASTROPHIC	1
60%	40%		MAJOR	2
20%	10%	Moderate damage to some of structure, and/or significant part of site requiring large stabilisation works. Could cause at least one adjacent property minor consequence damage.	MEDIUM	3
5%	1%		MINOR	4
0.5%		Little damage. (Note for high probability event (Almost Certain), this category may be subdivided at a notional boundary of 0.1%. See Risk Matrix.)	INSIGNIFICANT	5

- Notes:** (2) The Approximate Cost of Damage is expressed as a percentage of market value, being the cost of the improved value of the unaffected property which includes the land plus the unaffected structures.
- (3) The Approximate Cost is to be an estimate of the direct cost of the damage, such as the cost of reinstatement of the damaged portion of the property (land plus structures), stabilisation works required to render the site to tolerable risk level for the landslide which has occurred and professional design fees, and consequential costs such as legal fees, temporary accommodation. It does not include additional stabilisation works to address other landslides which may affect the property.
- (4) The table should be used from left to right; use Approximate Cost of Damage or Description to assign Descriptor, not *vice versa*

PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT 2007

APPENDIX C: – QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY (CONTINUED)

QUALITATIVE RISK ANALYSIS MATRIX – LEVEL OF RISK TO PROPERTY

LIKELIHOOD		CONSEQUENCES TO PROPERTY (With Indicative Approximate Cost of Damage)				
	Indicative Value of Approximate Annual Probability	1: CATASTROPHIC 200%	2: MAJOR 60%	3: MEDIUM 20%	4: MINOR 5%	5: INSIGNIFICANT 0.5%
A – ALMOST CERTAIN	10^{-1}	VH	VH	VH	H	M or L (S)
B – LIKELY	10^{-2}	VH	VH	H	M	L
C – POSSIBLE	10^{-3}	VH	H	M	M	VL
D – UNLIKELY	10^{-4}	H	M	L	L	VL
E – RARE	10^{-5}	M	L	L	VL	VL
F – BARELY CREDIBLE	10^{-6}	L	VL	VL	VL	VL

Notes: (5) For Cell A5, may be subdivided such that a consequence of less than 0.1% is Low Risk.
 (6) When considering a risk assessment it must be clearly stated whether it is for existing conditions or with risk control measures which may not be implemented at the current time.

RISK LEVEL IMPLICATIONS

Risk Level		Example Implications (7)
VH	VERY HIGH RISK	Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low; may be too expensive and not practical. Work likely to cost more than value of the property.
H	HIGH RISK	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to Low. Work would cost a substantial sum in relation to the value of the property.
M	MODERATE RISK	May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as practicable.
L	LOW RISK	Usually acceptable to regulators. Where treatment has been required to reduce the risk to this level, ongoing maintenance is required.
VL	VERY LOW RISK	Acceptable. Manage by normal slope maintenance procedures.

Note: (7) The implications for a particular situation are to be determined by all parties to the risk assessment and may depend on the nature of the property at risk; these are only given as a general guide.

Appendix E

Map of Geotechnical Areas – Manly

Schedule 1 – Map C – Potential Geotechnical Landslip Hazard Areas

Appendix 1B

Map of Geotechnical Areas Landslips Potential Hazards

Notes

1. Boundaries between geotechnical zones are approximate only, for more details see sheet 1, 2, 3, 4, 5 at Manly Council's Customer Service Centre, the broad zones are based on available topographical and geological data, with limited field checking.

The boundaries will be subject to change.
2. For definition of Geotechnical Zones refer to Coffey Geosciences Pty Ltd report No S20199/1-AM, November 1999.
2. Base plan provided by Manly Council on 23rd July 1999.

Legend

- Area G1
- Area G2
- Area G3
- Area G4
- Contour Lines
10 meter intervals



Scale 1:20 000 @ A3

Disclaimer

This map has been compiled from various sources and the publisher and/or contributors accept no responsibility for any injury, loss or damage arising from its use or errors or omissions therein. While all care is taken to ensure a high degree of accuracy users are invited to notify of any map discrepancies.

© Manly Council + © Survey General's Department 2001. All Rights Reserved. No part of this plan may be reproduced without written permission from the General Manager PO Box 62 Manly 1555. Produced by Manly Council's Planning, Design and Environment Group 2005.

The boundaries between the geotechnical zones shown on the maps should be regarded as being approximate only and must be used and applied with due caution. As the study did not involve site tripping of all geotechnical boundaries, it should be expected that some future amendments and refinements to the broad geotechnical zone boundaries will be required as more detailed information and site specific data becomes available to Council. In this regard Council may permit minor exceptions to this plan in order to meet the aims of Council and circumstances of the particular application. (Source: L&S/CIP part 1)

Source: "Geotechnical Zoning of Manly Council Area", Drawing Nos. S20199/1-1 to 5, dated 23/11/99 and drawn by Coffey Geosciences Pty Ltd.

Zone	Description	Slope Angle	Council Require
G1	Steeper slopes, generally near coastal or harbourside areas	>25 deg	Geotechnical assessment is required
G2	Flanking slopes	15 to 25 deg	Geotechnical assessment may be required
G3	Beach foredune and alluvial flats	<5 deg	Should follow good engineering practice
G4	Ridge crests, major spur slopes and dissected plateau areas	<15 deg	Geotechnical assessment may be required