

PO Box 979 Level 1, 91 George Street PARRAMATTA NSW 2150

Office 02 9891 5033 Fax 02 9891 3898 admin@sparksandpartners.com.au

sparksandpartners.com.au

ABN 95 161 152 969

## INTEGRATED WATER CYCLE MANAGEMENT REPORT

### **RESIDENTIAL DEVELOPMENT**

3 CENTRAL ROAD, AVALON

Date: 8 September 2020

Revision: 3

Issue: 3

Ref. No.: 19279\_C\_RPT\_IWCM Report

Prepared for:Avaion Central Pty Ltd C/o Cottee Parker<br/>JPRAClient Details:Email: Roland.Martinez@cotteeparker.com.au<br/>Phone: 9366 1133











### Disclaimer

This specification (including any enclosures and attachments) has been prepared for the exclusive use and benefit of the addressee(s) and solely for the purpose for which it is provided. Unless we provide express prior written consent, no part of this report should be reproduced, distributed or communicated to any third party. We do not accept any liability if this report is used for an alternative purpose from which it is intended, nor to any third party in respect of this report.

### **Document Control**

Revision	Date	Description	Prepared	Reviewed	Approved
1	12.12.19	Issued for DA	DL	BB	BB
2	31.07.20	Coordination Issue	DD	BB	BB
3	08.09.20	Issued for DA	DD	BB	BB

Prepared by	Daniel Drewitt	Revision	3
Approved by	Benjamin Barrett	Revision	3



### TABLE OF CONTENTS

1.	EXEC	TIVE SUMMARY						
2.	INTRO	DUCTION	2					
	2.1	Existing Site	2					
	2.2	Proposed Development	2					
3.	INTEGRATED WATER MANAGEMENT							
	3.1	General	3					
	3.2	Rainwater Reuse	3					
		3 Stormwater Quality						
	3.4	Stormwater Quantity	5					
	3.5	Maintenance and Monitoring	5					
CONC	LUSIO	Ν	6					
APPE	NDIX A	. CONCEPT DRAINAGE PLANS	7					
APPE	NDIX B	. GEOTECHINICAL REPORT	8					
APPE	PENDIX C. ON-SITE DETENTION CHECKLIST							
APPE	NDIX D	. MAINTENANCE & MONITORING SCHEDULE 1	0					



### 1. EXECUTIVE SUMMARY

Sparks & Partners have been engaged by Avalon Central Pty Ltd to provide civil engineering services to support the proposed Development Application for 3 Central Avenue, Avalon Beach. The engineering services include the design and documentation of the stormwater drainage infrastructure for the proposed development.

Northern Beaches Council being the approval authority for the proposed development, require an Integrated Water Cycle Management Plan be prepared that takes into consideration the objectives and controls under the relevant DCP and engineering guidelines. In response to this requirement Sparks and Partners has undertaken modelling of the proposed integrated water management measures and prepared this report to demonstrate that the proposed residential development identifies and incorporates water conservation and stormwater management measures into its design and operation in accordance with the requirements of the Northern Beaches Council DCP and Pittwater Council DCP.

This report addresses all items discussed and advice provided by Council during a meeting conducted on the 14<sup>th</sup> of July 2020.





### 2. INTRODUCTION

### 2.1 Existing Site

The site is situated within the former Pittwater area within Northern Beaches Council. The site currently contains a two storey residential building of masonry construction and associated driveway pavement, lawns and landscaping. The site perimeter is lined by a mix of timber, cyclone and aluminum fencing. The site falls steeply to the southern rear boundary at an average of 8.9% grade. A Sydney water sewer main traverses the rear and western boundaries in an east/west alignment.

### 2.2 Proposed Development

The proposed development is a for a residential flat building with a total site area of 1,417m<sup>2</sup>. The development consists of a basement carpark, seven (7) residential dwellings, a new concrete footpath and landscaping. The total non-trafficable roofed area occupies 256m2, 543m<sup>2</sup> of impervious surfaces including, private balconies, communal areas, pedestrian walkways, vehicle driveway and footpath. The landscaping occupies an area of 618m<sup>2</sup>. The site is bounded by Central Road on the northern boundary, Patterson Lane on the eastern boundary, 5 Central Road on the western boundary and Dunbar Park along the northern boundary.



### 3. INTEGRATED WATER MANAGEMENT

### 3.1 General

The objective of integrated water management is to provide a strategy that brings together the different aspects of the water cycle as a whole rather than an ad hoc approach to water management. This includes the management aspects of freshwater, wastewater and stormwater. The following integrated water management strategies have been considered and addressed for the proposed development:

- 1. Employ an integrated water collection and recycling system for capturing and recycling roofwater;
- 2. Control the quality of stormwater that is disposed from the site;
- 3. Control the quantity of stormwater that is discharged for the site.

To demonstrate the above concept stormwater drainage plans and associated details have been prepared along with detailed modelling using the Council endorsed MUSIC software package. The concept stormwater drainage plans detail the location of the water management infrastructure including pits, pipes, on-site detention (OSD) tank, rainwater tanks (RWT), Ocean Protect OceanGuard pit baskets and Ocean Protect StormFilter cartridges, and are included in Appendix A.

### 3.2 Rainwater Reuse

Through the reuse of collected roofwater for non-potable reuse the proposed demand on potable water resources is reduced. The proposed development will capture roof water from the non-trafficable part of the building rooved area ( $256m^2$ ). This collected roofwater will be conveyed to an 29,000 Litre tank for storage and reuse throughout the development. Re-use purposes will primarily include irrigation uses. The Rainwater tank has been sized to complied with the BASIX certificate for the development and is larger than the minimum allowable tank size as per the table provided within Clause B5.5 of Pittwater Council's DCP for a development with between  $300 - 400m^2$  of additional impervious area.

A water balance of the proposed reuse system has been completed to model the effectiveness and efficiency of the system. The water balance model was constructed using the MUSIC software package with the following inputs:

- Sydney Observatory rainfall data station 066062 from 1981 to 1985.
- Total approximate non-potable reuse of is based on:
  - 0.4kL/m<sup>2</sup>/year of irrigation for approximately 221m<sup>2</sup> of landscape area equates to approx. 88.4kL per year.

Using the above determined non-potable demand the MUSIC model determines the rainwater tank has an approximate efficiency of 100.0%. This efficiency results in an approximate reduction in the proposed demand on potable water supplies of 87,730 litres per year.



### 3.3 Stormwater Quality

To ensure the quality of stormwater leaving the site is acceptable and meets council's requirements specific water quality treatment measures are to be employed. These treatment measures are to treat the collected stormwater runoff prior to discharge to the council drainage system located in Patterson Lane. The treatment measures consist of Ocean Protect OceanGuard pit baskets within inlet pits, an 29kL rainwater tanks for reuse and four (4) Ocean Protect 690mm PSorb StormFilter cartridges The combination of these measures provides a treatment train approach to the treatment of stormwater runoff.

Alternate treatment measures such as swales and infiltration basins have been considered in the design. The steep slope of the site and layout of landscaping area available make these measures prohibitive to practically implement with sufficient capacity to meet council's reduction targets, drain adequately, and meet the requirement to capture all impervious area. The existing council drainage pit within Patterson Lane has been utilised as the site discharge point.


At the request of Council infiltration was investigated as the primary means of stormwater disposal. A site analysis and geotechnical report was prepared by JK Geotechnics Pty Ltd on the 27<sup>th</sup> of November 2019. Refer to Appendix B for a copy of their report. This analysis found that the site sits on a sandy clay layer. It was concluded by Sparks & Partners that the site would not be suitable for infiltration and Council was advised on the 14<sup>th</sup> of July 2020. This advice was acceptable by Council's Project Leader – Water Management, Ruby Ardren on the 16<sup>th</sup> of July 2020.

Modelling of the proposed treatment measures has been undertaken using the MUSIC software package version 6. The modelling inputs have been based on the source node parameters outlined in Northern Beaches Council WSUD & MUSIC Modelling Guidelines. The modelling results of the water quality achieved for the site is detailed in Table 1 – MUSIC Model Results below, along with a figure of the prepared model.

	Source Load	Residual Load	% Reduction Achieved	NBC % Reduction Requirement	Compliance with NBC Requirement
Total Suspended Solids (kg/yr)	135	19.9	85.2	85	YES
Total Phosphorus (kg/yr)	0.273	0.0725	73.4	65	YES
Total Nitrogen (kg/yr)	2.38	1.03	56.9	45	YES
Gross Pollutants (kg/yr)	22.8	1.87	91.8	90	YES

Table 1. MUSIC Model Results



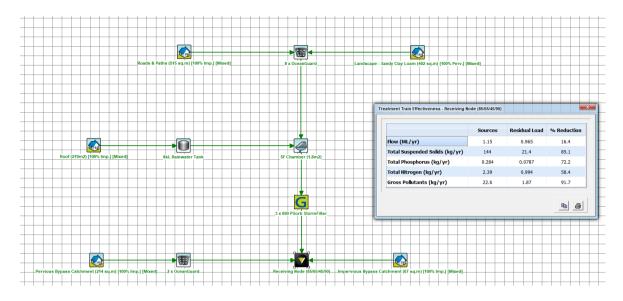

### 3.4 Stormwater Quantity

The proposed development requires the implementation of on-site detention (OSD) as per the Council DCP to control stormwater discharge from the site. The proposed development has an approximate area of 1,136m<sup>2</sup> (80.1%) draining to the proposed on-site detention (OSD) facility which includes pavement (476m<sup>2</sup>), roof (256m<sup>2</sup>) and landscaped (404m<sup>2</sup>) areas. A catchment plan of the proposed development is included in the Appendix A.

Pittwater Council's DCP Clause B5.7 has been utilised to determine the required volume and discharge for the proposed development. Based on the catchment plan (DA4.10) provided in appendix A the development will result in a total impervious area increased of 342m<sup>2</sup>. Therefore, as per PCDCP Clause B5.7 the required minimum storage volume for the proposed development is approx. 24m<sup>3</sup> with a maximum permissible discharge of 12.5L/sec from the OSD. The On-Site Detention Checklist is located in the Appendix C for review.

### 3.5 Maintenance and Monitoring

To ensure the continued efficient and correct operation of the proposed integrated water management infrastructure a 'maintenance and monitoring schedule' is included in the Appendix D of this plan. The schedule details the frequency of inspections, what is to be inspected and what rectifications to make if required for the water management infrastructure located within the proposed development. The schedule is to be implemented upon commissioning of the water management infrastructure and remain in place for the life of the development; with all records kept on site for inspection should the approval authority deem it necessary.



### CONCLUSION

Based on the preparation of the concept stormwater drainage plans and MUSIC modeling results it is demonstrated that the principles of integrated water management have been incorporated into the design and operation of the proposed development at 3 Central Avenue, Avalon Beach in accordance with Northern Beaches Council DCP and Pittwater Council DCP. It is demonstrated that the proposed development achieves reductions in potable water import by capturing rainwater on site and reusing this for non-potable uses including irrigation, achieves pollution reduction targets set by council, and employs OSD for the control of stormwater discharge from the site in accordance with targets set by council. It is also demonstrated that the proposed developments employed water conservation measures will continue to operate effectively and efficiently through the implementation and use of a monitoring and maintenance schedule ensuring the integrity of the system is maintained.



### **APPENDIX A. CONCEPT DRAINAGE PLANS**

## **3 CENTRAL ROAD, AVALON BEACH CONCEPT STORMWATER MANAGEMENT**

#### SITE WORKS - GENERAL

- ALL WORKS ARE TO BE UNDERTAKEN IN ACCORDANCE WITH LOCAL COUNCIL, AUSTRALIAN AND AUTHORITY STANDARDS.
   ALL TRENCHING WORKS ARE TO BE RESTORED TO ORIGINAL CONDITION.
- 3. THE INTEGRITY OF ALL EXISTING AND NEW SERVICES IS TO BE MAINTAINED THROUGHOUT THE CONSTRUCTION PERIOD. 4. ALL PLANS ARE TO BE READ IN CONJUNCTION WITH APPROVED
- ALL PLANS ARE TO BE READ IN CONJUNCTION WITH APPROVED ARCHITECTS, STRUCTURAL ENGINEERS AND OTHER CONSULTANT'S PLANS. ANY DISCREPANCIES ARE TO BE NOTIFIED TO THE ENGINEER FOR CLARIFICATION.
   THE ENGINEER SHALL BE GIVEN A MIN. OF 48 HOURS NOTICE FOR ALL
- STORMWATER DRAINAGE AND PAVEMENT INSPECTIONS. CONCRETE SHALL NOT BE DELIVERED UNTIL ENGINEERS APPROVAL IS OBTAINED.

#### SITE WORKS - ACCESS AND SAFETY

- ALL WORKS ARE TO BE UNDERTAKEN IN A SAFE MANNER IN ACCORDANCE WITH ALL STATUTORY AND INDUSTRIAL RELATION REQUIREMENTS.
- 2. ACCESS TO ADJACENT BUILDINGS AND PROPERTIES SHALL BE MAINTAINED AT ALL TIMES. 3. WHERE NECESSARY SAFE PASSAGE SHALL BE PROVIDED FOR VEHICLES AND PEDESTRIANS THROUGH OR ADJACENT TO THE SITE.

#### STORMWATER SUMMARY

#### ON-SITE DETENTION:

THE ON-SITE DETENTION TANK PROPOSED FOR THE DEVELOPMENT HAS BEEN SIZED AS PER THE TABLE LOCATED IN SECTION B5.7 OF PITTWATER COUNCIL'S DEVELOPMENT CONTROL PLAN (2015).

#### RAINWATER TANK

THE RAINWATER TANK PROPOSED FOR THE DEVELOPMENT HAS BEEN SIZED AS PER THE BASIX CERTIFICATE PREPARED FOR THE DEVELOPMENT. THE SIZE OF THE RAINWATER IS COMPLIANT WITH SECTION B5.5 OF PITTWATER COUNCIL'S DEVELOPMENT CONTROL PLAN (2015) AND THE REQUIREMENTS OF NORTHERN BEACHES COUNCIL TABLE.

#### STORMWATER QUALITY:

STORMWATER QUALITY TREATMENT DEVICES HAVE BEEN PROPOSED FOR USE WITHIN THE DEVELOPMENT BASED ON PITTWATER COUNCIL'S DEVELOPMENT CONTROL PLAN (2015) AND ADVICE RECEIVED BY COUNCIL ON THE 14TH OF JULY 2020. REFER TO THE INTEGRATED WATER CYLLE MANAGEMENT REPORT (19279 \_\_ RPT\_IWCM REPORT (3)) ACCOMPANYING THESE PLANS FOR FURTHER INFORMATION.

#### SEDIMENT AND EROSION CONTROL

- THE CONTRACTOR SHALL INSTIGATE ALL SEDIMENT AND EROSION CONTROL MEASURES IN ACCORDANCE WITH NORTHERN BEACHES COUNCIL AND THE "BLUE BOOK" (MANAGING URBAN STORTWATER SOLLS AND CONSTRUCTION, PRODUCED BY THE DEPARTMENT OF HOUSING). THESE MEASURES ARE TO BE REGULARLY INSPECTED AND MAINTAINED.
- 2. THE SEDIMENT & EROSION CONTROL PLAN PRESENTS CONCEPTS ONLY, THE CONTRACTOR SHALL AT ALL TIMES BE RESPONSIBLE FOR THE ESTABLISHMENT & MANAGEMENT OF A DETAILED SCHEME MEETING COUNCIL'S DESIGN, AND ALL OTHER REGULATORY AUTHORITY REQUIREMENTS.
- 3. WHERE PRACTICAL, THE SOIL EROSION HAZARD ON THE SITE SHALL BE KEPT AS LOW AS POSSIBLE. TO THIS END, WORKS SHOULD BE UNDERTAKEN IN THE FOLLOWING SEQUENCE:
- a. INSTALL ALL TEMPORARY SEDIMENT FENCES AND BARRIER FENCES. WHERE FENCES ARE ADJACENT TO EACH OTHER THE SEDIMENT FENCE CAN BE INCORPORATED INTO THE BARRIER FENCE.
- b. CONSTRUCT TEMPORARY STABILISED SITE ACCESS. INCLUDING SHAKE DOWN AND WASH PAD.
- c. INSTALL SEDIMENT CONTROL MEASURES AS OUTLINED ON THESE SEDIMENT AND CONTROL PLANS (ONCE APPROVED)
- 4. THE CONTRACTOR SHALL UNDERTAKE SITE DEVELOPMENT WORKS SO THAT LAND DISTURBANCE IS CONFINED TO AREAS OF MINIMUM WORKABLE SIZE.
- 5. AT ALL TIMES AND IN PARTICULAR DURING WINDY AND DRY WEATHER, LARGE, UNPROTECTED AREAS WILL BE KEPT MOIST (NOT WET) BY SPRINKLING WITH WATER TO KEEP DUST UNDER CONTROL. TACIFIERS MAY BE USED TO CONTROL DUST DURING EXTENDED PERIODS OF DRY
- WEATHER. 6. ANY SAND USED IN THE CONCRETE CURING PROCESS (SPREAD OVER THE SURFACE) SHALL BE REMOVED AS SOON AS POSSIBLE AND WITHIN 10 WORKING DAYS FROM PLACEMENT.
- 7. WATER SHALL BE PREVENTED FROM ENTERING THE PERMANENT DRAINAGE SYSTEM UNLESS THE CATCHMENT AREA HAS BEEN STABILISED AND/OR ANY LIKELY SEDIMENT HAS BEEN FILTERED OUT.
- TEMPORARY SOIL AND WATER MANAGEMENT STRUCTURES SHALL BE REMOVED ONLY AFTER THE LANDS THEY ARE PROTECTING ARE STABILISED / REHABILITATED.
- 9. THE CONTRACTOR SHALL ALLOW FOR THE ESTABLISHMENT OF ANY OTHER EROSION PROTECTION MEASURES. (IF APPLICABLE).
- 10.THE CONTRACTOR SHALL REGULARLY INSPECT (MINIMUM TWICE PER WEEK) ALL EROSION AND SEDIMENT CONTROL MEASURES TO ENSURE THEY ARE OPERATING EFFECTIVELY. REPAIRS AND/OR MAINTENANCE SHALL BE UNDERTAKEN REGULARLY AND AS REQUIRED, PARTICULARLY FOLLOWING STORM EVENTS.
- 11. ACCEPTABLE RECEPTORS SHALL BE USED FOR CONCRETE AND MORTAR SLURRIES, PAINTS, ACID WASHINGS, LIGHT-WEIGHT WASTE MATERIALS AND LITTER. WASTE FROM THESE RECEPTORS SHALL BE DISPOSED OF IN ACCORDANCE WITH REGULATORY AUTHORITY REQUIREMENTS. PAY ALL FEES AND PROVIDE EVIDENCE OF SAFE DISPOSAL.

#### STORMWATER

- ALL WORKS ARE TO BE UNDERTAKEN IN ACCORDANCE WITH THE FOLLOWING AUSTRALIAN STANDARDS AS2032, AS3500 AND AS3725 AS A MINIMUM.
- REFER TO INTEGRATED WATER CYCLE MANAGEMENT REPORT [1] (DATED: 29.07.20) FOR FURTHER DETAILS ON STORMWATER SYSTEM
   ALL PIPES LESS THAN OR EQUAL TO Ø300mm IN SIZE ARE TO BE
- ALL PIPES LESS THAN OR EQUAL TO BOUMM IN SIZE ARE TO BE SOLVENT WELD-JOINTED UPVC CLASS SN6 U.N.O.
   ALL PIPES Ø375mm OR GREATER IN SIZE ARE TO BE MIN. CLASS 2
- ALL PIPES 0375mm UR GREATER IN SIZE ARE TO BE MIN. LLASS 2 REINFORCED CONCRETE PIPE (RCP) WITH SPIGGOT AND SOCKETED JOINT OR VANTAGE PIPE PLUS (VPIPE-) FIBRE REINFORCED CONCRETE (FRC) WITH VANTAGE PIPE PLUS JOINT U.N.O.
- 5. ALL PIPES ARE TO BE LAID AT MIN. 1.0% GRADE U.N.O.
- 6. PIPE BEDDING IS TO BE HS2 UNDER ROADS AND TRAFFICKED AREAS AND SHALL BE H2 IN LANDSCAPED AND PEDESTRIAN TRAFFICKED AREAS U.N.O.
- 7. ALL PIPE BENDS AND JUNCTIONS ARE TO BE MADE WITH EITHER PURPOSE MADE FITTINGS OR STORMWATER DRAINAGE PITS.
- MINIMUM COVER FROM THE OBVERT OF THE STORMWATER PIPE OF 300mm IS TO BE PROVIDED IN LANDSCAPED AREAS AND 600mm IN
- VEHICULAR TRAFFICKED AREAS U.N.O. 9. WHERE MINIMUM COVER CANNOT BE ACHIEVED CONCRETE ENCASEMENT OF THE AFFECTED PIPE IS MAY BE UNDERTAKEN WITH 20MPa CONCRETE WITH A MIN. COVER OF 150mm TO ALL SIDES OF THE PIPE. THE CONTRACTOR SHALL CONFIRM THIS REQUIREMENT WITH THE ENGINERE OR SUPERITYONERT.
- 10. LAID PIPELINES ARE TO HAVE THE FOLLOWING CONSTRUCTED TOLERANCES:
- a. HORIZONTAL-1:300 ANGULAR DEVIATION FROM REQUIRED ALIGNMENT, b. VERTICAL-1:300 ANGULAR DEVIATION FROM REQUIRED ALIGNMENT.
- 10. ALL DRAINAGE PITS ARE TO BE CAST IN-SITU, PRECAST DRAINAGE PITS MAY BE USED WITH APPROVAL FROM THE ENGINEER. THE CONTRACTOR SHALL SUBMIT A PRECAST PIT INSTALLATION WORK METHOD STATEMENT FOR ASSESSMENT BY THE ENGINEER FOR APPROVAL.
- 11. DRAINAGE PIT COVERS ARE TO BE EITHER GALVANISED STEEL OR CAST IRON CLASS 'B' IN LANDSCAPED AND PEDESTRIAN TRAFFICKED AREAS AND CLASS 'D' IN ALL VEHICULAR TRAFFICKED AREAS U.N.O.
- 12. DRAINAGE PIT COVERS ARE TO BE 'HEELSAFE' TYPE IN ALL PEDESTRIAN TRAFFICKED AREAS U.N.O.
- EXISTING STORMWATER PIT LOCATIONS AND INVERT LEVELS TO BE CONFIRMED PRIOR TO COMMENCING WORKS ON SITE.
   PROVIDE (LEANING FYES (RODDING POINTS) TO PIPES AT ALL CORNERS.
- PROVIDE LLEANING ETES (ROUDING POINTS) TO PITES AT ALL CURRER: AND T-JUNCTIONS WHERE NO PITS ARE PRESENT.
   DOWN PIPES CONNECTED DIRECT TO PIPES TO BE CONNECTED AT 45°
- TO THE FLOW DIRECTION WITH A CLEANING EYE PROVIDED AT GROUND LEVEL.

#### DRAWING SCHEDULE

DA1.01COVER SHEET, DRAWING SCHEDULE & LOCALITY PLANDA2.01CONCEPT SEDIMENT & EROSION CONTROL PLAN & DETAILSDA4.01CONCEPT STORMWATER MANAGEMENT PLAN - LOWER GROUNDDA4.02CONCEPT STORMWATER MANAGEMENT PLAN - GROUNDDA4.10CONCEPT STORMWATER CATCHMENT PLANDA4.11STORMWATER MANAGEMENT DETAILS SHEET 1DA4.22STORMWATER MANAGEMENT DETAILS SHEET 2

HLOIM	NOT TO SCALE											
r n	IMPORTANT • DD NOT SCALE OFF THIS DRAWING. USE DIMENSIONS & ARCHITECTURAL DRAWINGS ONLY	NORTH POI	NT			DATE	AMENDMENT	INIT	REV	DATE	AMENDMENT	
THE .	DRAWINGS TO BE READ IN CONJUNCTION WITH SPECIFICATION.		(		7	12.12.19	ISSUED FOR DA	DL	1			
5	THE INFORMATION ON THIS DRAWING REMAINS THE PROPERTY OF SPARKS & PARTNERS CONSULTING ENGINEERS REPRODUCTION OF THE WHOLE OR PART OF	'			$\langle   \rangle$	/	31.07.20	ISSUED FOR COORDINATION	DD	2		
G	THE DOCUMENT CONSTITUTES AN INFRINGEMENT OF COPYRIGHT®					08.09.20	ISSUED FOR DA	DD	3			
2012	DEEEDENCES											

INIT	REV	STRUCTURAL		PROJECT	
			AVALON BEACH CENTRAL PTY. LTD.	3 CENTRAL ROAD, AVALON BEACH	
		MECHANICAL			
 					P
		ELECTRICAL		ARCHITECT	hi
		-		COTTEEPARKER Ø JPRA	
		CIVIL		SYDNEY T 612 9368 1133	
				COTTEE PARKER ARCHITECTS PTY LTD	




LOCALITY PLAN

## 





CIVIL DESIGN COVER SHEET, DRAWING SCHEDULE & LOCALITY PLAN

IATE	DRAWN DESIGNED CHECKED
DEC 2019	SCALE SIZE REVISION
ROJECT No	N.T.S A1
19279	DA1.01 3
	10

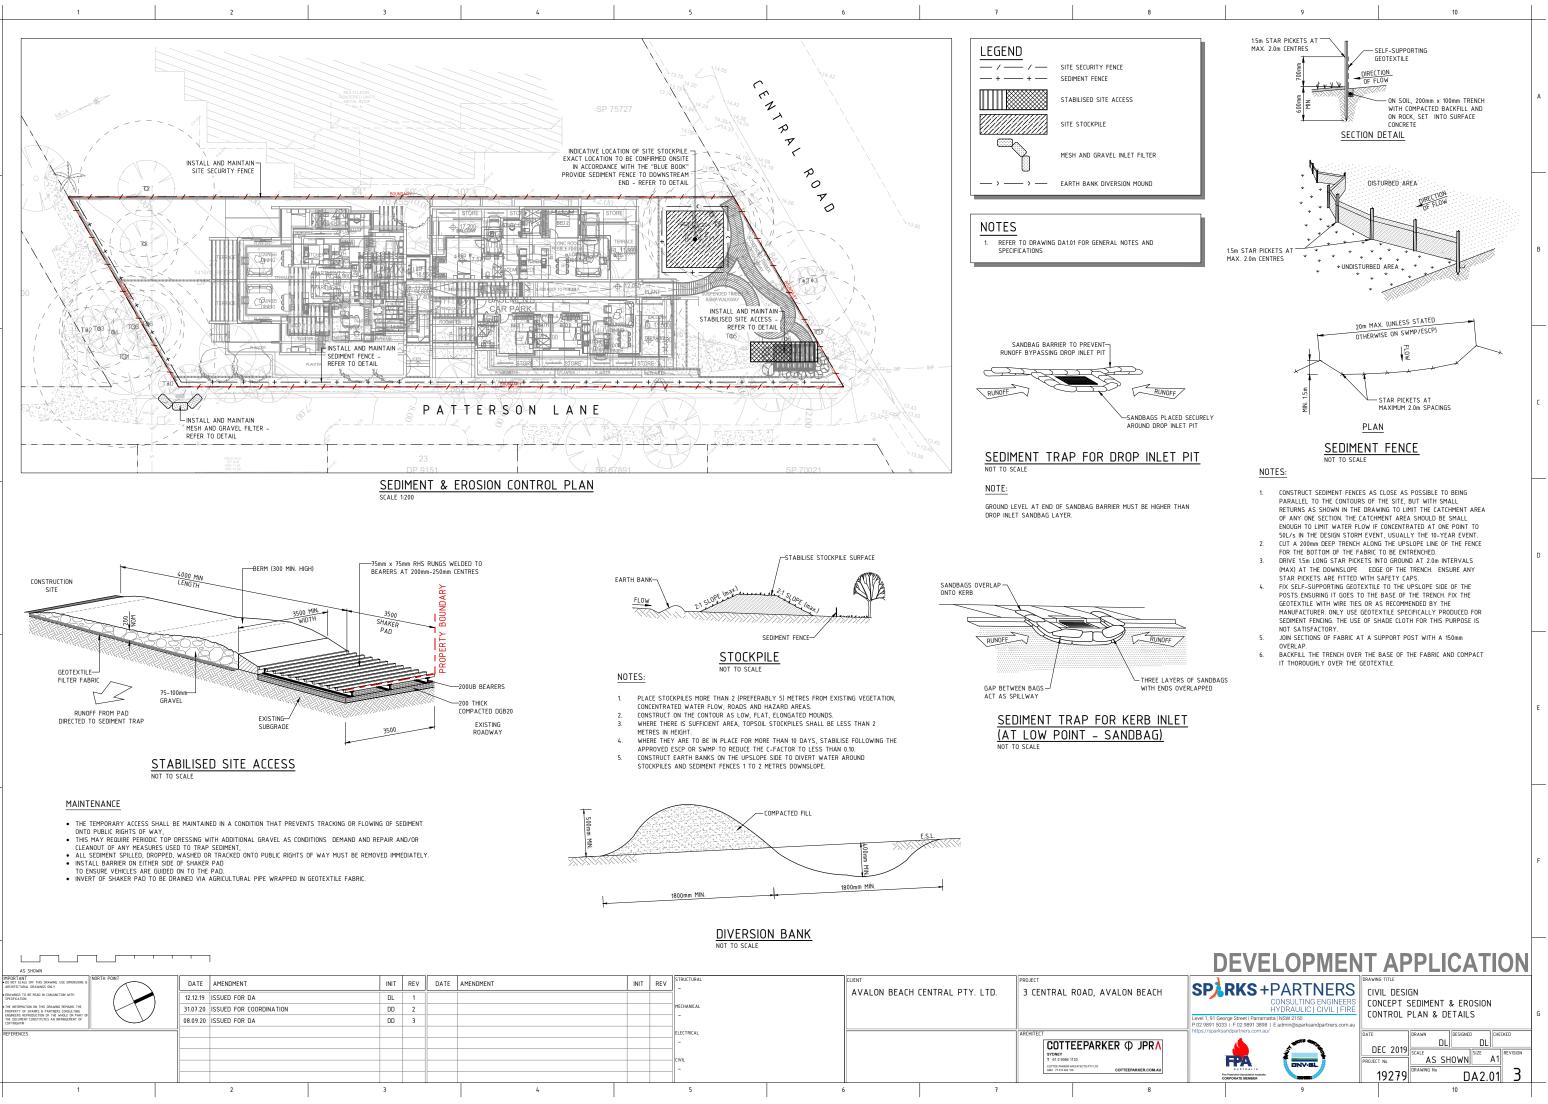

	AS SHOWN												
	<ul> <li>D0 N0T SCALE OFF THIS DRAWING. USE DIMENSIONS &amp; ARCHITECTURAL DRAWINGS ONLY</li> </ul>	NORTH POINT	DATE	AMENDMENT	INIT	REV	DATE	AMENDMENT	INIT	REV	STRUCTURAL		PROJECT
	DRAWINGS TO BE READ IN CONJUNCTION WITH     SPECIFICATION.		12.12.19	ISSUED FOR DA	DL	1						AVALON BEACH CENTRAL PTY. LTD.	3 CENTRAL ROAD, AVALON BEAC
-	<ul> <li>THE INFORMATION ON THIS DRAWING REMAINS THE PROPERTY OF SPARKS &amp; PARTNERS CONSULTING ENGINEERS REPRODUCTION OF THE WHOLE OR PART OF THE DOLUMENT CONSTITUTES AN INFRINGEMENT OF COPYRIGHT@</li> </ul>		31.07.20	ISSUED FOR COORDINATION	DD	2					MECHANICAL		
G	THE DOCUMENT CONSTITUTES AN INFRINGEMENT OF COPYRIGHT®		08.09.20	ISSUED FOR DA	DD	3					-		
	REFERENCES										ELECTRICAL		ARCHITECT
				-							-		COTTEEPARKER (D) JPR
											CIVIL		SYDNEY T 612 9366 1133
											-		COTTEE PARKER ARCHITECTS PTY LTD ABIN 77 010 594 108 COTTEEPARKER.COM.A

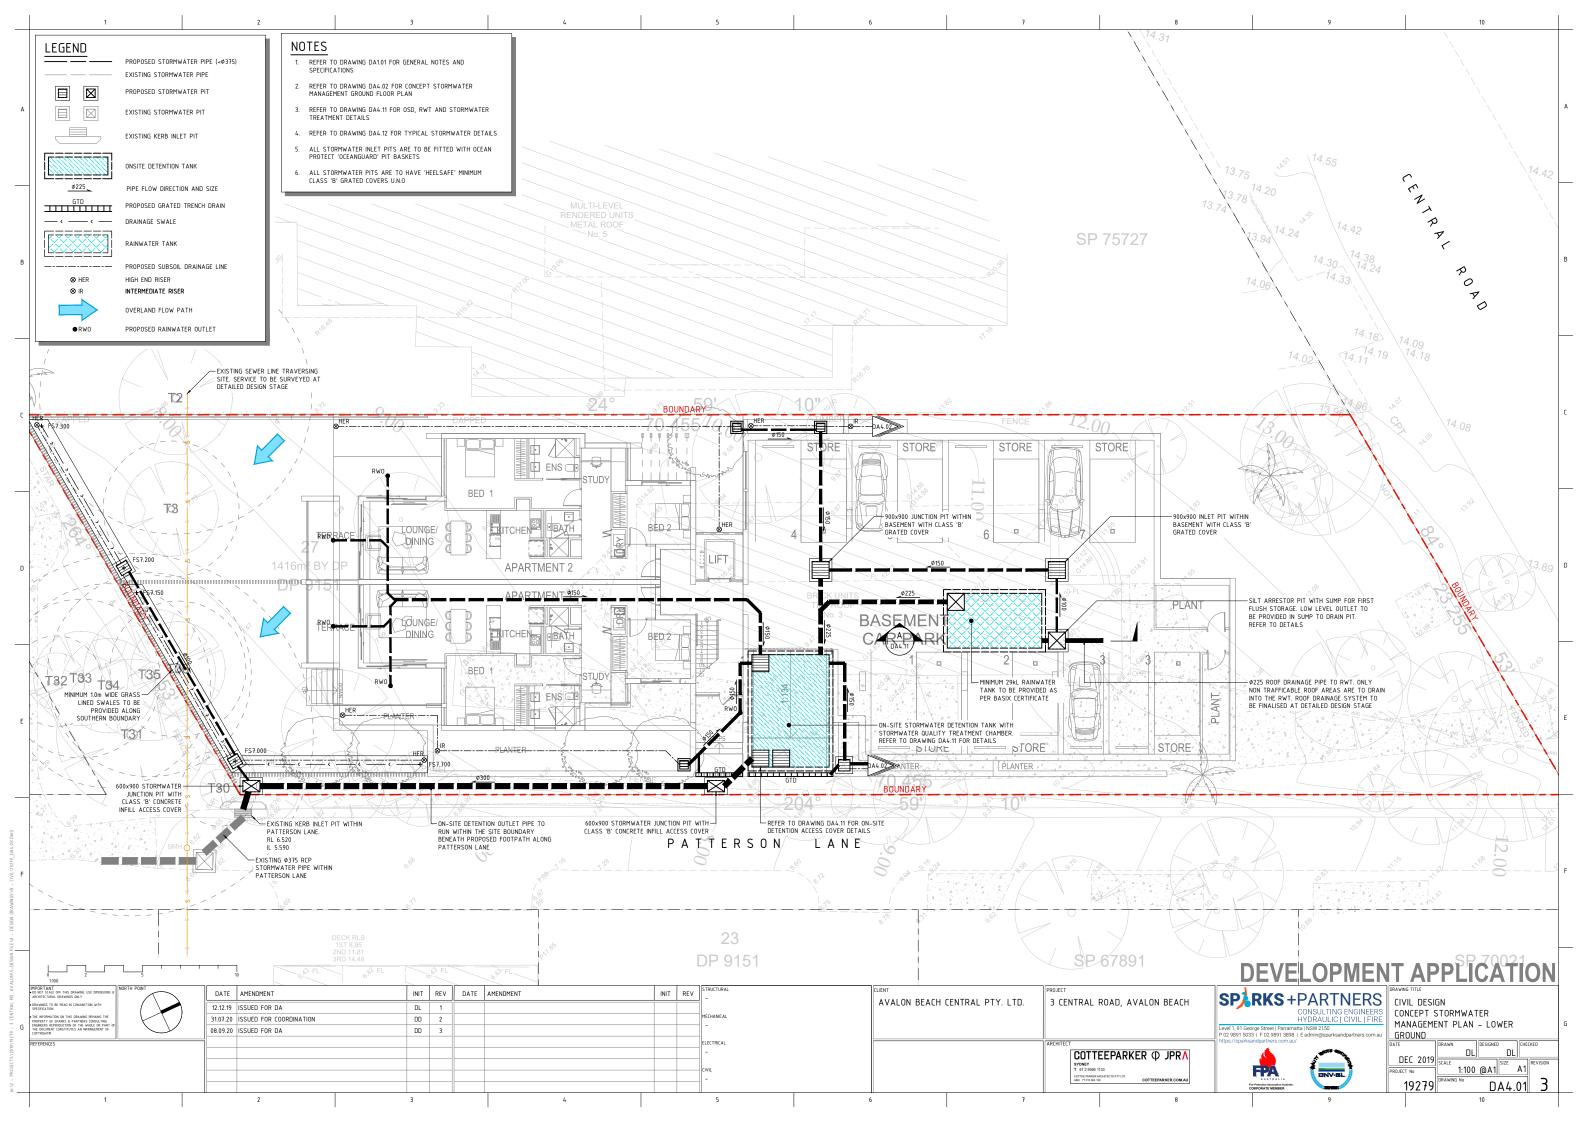

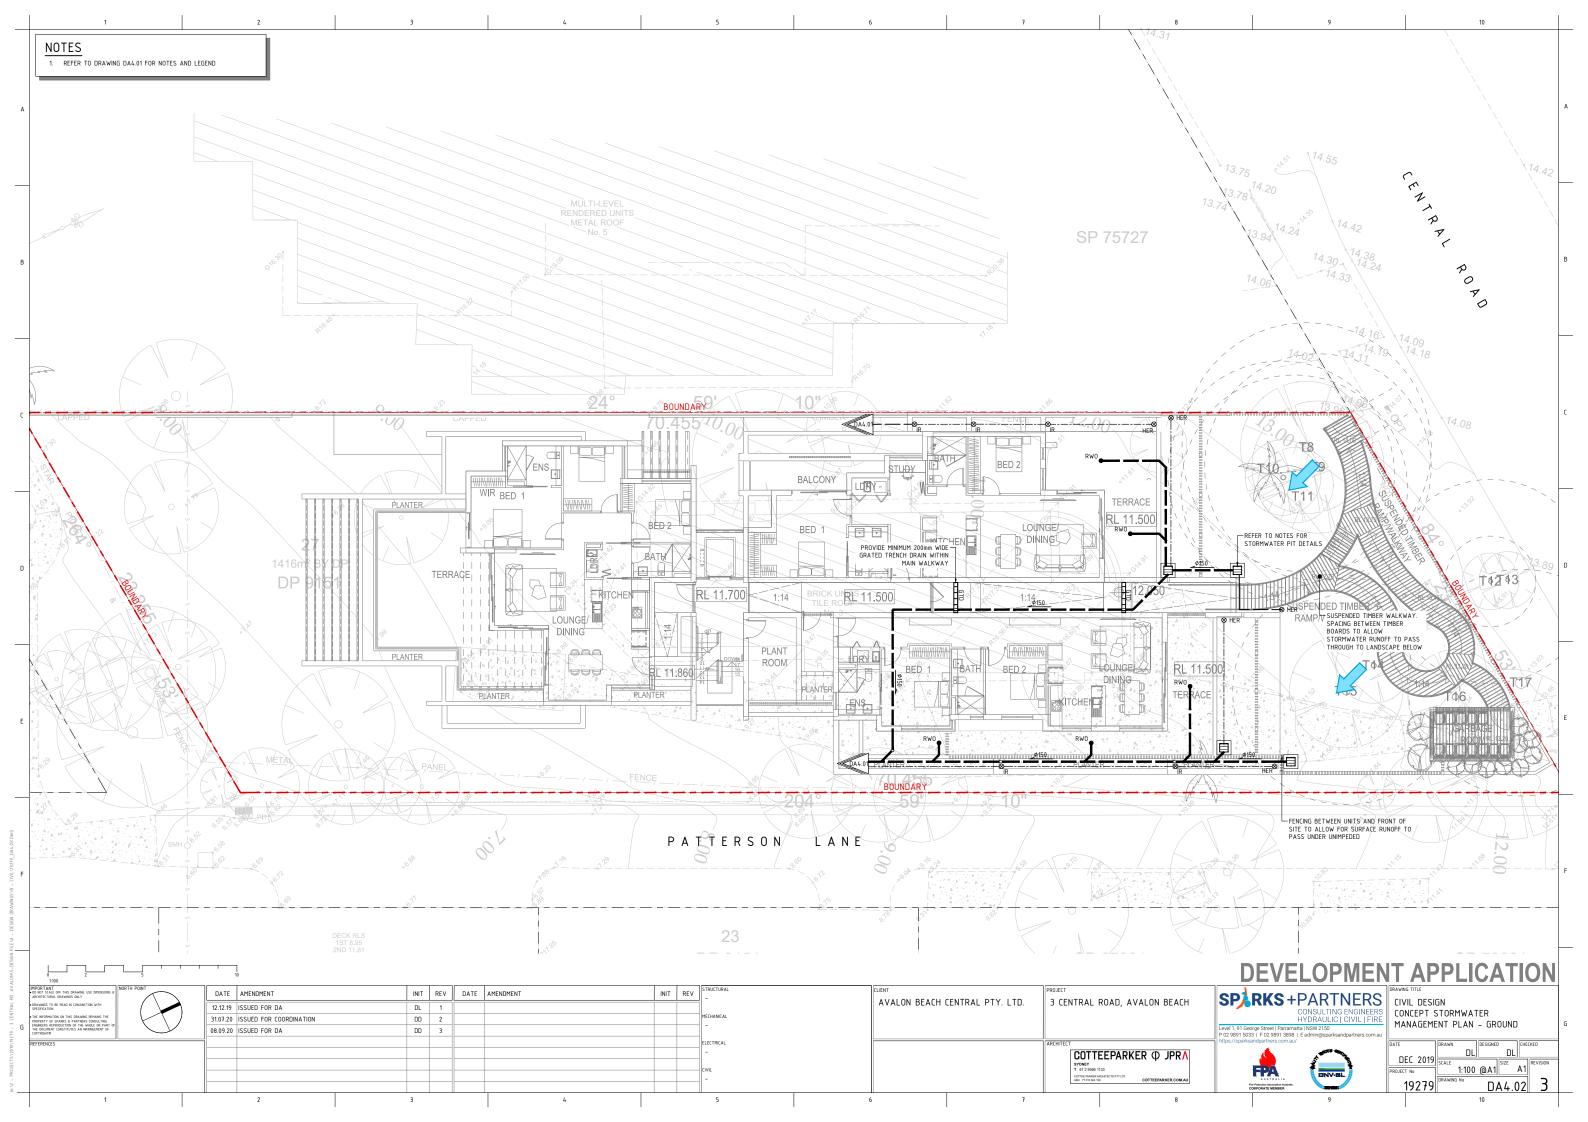



		9		10	
LEGE	<u>END</u>	IMPERVIOUS CATCHMENT AREA TO	0.050 =		
		476m <sup>2</sup> PERVIOUS CATCHMENT AREA TO ( 404m <sup>2</sup>	DSD =		
		NON TRAFFICABLE ROOF CATCHME TO RWT = 256m <sup>2</sup> IMPERVIOUS BYPASS CATCHMENT			A
		67m <sup>2</sup> PERVIOUS BYPASS CATCHMENT A 214m <sup>2</sup>	REA =		
		TOTAL AREA = 1,417m <sup>2</sup>			

### NOTES

1. REFER TO DRAWING DA1.01 FOR GENERAL NOTES AND SPECIFICATIONS

### LEGEND



EXISTING IMPERVIOUS CATCHMENT AREA = 218m<sup>2</sup> EXISTING PERVIOUS CATCHMENT AREA = EXISTING ROOF CATCHMENT AREA = 239m<sup>2</sup>


TOTAL AREA =  $1,417m^2$ 


## **DEVELOPMENT APPLICATION**



CIVIL DESIGN CONCEPT STORMWATER CATCHMENT PLAN

								1
Έ		DRAWN		DESIGNED	)	CHE	CKED	1
וח	EC 2019		DL	L	DL			
		SCALE	1:200	Q 1 1	SIZE	۸ 1	REVISION	L
ITEC.	Γ No		1:200	ωAΙ		ЧI		
	19279	DRAWIN	G No	D	A4.′	10	3	
				10				[

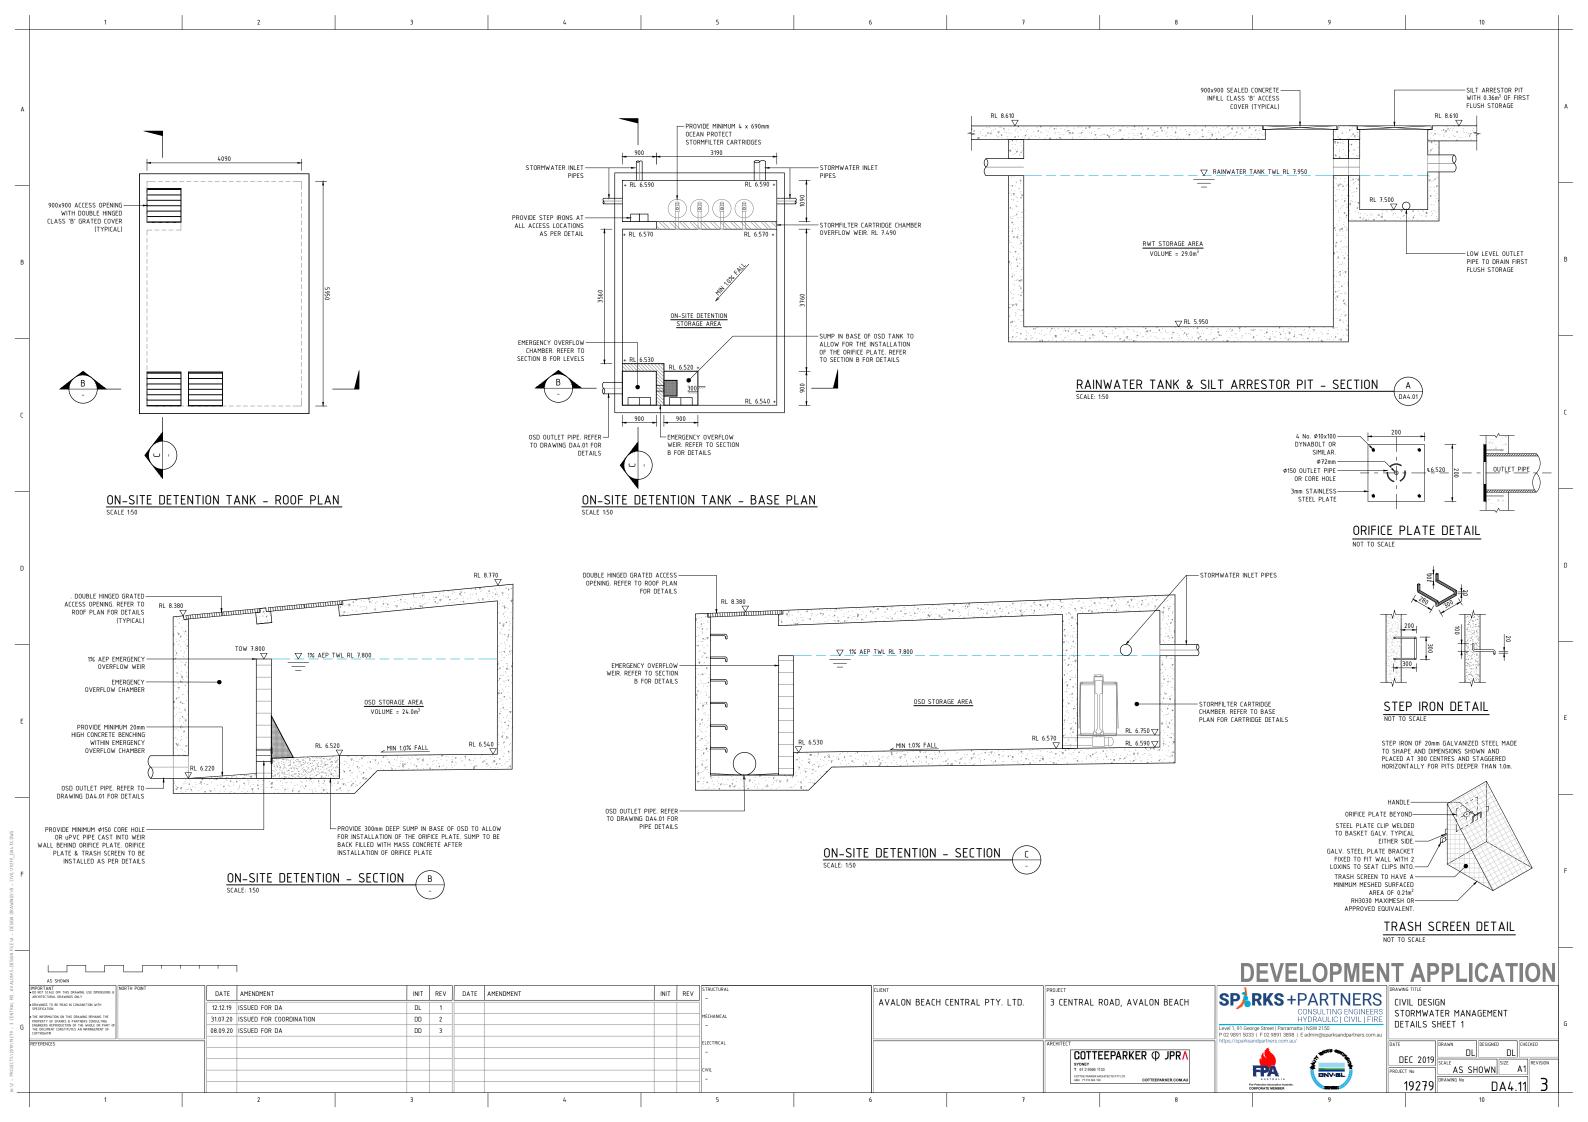

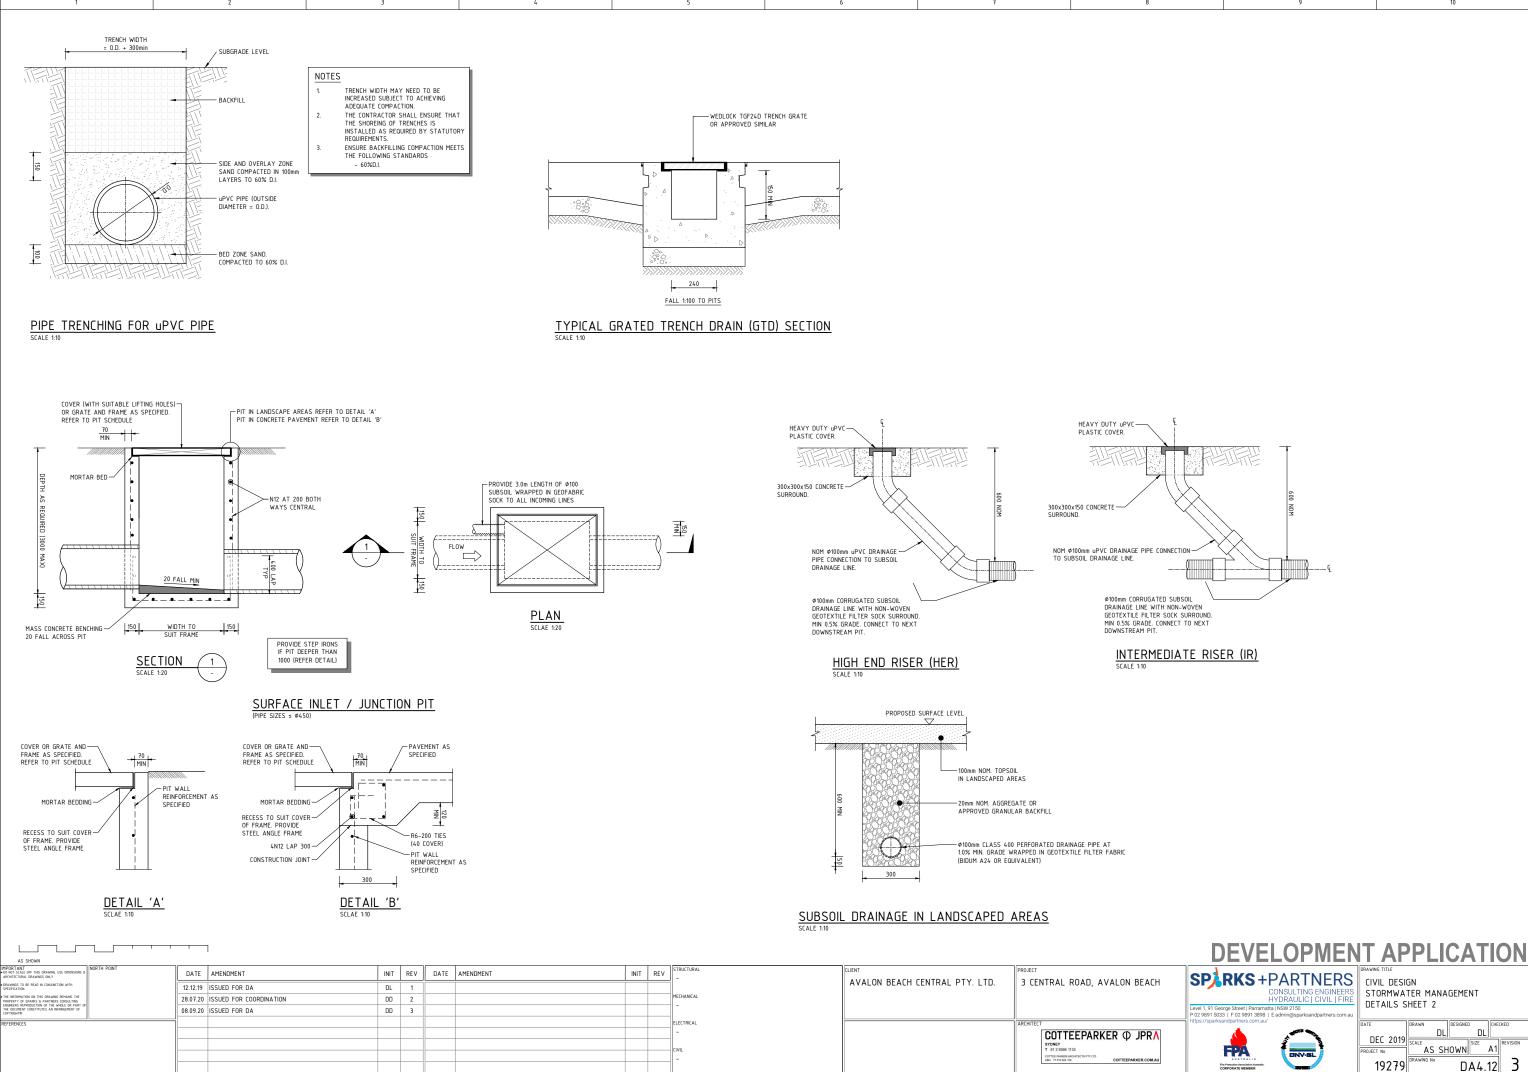

TE			DRAWN	DESIGNED		CHEC	KED
	~	2040	DL		DL		
DE	L	2019	SCALE		SIZE		REVISION
OJECT I	No		AS SH	IOWN		A1	
1	92	279	DRAWING No	DA	<b>4</b> 4.	12	3
				10			



### **APPENDIX B. GEOTECHINICAL REPORT**

#### GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER FORM NO. 1 – To be submitted with Development Application

Name of Applicant	Application for	Development Appli
Address of site3 Central Road, Avalon, NSW	∋ <u>3 Cer</u>	Address of site

#### Declaration made by geotechnical engineer or engineering geologist or coastal engineer (where applicable) as part of a geotechnical report

IDaniel Bliss	on behalf of	JK Geotechnics Pty Ltd
(Insert Name)		(Trading or Company Name)

27 November 2019 certify that I am a geotechnical engineer or engineering geologist or coastal engineer as on this the defined by the Geotechnical Risk Management Policy for Pittwater - 2009 and I am authorised by the above organisation/company to issue this document and to certify that the organisation/company has a current professional indemnity policy of at least \$2million. we/l have:

#### Please mark appropriate box

- $\square$ Prepared the detailed Geotechnical Report referenced below in accordance with the Australia Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- $\mathbf{\nabla}$ + Are/am willing to technically verify that the detailed Geotechnical Report referenced below has been prepared in accordance with the Australian Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- $\square$ Have examined the site and the proposed development in detail and have carried out a risk assessment in accordance with Section 6.0 of the Geotechnical Risk Management Policy for Pittwater - 2009. We/I confirm that the results of the risk assessment for the proposed development are in compliance with the Geotechnical Risk Management Policy for Pittwater - 2009 and further detailed geotechnical reporting is not required for the subject site.
- Have examined the site and the proposed development/alteration in detail and are/am of the opinion that the Development Application only involves Minor Development/Alterations that do not require a Detailed Geotechnical Risk Assessment and hence my/our report is in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009 requirements for Minor Development/Alterations.
- $\square$ Provided the coastal process and coastal forces analysis for inclusion in the Geotechnical Report

#### **Geotechnical Report Details:**

Report Title: Geotechnical Investigation and Assessment for Proposed Independent Living Units at 3 Central Road, Avalon, NSW

Report Date: Thomas Clent/Daniel Bliss Author:

Signature

Report Ref No: 32781BCrpt

Author's Company/Organisation: JK Geotechnics Pty Ltd

#### Documentation which relate to or are relied upon in report preparation:

27 November 2019

See text of report

Lam We are aware that the above Geotechnical Report, prepared for the abovementioned site is to be submitted in support of a Development Application for this site and will be relied on by Pittwater Council as the basis for ensuring confirming that the Geotechnical Risk Management aspects of the proposed development have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk, as discussed in the Report.

Alias

Name	Daniel Bliss
Chartered Professional Status	MIEAust; CPEng
Membership No.	969495
Company:	JK Geotechnics Pty Ltd

### GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER FORM NO. 1(a) - Checklist of Requirements For Geotechnical Risk Management Report for


Development Application				
Development Application for Avalon Central Pty Ltd				
Name of Applicant				
Address of site3 Central Road, Avalon, NSW The following checklist covers the minimum requirements to be addressed in a Geotechnical Risk Management Geotechnical Rep	ort.			
This checklist is to accompany the Geotechnical Report and its certification (Form No. 1).	0/1.			
Geotechnical Report Details:				
Report Title: Geotechnical Investigation and Assessment for Proposed Independent Living Units at 3 Central				
Road, Avalon, NSW				
Report Date:27 November 2019Report Ref No:32781BCrpt				
Author: Thomas Clent/Daniel Bliss				
Author's Company/Organisation: JK Geotechnics Pty Ltd				
Please mark appropriate box				
Comprehensive site mapping conducted <u>6 November 2019</u>				
(date) (date) Mapping details presented on contoured site plan with geomorphic mapping to a minimum scale of 1:200 (as appropriate)				
Subsurface investigation required				
No Justification				
Yes Date conducted30 October 2019				
Geotechnical model developed and reported as an inferred subsurface type-section				
Geotechnical hazards identified				
$\blacksquare$ Above the site				
☑ On the site				
☑ Below the site				
☑ Beside the site				
Geotechnical hazards described and reported				
Risk assessment conducted in accordance with the Geotechnical Risk Management Policy for Pittwater – 2009				
Consequence analysis				
Frequency analysis				
Risk calculation				
Risk assessment for property conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009				
Risk assessment for loss of life conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009				
Assessed risks have been compared to "Acceptable Risk Management" criteria as defined in the Geotechnical Risk Managen Policy for Pittwater - 2009	ent			
Opinion has been provided that the design can achieve the "Acceptable Risk Management" criteria provided that the specified				
conditions are achieved recommendations presented in the Report are adopted.				
Design Life Adopted:				
I 100 years				
Otherspecify				
Specify Geotechnical Conditions to be applied to all four phases as described in the Geotechnical Risk Management Policy for Pittwate	r -			
2009 have been specified	_			
Additional action to remove risk where reasonable and practical have been identified and included in the report.				
Risk assessment within Bushfire Asset Protection Zone.				

Ham We are aware that Pittwater Council will rely on the Geotechnical Report, to which this checklist applies, as the basis for ensuring confirming that the geotechnical risk management aspects of the proposal have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated, and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk as discussed in the Report.

> Signature Name **Chartered Professional Status** Membership No. Company

lia

**Daniel Bliss MIEAust CPEng** 969495 JK Geotechnics Pty Ltd

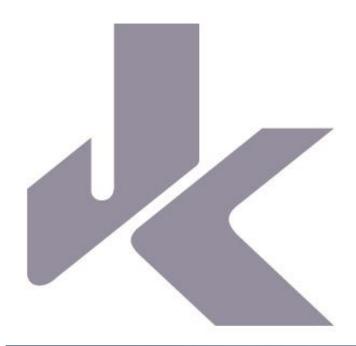

REPORT TO AVALON CENTRAL PTY LTD

ON

GEOTECHNICAL INVESTIGATION AND ASSESSMENT (In Accordance with Pittwater Council Risk Management Policy)

FOR PROPOSED INDEPENDENT LIVING UNITS

AT **3 CENTRAL ROAD, AVALON, NSW** 

Date: 27 November 2019 Ref: 32781BCrpt

## JKGeotechnics www.jkgeotechnics.com.au

T: +61 2 9888 5000 Jeffery and Katauskas Pty Ltd trading as JK Geotechnics ABN 17 003 550 801





Report prepared by:

About

Thomas Clent Senior Engineering Geologist

Report reviewed by:

Daniel Bliss Principal | Geotechnical Engineer

For and on behalf of JK GEOTECHNICS PO BOX 976 NORTH RYDE BC NSW 1670

### **DOCUMENT REVISION RECORD**

Report Reference	Report Status	Report Date
32781BCrpt Draft	Draft Report	21 November 2019
32781BCrpt	Final Report	27 November 2019

© Document copyright of JK Geotechnics

This report (which includes all attachments and annexures) has been prepared by JK Geotechnics (JKG) for its Client, and is intended for the use only by that Client.

This Report has been prepared pursuant to a contract between JKG and its Client and is therefore subject to:

- a) JKG's proposal in respect of the work covered by the Report;
- b) The limitations defined in the Client's brief to JKG;
- c) The terms of contract between JKG and the Client, including terms limiting the liability of JKG.

If the Client, or any person, provides a copy of this Report to any third party, such third party must not rely on this Report, except with the express written consent of JKG which, if given, will be deemed to be upon the same terms, conditions, restrictions and limitations as apply by virtue of (a), (b), and (c) above.

Any third party who seeks to rely on this Report without the express written consent of JKG does so entirely at their own risk and to the fullest extent permitted by law, JKG accepts no liability whatsoever, in respect of any loss or damage suffered by any such third party.

At the Company's discretion, JKG may send a paper copy of this report for confirmation. In the event of any discrepancy between paper and electronic versions, the paper version is to take precedence. The USER shall ascertain the accuracy and the suitability of this information for the purpose intended; reasonable effort is made at the time of assembling this information to ensure its integrity. The recipient is not authorised to modify the content of the information supplied without the prior written consent of JKG.



### **Table of Contents**

1	INTRODUCTION		
2	ASSES	SMENT METHODOLOGY	1
	2.1	Walkover Survey	1
	2.2	Subsurface Investigation	2
3	SUMMARY OF OBSERVATIONS		
4	SUBSURFACE CONDITIONS		
5	PROPOSED DEVELOPMENT		
6	COMMENTS AND RECOMMENDATIONS		
	6.1	Excavation	6
	6.2	Groundwater	6
	6.3	Retention	7
	6.4	Footings	8
	6.5	Basement Floor Slabs	9
7	GEOT	ECHNICAL SLOPE STABILITY RISK ASSESSMENT	9
	7.1	Potential Landslide Hazards	10
	7.2	Risk Analysis	10
	7.3	Risk Assessment	11
8	сомі	MENTS AND RECOMMENDATIONS IN ACCORDANCE WITH THE COUNCIL POLICY	11
	8.1	Conditions Recommended to Establish the Design Parameters	12
	8.2 Certifi	Conditions Recommended to the Detailed Design to be Undertaken for the Construction cate	12
	8.3	Conditions Recommended During the Construction Period	12
	8.4	Conditions Recommended for Ongoing Management of the Site/Structure(s)	13
9	OVER	VIEW	13

### **ATTACHMENTS**

Table A: Summary of Risk Assessment to PropertyTable B: Summary of Risk Assessment to Life

STS Table A: Moisture Content, Atterberg Limits & Linear Shrinkage Test Report

- Envirolab Services Certificate of Analysis No. 229778
- Borehole Logs 1 to 4 Inclusive
- Figure 1: Site Location Plan
- Figure 2: Geotechnical Sketch Plan



Figure 3: Geotechnical Cross Section Figure 4: Geotechnical Mapping Symbols Report Explanation Notes Appendix A:Landslide Risk Management Terminology Appendix B: Some Guidelines For Hillside Construction

## **JK**Geotechnics



### **1** INTRODUCTION

This report presents the results of our geotechnical investigation and geotechnical slope stability risk assessment for the proposed independent living units at 3 Central Road, Avalon, NSW. The location of the site is shown in Figure 1. The assessment was commissioned by Mr. Wei Huang of Avalon Central Pty Ltd by signed 'Acceptance of Proposal' form dated 22 October 2019. The commission was on the basis of our fee proposal (Ref. P50315B) dated 17 September 2019.

Details of the proposed development are presented in Section 5 below. In summary, however, it is proposed to demolish the existing two storey residential apartment building and construct a residential development within two buildings each with two above ground levels, over a single basement/lower ground car park levels. Excavations for the proposed car parks will require cuts into the existing hillside to a maximum depth of about 3m.

This report has been prepared in accordance with the requirements of the Geotechnical Risk Management Policy for Pittwater (2009) as discussed in Section 7 below. It is understood that the report will be submitted to Council as part of the DA documentation. Our report is preceded by the completed Council Forms 1 and 1a.

This geotechnical investigation was carried out in conjunction with an acid sulfate soil assessment by our environmental division, JK Environments (JKE). Reference should be made to the separate report by JKE, Ref: E32781Brpt, for the results of the acid sulfate soil assessment.

### 2 ASSESSMENT METHODOLOGY

### 2.1 Walkover Survey

The slope stability risk assessment is based upon a detailed inspection of the topographic, surface drainage and geological conditions of the site and its immediate environs by our Senior Engineering Geologist, Mr Thomas Clent, who visited the site on 6 November 2019. These features were compared to those of other similar lots in neighbouring locations to provide a comparative basis for assessing the risk of instability affecting the proposed development. The attached Appendix A defines the terminology adopted for the risk assessment together with a flowchart illustrating the Risk Management Process based on the guidelines given in AGS 2007c (Reference 1).

A summary of our observations is presented in Section 3 below. Our specific recommendations regarding the proposed development are discussed in Sections 6 and 8, with our geotechnical slope stability risk assessment provided in Section 7.

The attached Figure 2 presents a geotechnical sketch plan showing the principal geotechnical features present at the site. Figure 2 is based on the survey plan by Intrax Consulting Group (Drawing No.125698\_SU\_2019-05-09 DE dated 9 May 2019). Additional features on Figure 2 have been measured by





hand held inclinometer and tape measure techniques and hence are only approximate. Should any of the features be critical to the proposed development, we recommend they be located more accurately using instrument survey techniques. Figure 3 presents a typical cross-section through the site based on the survey data augmented by our mapping observations. Figure 4 defines the mapping symbols used.

### 2.2 Subsurface Investigation

The subsurface investigation was carried out on 30 October 2019 and comprised the spiral auger drilling of four boreholes (BH1 to BH4) using our track-mounted JK205 drill rig to depths ranging from 5m to 9m below the existing ground surface.

The borehole locations, as shown on Figure 2, were set out by taped measurements from existing surface features. The approximate surface levels, as shown on the borehole logs, were estimated by interpolation between spot levels shown on the supplied survey plans by Intrax Consulting Group. The datum of the levels is Australian Height datum (AHD).

The relative density and strength of the subsurface soils was assessed from Standard Penetration Test (SPT) 'N' values, augmented by hand penetrometer test results on cohesive samples returned by the SPT split tube sampler. The strength of the underlying weathered bedrock profile was assessed by observation of the drilling resistance of the Tungsten Carbide (TC) bit attached to the augers, together with inspection of the recovered rock chip samples and subsequent correlations with laboratory moisture content test results.

Groundwater observations were made in the boreholes during and on completion of drilling. Groundwater monitoring wells were installed in BH2 and BH4 on completion and a return visit was made to the site 7 days after installation (on 6 November 2019) to measure the groundwater levels. No longer term monitoring of groundwater levels was carried out.

The fieldwork was completed in the full-time presence of our Geotechnical Engineer, Mr Arthur Kourtesis, who set out the boreholes, nominated the sampling and testing locations and prepared logs of the strata encountered. The borehole logs, which include field test results and groundwater observations, are attached to this report, together with a set of Report Explanation Notes, which describe the investigation techniques, and their limitations, and define the logging terms and symbols used.

Selected samples were returned to Soil Test Services Pty Ltd (STS) and Envirolab Services Pty Ltd, both NATA accredited laboratories, for testing to determine moisture contents, Atterberg Limits, linear shrinkages, pH, chloride content, sulphate content and resistivity values. The results of the laboratory testing are presented in the attached STS Table A and Envirolab Services Pty Ltd Certificate of Analysis 229778. Samples were also collected from the boreholes for testing as part of the acid sulfate soil assessment by JKE.



### **3** SUMMARY OF OBSERVATIONS

We recommend that the summary of observations which follows be read in conjunction with the attached Figure 2.

The site is located on a southerly facing hillside with grades ranging from 2° to 5°. The site falls from about RL13m in the north-western corner down to about RL7.3m in the south-eastern corner. The site is bounded by Central Road to the north and Patterson Lane to the east. Generally, the ground surface of the property along Central Road is approximately 1m lower than the street levels, with a vegetated batter sloping at a maximum of about 20° down to the property from the road. Central Road appears have been formed by cutting into the slope.

The site contains a two-storey brick residential apartment building located centrally within the site. The building appeared to be in fair external condition, with some minor cracking observed within the brick work. Lawns are present to the north, south and west of the building with a concrete paved driveway on the eastern side of the building providing access from Central Road to the rear of the building and a car port. A second car port is attached to the eastern side of the building. The driveway initially slopes at about 20° down from the road, and then within the site generally slopes at about 5° down to the south. The car port structures appeared to be in good condition.

The lawn on the southern side of the building has a slightly hummocky appearance and medium to large trees are located on the site boundaries. The surrounding driveways and footpaths appeared to be in fair condition with some minor cracking observed. On the western side of the building are a series of timber sleepers up to 0.2m in height retaining relatively level lawn areas as terraces down the slope. The lawn areas to the north and south of the building slope down towards the south at about 5°.

Towards the southern boundary of the site the hillside flattens to about 1° to 2° down to the south. Immediately beyond the southern boundary is a concrete footpath and then a park, which continues to slope at about 1° to 2° down to the south.

Along the eastern boundary is Paterson Lane which slopes initially at about 15° down from Central Road and then reduces to about 10° for the majority of the boundary and flattens again to about 2° at the southern end. The southern half of the boundary is supported by a brick retaining wall with a maximum height of 1.2m, as shown on Figure 2. The wall generally appeared to be in fair condition, with some evidence of outward leaning observed. The remaining portion of the eastern boundary comprised a lightly vegetated batter inclined at about 15° to 30° down towards Patterson Lane. On the eastern side of Patterson Lane are several residential unit buildings of one to four stories.

The property to the west of the site contains a two-storey residential apartment building set back about 1m to 2m from the common boundary, with at least one level of basement car parking. Along the northern end of the western boundary is a timber retaining wall with an approximate height of between 0.5m and 1m, which retains the neighbouring driveway. To the south of the timber wall a 0.6m to 1m high masonry sandstone block retaining wall located just inside the adjoining property retains the subject site as the adjoining driveway slopes down into the basement below the adjoining building. At the base of the timber wall and from the top of the masonry wall the ground surface within the subject site slopes down into the





site at about 5° to 20°. The walls appeared to be in good condition based on a cursory inspection. The surface levels across the remaining portion of the western boundary appeared to be fairly similar, although due to a high fence and access restrictions this cannot be confirmed.

### 4 SUBSURFACE CONDITIONS

Reference to the Sydney 1:100,000 Geological Series Sheet indicates that the site is located within an area mapped to be underlain by the Newport Formation of the Narrabeen Group. The boreholes disclosed a subsurface profile of shallow fill, underlain by alluvial sands over residual clays grading into siltstone bedrock of generally poor quality. Further comments on the subsurface conditions encountered are provided below. Reference should be made to the borehole logs for detailed descriptions of the subsurface conditions encountered. The results are also summarised within the section given as Figure 3.

### Fill

Fill was encountered in all boreholes to depths ranging from 0.2m to 0.5m. The fill comprised silty sand and silty clay with a trace root fibres.

### **Alluvial Soils**

Alluvial soil comprising silty sand and sand was encountered below the fill to in all boreholes and extended to depths ranging from 0.5m to 1.0m. Based on the SPT 'N' values, the sandy soils were assessed to be of loose relative density.

### **Residual Soils**

The residual sandy clay was assessed to be of low plasticity and the residual silty clay was assessed to be of high plasticity. The clays were generally of very stiff to hard strength, but in BH3 the upper silty sandy clay was assessed to be of stiff strength.

### Weathered Siltstone

Weathered siltstone was encountered at depths ranging from 3.3m to 6m, with the level of the surface of the rock falling down towards the south from about RL9.4m in BH4 to about RL2.6 in BH1. The siltstone was assessed to be extremely weathered and of hard strength, but in BH4 contained higher strength sandstone bands.

#### Groundwater

Groundwater seepage was not encountered during auger drilling of the boreholes, which were dry on completion of auger drilling. Groundwater monitoring wells were installed in BH2 and BH4 to depths of 6.3m and 6.0m, respectively. The groundwater within the wells was allowed to stabilise over 7 days and a return visit was made to site on the 6 November 2019, with groundwater measured at a depth of 3.3m (RL4.8m) in BH2 and BH4 was dry to the well depth of 6m.



### Laboratory Test Results

Based on the Atterberg limits and linear shrinkage test results the residual silty sandy clay tested from BH1 is of low plasticity and is assessed to have a moderate potential to shrink/swell movements with changes in moisture content. The silty clay tested from BH4 is of high plasticity and is assessed to have a high potential for shrink/swell movements with changes in moisture content. The moisture content test results showed reasonably good correlation with our field assessment of rock strength.

The pH values on samples of the alluvial sand, residual silty clay and weathered bedrock were 7.0, 5.6 and 5.0, respectively, indicating slightly acidic conditions. The sulphate contents ranged from <10mg/kg to 20mg/kg, the chloride contents ranged from 10mg/kg to 20mg/kg and the resistivity ranged from 23000ohm.cm to 30000ohm.cm. Based on these results, the alluvial sand, residual silty clay and weathered bedrock would be classified as 'mild' exposure classification for concrete piles in accordance with Table 6.4.2(C) of AS2159-2009 'Piling – Design and Installation' and 'non-aggressive' exposure classification for steel piles in accordance with Table 6.5.2(C) of AS2159-2009.

### 5 PROPOSED DEVELOPMENT

We have been provided with the following information:

- Survey plan by Intrax Consulting Group, Drawing No.125698\_SU\_2019-05-09 DE, dated 9 May 2019.
- Architectural drawings by Cottee Parker Architects Pty Ltd, Reference 5914, Dwg Nos: SK2007 to SK2011, SK2801 to SK2808, SK3001 to SK3003, SK3101 and SK3102, Issue A, dated 25/11/2019.

From review of the supplied drawings, we understand that following demolition of the existing structures on site the proposed development will comprise the construction of two residential buildings each with two above ground levels over single basement/lower ground car park levels. The basement/lower ground levels will be accessible from Patterson Lane on the eastern side of the site and will step down the hillside slope. The lower ground floor level of the northern building is proposed at RL10.2m and will require excavation ranging from about 0m at the southern end to a maximum of about 2.5m in the north-western corner. The basement level of the southern building is proposed at RL7.1m and will require excavation ranging from about 0.5m in the south-eastern corner to a maximum about 3m in the north-western corner.

Landscaping will be carried out externally to form private courtyards and communal spaces outside of the proposed buildings. The existing retaining wall and batters on the eastern boundary will be removed to allow construction of the entries to the basement and lower ground floor levels and we have assumed that any resulting changes in levels will be supported by new retaining walls. It is unknown if the retaining walls along the western boundary will be left in place or replaced, but we expect that the masonry wall within the adjoining property will remain and the timber wall may or may not be replaced.



### **6** COMMENTS AND RECOMMENDATIONS

### 6.1 Excavation

Prior to the start of demolition and excavation a dilapidation survey should be completed on at least the adjoining property to the west of the site. The dilapidation surveys should comprise a detailed inspection of the adjoining property, both externally and internally, with all defects rigorously described, i.e. defect type, defect location, crack width, crack length, etc. The respective owners of the adjoining property should be asked to confirm that the dilapidation report represents a fair record of actual conditions as the report can be used to assess claims for damage following completion of the works. Consideration could also be given to completing dilapidation surveys on the buildings on the eastern side of Patterson Lane as these reports can help to guard against opportunistic claims for damage that was present prior to the start of work.

Excavation to achieve the proposed basement and lower ground floor levels will be required to maximum depths of about 3m. We expect that such excavations will encounter predominantly alluvial and residual soils, with extremely weathered siltstone within the base of the deepest excavations.

All excavations must be completed with care so as not to damage or destabilise the neighbouring surface levels, particularly on the western boundary of the site where retaining walls are present (if these are to remain).

Excavation of the soils and extremely weathered rock should be achievable using conventional excavation equipment, such as the buckets of hydraulic excavators.

### 6.2 Groundwater

No groundwater seepage was encountered during auger drilling of the boreholes and was measured within the monitoring well BH2 at RL4.8m, which is approximately 2.3m below the proposed basement excavation level in this area. The measure groundwater is likely to represent flow across the soil/rock interface and through joints and bedding partings within the rock, particularly since no groundwater was measured within the well in BH4, which extended to a depth of 6m.

We do not consider that groundwater will be a significant issue for the proposed development, but some seepage may occur during and following rainfall. Any such seepage generally tends to occur at the soil/rock interface, but could also occur at the interface between the more permeable alluvial sands and the underlying residual clays. Any seepage that does occur should be able to be controlled during construction using gravity drainage and conventional sump and pump techniques. In the long term, drainage should be provided behind the retaining walls and possibly below the basement floor slabs. The completed excavation should be inspected by the hydraulic consultant to confirm that the designed drainage system is adequate for the actual seepage flows.



### 6.3 Retention

Given the offset of the proposed excavations from the western and eastern boundaries insufficient space would be available for temporary batters and full depth retention systems will need to be installed prior to the start of excavation. Temporary batters could potentially be used on the northern side of the excavations, or where excavations are shallow, but it may be more practical to extend the retention system around the full perimeter of the proposed excavation.

The most appropriate retention system is difficult to judge due to the variable soils comprising upper sandy soils over the lower clays. The use of soldier pile walls with shotcrete infill panels may be feasible, depending on the ability of the upper sandy soils to remain in place following excavation to allow placement of the shotcrete. If such walls are to be attempted, we recommend that trial excavations be are carried out to assess if the upper sandy soils will hold up. Given the shallow depth of these sandy soils, encountered to depths of 0.5m to 1m in the boreholes, they may be able to be battered at the surface to allow construction of solider pile walls for the deeper more clayey soils, but the soldier piles may need to be at a closer spacing than they otherwise would be. If the sandy profile is unable stand up once excavated then the retention system would need to comprise contiguous pile walls. Even if the sandy soils stand sufficiently to allow construction of soldier pile walls, where movements are to be kept low contiguous pile walls should be used in order to limit deflections.

Again, due to the sandy soils bored piers may not be suitable and the sands may collapse. If such piles are proposed trial piers should be drilled to assess difficulties that may be encountered and the use of temporary liners within the upper sandy soil may be required. Alternatively, auger, grout injected (CFA) piles may be used. Where contiguous piles are adopted, the gaps between the piles must be progressively dry packed to prevent the loss of the upper alluvial sand from between the piles. It is important that this is progressively completed and that the builder does not wait until the excavation is completed before dry packing. If granular soil is lost from between the piles, settlement will be induced behind the wall that may in turn lead to damage to structures present behind the walls.

The proposed new retaining walls should be designed using the following parameters:

- For cantilever walls retaining no more than about 3m in height, adopt a triangular lateral earth pressure distribution and an 'active' earth pressure coefficient, K<sub>a</sub>, of 0.3, for the retained height, assuming a horizontal backfill surface. This assumes that some resulting movement behind the wall is acceptable.
- Where movements are to be kept low, such as where adjacent buildings or services are located within a horizontal distance from the wall of twice the retained height, an 'at rest' earth pressure coefficient, K<sub>0</sub>, of 0.6 should be used, assuming a horizontal backfill surface.
- A bulk unit weight of 20kN/m<sup>3</sup> should be adopted for the soil profile.
- Any surcharge affecting the walls (e.g. traffic loading, live loading, compaction stresses, etc) should be allowed in the design. This included where new walls are construction in front of the western boundary walls if these are to remain.



- The retaining walls should be provided with complete and permanent drainage of the ground behind the walls. The subsoil drains should incorporate a non-woven geotextile fabric (eg. Bidim A34), to act as a filter against subsoil erosion.
- For the design of the required embedment depth, a coefficient of passive earth pressure, k<sub>p</sub>, of 3 may be adopted. However, due to the significant displacements required to mobilise this earth pressure coefficient we recommend that a factor of safety of 2 be adopted. Care must be taken to consider the potential impact of temporary and localised excavations in front of retaining walls. In this regard the design embedment length must not start until the piles extends below all excavations (including localised and temporary) in front of the wall.
- Piles socketed into siltstone below the bulk excavation level maybe designed for an allowable lateral resistance of 100kPa for extremely weathered rock. The passive resistance should be ignored for at least 0.5m below the base of the excavation, including footing and service excavations.

For shallow cuts away from the boundaries, temporary batters no higher than 3m should be no steeper than 1 Vertical in 1 Horizontal (1V:1H). Such batters should remain stable in the short term, provided all surcharge loads, including construction loads, are be kept well clear of the crest of the batters. Permanent batters should be no steeper than 1V:2H, but flatter batters of the order of 1V:3H may be preferred to allow access for maintenance of vegetation. Permanent batters should be covered with topsoil and planted with a deeprooted runner grass, or other suitable coverings, to reduce erosion. All stormwater runoff should be directed away from all temporary and permanent batters to also reduce erosion.

Any landscaping retaining walls constructed over the proposed basement and lower ground floor levels should be supported on the floor/roof slab over the basement or lower ground floor levels. The use of separate footings for such walls founded within backfill over the basement is not recommended as the backfill will be difficult to properly compact within the limited space available. The retaining walls should be designed based on the parameters given above and the floor/roof slab over the basement designed to accommodate the surcharge loads of the walls and the required backfill. Where walls are proposed between the buildings and away for the basement backfill these maybe supported on shallow footings founded within the residual silty clays, provide the wall are structurally separate to the main building structure.

### 6.4 Footings

Following bulk excavation, we expect that extremely weathered bedrock will be encountered within the deepest cut and as such all footings should be founded within the bedrock to provide uniform support and reduce the risk of differential settlements. Where rock is encountered or is at shallow depths, pad or strip footings would be appropriate. However, where the depth to the rock is more than about 1m the use of piles may be more practical. We expect that piles will be required for the majority of the buildings.

Bored piers could be used, but some collapse of any sandy soils may be experienced requiring the use of temporary liners.



The footings should be designed based on an allowable bearing pressure of 700kPa, subject to inspection of the footing excavations and pile drilling by a geotechnical engineer prior to pouring. Higher strength rock was not encountered within the boreholes to allow the use of higher bearing pressures.

### 6.5 Basement Floor Slabs

Clayey soils are expected to be exposed at bulk excavation level for most of the excavation, with extremely weathered rock within the areas of deepest cuts. The subgrade below the basement/lower ground floor slabs should be inspected by a geotechnical engineer, who may want to proof roll the exposed subgrade to detect any weak subgrade areas. Any weak areas detected should be locally excavated and replaced with controlled engineered fill, or as directed by the geotechnical engineer.

Similarly, any areas outside of the excavation where fill is proposed should be stripped of vegetation and root affected soils and the subgrade inspected by a geotechnical engineer. Following inspection and any treatment of the subgrade engineered fill may be placed as required. Engineered fill should preferably comprise well graded granular material, such as crushed sandstone, free of deleterious materials and particles in excess of 75mm in size. Such fill should be compacted in thin layers appropriate to the compaction equipment being used and may need to be limited to 100mm loose thickness if light equipment is used. Granular fill should be compacted to a density of at least 98% of Standard Maximum Dry Density (SMDD). The excavated soils may be reused as engineered fill, but any clay fill should be compacted to a density strictly between 98% and 102% of SMDD and at moisture contents within 2% of Standard Optimum Moisture Content (SOMC). Density tests should be regularly carried out on the fill to confirm that that above specifications are achieved.

The basement floor slabs and ramps should have a sub-base layer of at least 100mm thickness of crushed rock to RMS QA specification 3051 unbound base material (or other approved good quality durable fine crushed rock) which is compacted to at least 100% of Standard Maximum Dry Density (SMDD). This layer will provide a separation between the clay subgrade and the underside of the floor slab and is also to provide uniform support for the basement slab.

As detailed in Section 6.2, drainage may be required below the basement slabs. The sub-base layer could be used as a drainage layer by the adoption of a uniform free draining material. Alternatively, a grid of subsoil drains could be used. A sump with a fail-safe pumping system should be constructed to prevent basement flooding.

### 7 GEOTECHNICAL SLOPE STABILITY RISK ASSESSMENT

The overall hillside slope is not greater than the likely angle of repose typical of the soils encountered. There are no distinct outcrops, cliff lines, watercourses and only minor surface depressions present. Generally, the slopes are well vegetated with established trees. The steepest slope on site is a 30° batter on the eastern boundary of the site, which was vegetated with grass and showed little sign of deterioration. There were no signs of slope movement. Central Road is orientated along the northern boundary of the site and marks the



crest of the slope, no tension cracking within the road surface was observed, which would indicate deeper seated instability.

There are however, several low height retaining walls along the boundaries of the site. Some of these appear to have been properly constructed, albeit perhaps not to an engineered design, and appear to be functioning adequately, while other walls comprise simple timber or brick walls and are showing signs of wear likely due to age and poor maintenance. However due to the low height of the walls any collapse would be relatively localised. In addition, most of these walls will be removed as part of the proposed development. Where walls will remain, these pose a potential hazard and may require stabilisation as part of the development.

Significant site instability within the soil cover would not be expected for the gentle slope angles recorded within and neighbouring the site.

### 7.1 Potential Landslide Hazards

We consider that the potential landslide hazards associated with the site and the proposed development to be the following:

- A Stability of Proposed Basement/Lower Ground Level Retaining Walls.
- B Stability of Existing Western Boundary Retaining Walls, if these are to remain.
- C Stability of the Hillside Slope Beneath the Proposed Development.
- D Stability of Proposed Minor Landscape Walls Between Buildings.

These potential hazards are indicated in schematic form on the attached Figures 2 and 3.

### 7.2 Risk Analysis

The attached Table A summarises our qualitative assessment of each potential landslide hazard and of the consequences to property should the landslide hazard occur. Use has been made of data in MacGregor *et al* (2007) to assist with our assessment of the likelihood of a potential hazard occurring. Based on the above, the qualitative risks to property have been determined. The terminology adopted for this qualitative assessment is in accordance with Table A1 given in Appendix A. Table A indicates that the assessed risk to property varies between "Very Low" and "Low", which would be considered 'acceptable' in accordance with the criteria given in Reference 1 and the Pittwater Council Risk Management Policy.

We have also used the indicative probabilities associated with the assessed likelihood of instability to calculate the risk to life. The temporal and vulnerability factors that have been adopted are given in the attached Table B together with the resulting risk calculation. Our assessed risk to life for the person most at risk is about  $5 \times 10^{-6}$ . This would be considered to be 'acceptable' in relation to the criteria given in Reference 1 and the Pittwater Council Risk Management Policy.



### 7.3 Risk Assessment

The Pittwater Risk Management Policy requires suitable measures 'to remove risk'. It is recognised that, due to the many complex factors that can affect a site, the subjective nature of a risk analysis, and the imprecise nature of the science of geotechnical engineering, the risk of instability for a site and/or development cannot be completely removed. It is, however, essential that risk be reduced to at least that which could be reasonably anticipated by the community in everyday life and that landowners are made aware of reasonable and practical measures available to reduce risk as far as possible. Hence, where the policy requires that 'reasonable and practical measures have been identified to remove risk', it means that there has been an active process of reducing risk, but it does not require the geotechnical engineer to warrant that risk has been completely removed, only reduced, as removing risk is not currently scientifically achievable.

Similarly, the Pittwater Risk Management Policy requires that the design project life be taken as 100 years unless otherwise justified by the applicant. This requirement provides the context within which the geotechnical risk assessment should be made. The required 100 years baseline broadly reflects the expectations of the community for the anticipated life of a residential structure and hence the timeframe to be considered when undertaking the geotechnical risk assessment and making recommendations as to the appropriateness of a development, and its design and remedial measures that should be taken to control risk. It is recognised that in a 100 year period external factors that cannot reasonably be foreseen may affect the geotechnical risks associated with a site. Hence, the Policy does not seek the geotechnical engineer to warrant the development for a 100 year period, rather to provide a professional opinion that foreseeable geotechnical risks to which the development may be subjected in that timeframe have been reasonably considered.

Our assessment of the probability of failure of existing structural elements such as retaining walls (where applicable) is based upon a visual appraisal of their type and condition at the time of our inspection. Where existing structural elements such as retaining walls will not be replaced as part of the proposed development, where appropriate we identify the time period at which reassessment of their longevity seems warranted. In preparing our recommendations given below we have adopted the above interpretations of the Risk Management Policy requirements. We have also assumed that no activities on surrounding land which may affect the risk on the subject site would be carried out. We have further assumed that all Council's buried services are, and will be regularly maintained to remain, in good condition.

We consider that our risk analysis has shown that the site and existing and proposed development can achieve the 'Acceptable Risk Management' criteria in the Pittwater Risk Management Policy provided that the recommendations given in Section 7 below are adopted. These recommendations form an integral part of the Landslide Risk Management Process.

### 8 COMMENTS AND RECOMMENDATIONS IN ACCORDANCE WITH THE COUNCIL POLICY

We consider that the proposed development may proceed provided the following specific design, construction and maintenance recommendations are adopted to maintain and reduce the present risk of



instability and to control future risk. These recommendations address issues only and other conditions may be required to address other aspects.

### 8.1 Conditions Recommended to Establish the Design Parameters

- 8.1.1 Design and construction of the proposed development is to be carried out in accordance with the recommendations provided in Section 6.
- 8.1.2 The guidelines for Hillside Construction given in Appendix B should also be adopted

# 8.2 Conditions Recommended to the Detailed Design to be Undertaken for the Construction Certificate

- 8.2.1 All structural design drawings must be reviewed by the geotechnical engineer who should endorse that the recommendations contained in this report have been adopted in principle.
- 8.2.2 All hydraulic design drawings must be reviewed by the geotechnical engineer who should endorse that the recommendations contained in this report have been adopted in principle.
- 8.2.3 All landscape design drawings must be reviewed by the geotechnical engineer who should endorse that the recommendations contained in this report have been adopted in principle.
- 8.2.4 Dilapidation surveys must be carried out on the neighbouring buildings and structures to the west. A copy of the dilapidation report must be provided to the neighbours and Council or the Principle Certifying Authority.

### 8.3 Conditions Recommended During the Construction Period

- 8.3.1 The geotechnical engineer must inspect all footing excavations prior to placing reinforcement or pouring the concrete.
- 8.3.2 Proposed material to be used for any filling must be approved by the geotechnical engineer prior to placement.
- 8.3.3 Compaction density of fill must be checked by a NATA accredited laboratory to at least Level 2 standard in accordance with, and to the frequency outlined in, AS3798, and the results submitted to the geotechnical engineer.
- 8.3.4 If they are to be retained, the existing stormwater system, sewer and water mains must be checked for leaks by using static head and pressure tests under the direction of the hydraulic engineer or architect, and repaired if found to be leaking.
- 8.3.5 The geotechnical engineer must inspect all subsurface drains prior to backfilling.
- 8.3.6 An 'as-built' drawing of all buried services at the site must be prepared (including all pipe diameters, pipe depths, pipe types, inlet pits, inspection pits, etc).



8.3.7 The geotechnical engineer must confirm that the proposed development has been completed in accordance with the geotechnical reports.

We note that all above Conditions must be complied with. Where this has not been done, it may not be possible for Form 3, which is required for the Occupation Certificate to be signed.

## 8.4 Conditions Recommended for Ongoing Management of the Site/Structure(s)

The following recommendations have been included so that the current and future owners of the subject property are aware of their responsibilities:

- 8.4.1 All proposed surface (including roofs) and subsurface drains must be subject to ongoing and regular maintenance by the property owners. In addition, such maintenance must also be carried out by a plumber at no more than ten yearly intervals; including provision of a written report confirming scope of work completed (with reference to the 'as-built' drawing) and identifying any required remedial measures.
- 8.4.2 No cut or fill in excess of 0.5m (e.g. for landscaping, buried pipes, retaining walls, etc), is to be carried out on site without prior consent from Council.
- 8.4.3 Where the structural engineer has indicated a design life of less than 100 years then the structure and/or structural elements must be inspected by a structural engineer at the end of their design life; including a written report confirming scope of work completed and identifying the required remedial measures to extend the design life over the remaining 100 year period.

### 9 OVERVIEW

We consider the proposed development may proceed at this site provided the recommendations within this report are followed.

It is possible that the subsurface soil, rock or groundwater conditions encountered during construction may be found to be different (or may be interpreted to be different) from those inferred from our surface observations in preparing this report. Also, we have not had the opportunity to observe surface run-off patterns during heavy rainfall and cannot comment directly on this aspect. If conditions appear to be at variance or cause concern for any reason, then we recommend that you immediately contact this office.

This report has been prepared for the particular project described and no responsibility is accepted for the use of any part of this report in any other context or for any other purpose. If there is any change in the proposed development described in this report then all recommendations should be reviewed. Copyright in this report is the property of JK Geotechnics. We have used a degree of care, skill and diligence normally exercised by consulting engineers in similar circumstances and locality. No other warranty expressed or implied is made or intended. Subject to payment of all fees due for the investigation, the client alone shall have a licence to use this report. The report shall not be reproduced except in full.



- Reference 1: Australian Geomechanics Society (2007c) '*Practice Note Guidelines for Landslide Risk Management*', Australian Geomechanics, Vol 42, No 1, March 2007, pp63-114.
- Reference 2: MacGregor, P, Walker, B, Fell, R, and Leventhal, A (2007) 'Assessment of Landslide Likelihood in the *Pittwater Local Government Area*', Australian Geomechanics, Vol 42, No 1, March 2007, pp183-196.



# TABLE A SUMMARY OF RISK ASSESSMENT TO PROPERTY

POTENTIAL LANDSLIDE HAZARD	А	В	С	D	
ΠΑΖΑΚΟ	Stability of Proposed Basement Retaining Walls	Stability of Existing Western Boundary Retaining Wall (if to remain)	Stability of the Hillside Slope Beneath the Proposed Development	Stability of Proposed Minor Landscape Walls Between Buildings	
Assessed Likelihood	Rare	Unlikely	Rare	Rare	
Assessed Consequence	Major	Insignificant	Medium	Minor	
Risk	Low	Very Low	Low	Very Low	
Comments	Assumes Retaining Walls will be properly engineer designed and constructed in accordance with design.	Assumes proposed retaining walls and footings do not surcharge or undermine existing wall. Care should be taken during demolition and excavation in this area.	Footings for the proposed structure will be founded on bedrock. All basement retaining walls will be properly designed shoring systems.	Assumes the walls will be properly engineer designed and constructed.	



## TABLE B SUMMARY OF RISK ASSESSMENT TO LIFE

POTENTIAL LANDSLIDE	Α	В	С	D
HAZARD	Stability of Proposed Basement Retaining Walls	Stability of Existing Western Boundary Retaining Wall (if to remain)	Stability of the Hillside Slope Beneath the Proposed Development	Stability of Proposed Minor Landscape Walls Between Buildings
Assessed Likelihood	Rare	Unlikely	Rare	Rare
Indicative Annual Probability	10 <sup>-5</sup>	10-4	10 <sup>-5</sup>	10 <sup>-5</sup>
Persons at risk	People in basements and apartments	People directly adjacent to wall	People in basements and apartments	People within the common garden areas
Duration of Use of area Affected (Temporal Probability)	Say 20hrs per day <b>0.833</b>	lay Say 15mins per week Say 20hrs per day 0.0015 0.833		Say 1hr per day <b>0.04</b>
Probability of not Evacuating Area Affected	<b>0.8</b> Warning Likely	0.8 Warning Likely	<b>0.2</b> Initial movement and cracking may be seen	<b>0.1</b> Cracking and movement likely to be seen
Vulnerability to Life if Failure Occurs Whilst Person Present	<b>0.6</b> Potential to be buried by rubble	<b>0.2</b> Potential to be partly struck by rubble	<b>0.6</b> Potential to be buried by rubble	<b>0.2</b> Potential to be partially struck by rubble
Risk for Person most at Risk	4x10 <sup>-6</sup>	2.4x10 <sup>-8</sup>	1x10 <sup>-6</sup>	8.3x10 <sup>-9</sup>
Combined total Risk for Person Most at Risk		5x:	10 <sup>-6</sup>	



### TABLE A MOISTURE CONTENT, ATTERBERG LIMIT AND LINEAR SHRINKAGE TEST REPORT

Client: Project: Location:	JK Geotechn Proposed Ind 3 Central Roa	Ref No: Report: Report Date: Page 1 of 1	32781B A 13/11/2019			
AS 1289	TEST METHOD	2.1.1	3.1.2	3.2.1	3.3.1	3.4.1
BOREHOLE	DEPTH	MOISTURE	LIQUID	PLASTIC	PLASTICITY	LINEAR
NUMBER	m	CONTENT	LIMIT	LIMIT	INDEX	SHRINKAGE
		%	%	%	%	%
1	1.50 - 1.95	14.0	30	13	17	6.5
1	5.70 - 6.00	16.0	-	-	-	-
4	3.00 - 3.30	12.1	51	20	31	12.5
4	3.50 - 4.00	14.6	-	-	-	-

#### Notes:

• The test sample for liquid and plastic limit was air-dried & dry-sieved

• The linear shrinkage mould was 125mm

· Refer to appropriate notes for soil descriptions

• Date of receipt of sample: 31/10/2019.

· Sampled and supplied by client. Samples tested as received.



Accredited for compliance with ISO/IEC 17025 - Testing. This document shall not be reproduced except In full without approval of the laboratory. Results relate only to the items tested or sampled.

e C /13/11/2019 Authorised Signature / Date (D. Treweek)

All services provided by STS are subject to our standard terms and conditions. A copy is available on request.



### **CERTIFICATE OF ANALYSIS 229778**

Client Details	
Client	JK Geotechnics
Attention	Arthur Kourtesis
Address	PO Box 976, North Ryde BC, NSW, 1670

Sample Details	Sample Details					
Your Reference	<u>32781B, Avalon</u>					
Number of Samples	3 Soil					
Date samples received	31/10/2019					
Date completed instructions received	31/10/2019					

### **Analysis Details**

Please refer to the following pages for results, methodology summary and quality control data.

Samples were analysed as received from the client. Results relate specifically to the samples as received.

Results are reported on a dry weight basis for solids and on an as received basis for other matrices.

Report Details	
Date results requested by	07/11/2019
Date of Issue	06/11/2019
NATA Accreditation Number 29	01. This document shall not be reproduced except in full.
Accredited for compliance with	SO/IEC 17025 - Testing. Tests not covered by NATA are denoted with *

<u>Results Approved By</u> Diego Bigolin, Team Leader, Inorganics Authorised By

Nancy Zhang, Laboratory Manager



Misc Inorg - Soil				
Our Reference		229778-1	229778-2	229778-3
Your Reference	UNITS	BH1	BH2	BH3
Depth		0.5-0.95	6.0-6.3	3.0-3.45
Date Sampled		30/10/2019	30/10/2019	30/10/2019
Type of sample		Soil	Soil	Soil
Date prepared	-	04/11/2019	04/11/2019	04/11/2019
Date analysed	-	04/11/2019	04/11/2019	04/11/2019
pH 1:5 soil:water	pH Units	7.0	5.6	5.0
Chloride, Cl 1:5 soil:water	mg/kg	10	20	10
Sulphate, SO4 1:5 soil:water	mg/kg	<10	20	20
Resistivity in soil*	ohm m	270	230	300

Method ID	Methodology Summary
Inorg-001	pH - Measured using pH meter and electrode in accordance with APHA latest edition, 4500-H+. Please note that the results for water analyses are indicative only, as analysis outside of the APHA storage times.
Inorg-002	Conductivity and Salinity - measured using a conductivity cell at 25oC in accordance with APHA 22nd ED 2510 and Rayment & Lyons. Resistivity is calculated from Conductivity (non NATA). Resistivity (calculated) may not correlate with results otherwise obtained using Resistivity-Current method, depending on the nature of the soil being analysed.
Inorg-081	Anions - a range of Anions are determined by Ion Chromatography, in accordance with APHA latest edition, 4110-B. Waters samples are filtered on receipt prior to analysis. Alternatively determined by colourimetry/turbidity using Discrete Analyser.

QUALITY	QUALITY CONTROL: Misc Inorg - Soil					Duplicate			Spike Recovery %	
Test Description	Units	PQL	Method	Blank	#	Base	Dup.	RPD	LCS-1	[NT]
Date prepared	-			04/11/2019	[NT]	[NT]	[NT]	[NT]	04/11/2019	
Date analysed	-			04/11/2019	[NT]	[NT]	[NT]	[NT]	04/11/2019	
pH 1:5 soil:water	pH Units		Inorg-001	[NT]	[NT]	[NT]	[NT]	[NT]	102	
Chloride, Cl 1:5 soil:water	mg/kg	10	Inorg-081	<10	[NT]	[NT]	[NT]	[NT]	95	
Sulphate, SO4 1:5 soil:water	mg/kg	10	Inorg-081	<10	[NT]	[NT]	[NT]	[NT]	116	
Resistivity in soil*	ohm m	1	Inorg-002	<1	[NT]	[NT]	[NT]	[NT]	[NT]	[NT]

Result Definiti	ons
NT	Not tested
NA	Test not required
INS	Insufficient sample for this test
PQL	Practical Quantitation Limit
<	Less than
>	Greater than
RPD	Relative Percent Difference
LCS	Laboratory Control Sample
NS	Not specified
NEPM	National Environmental Protection Measure
NR	Not Reported

Quality Contro	ol Definitions
Blank	This is the component of the analytical signal which is not derived from the sample but from reagents, glassware etc, can be determined by processing solvents and reagents in exactly the same manner as for samples.
Duplicate	This is the complete duplicate analysis of a sample from the process batch. If possible, the sample selected should be one where the analyte concentration is easily measurable.
Matrix Spike	A portion of the sample is spiked with a known concentration of target analyte. The purpose of the matrix spike is to monitor the performance of the analytical method used and to determine whether matrix interferences exist.
LCS (Laboratory Control Sample)	This comprises either a standard reference material or a control matrix (such as a blank sand or water) fortified with analytes representative of the analyte class. It is simply a check sample.
Surrogate Spike	Surrogates are known additions to each sample, blank, matrix spike and LCS in a batch, of compounds which are similar to the analyte of interest, however are not expected to be found in real samples.
Australian Drinking	Water Guidelines recommend that Thermotolerant Coliform Faecal Enterococci. & E Coli levels are less than

Australian Drinking Water Guidelines recommend that Thermotolerant Coliform, Faecal Enterococci, & E.Coli levels are less than 1cfu/100mL. The recommended maximums are taken from "Australian Drinking Water Guidelines", published by NHMRC & ARMC 2011.

### Laboratory Acceptance Criteria

Duplicate sample and matrix spike recoveries may not be reported on smaller jobs, however, were analysed at a frequency to meet or exceed NEPM requirements. All samples are tested in batches of 20. The duplicate sample RPD and matrix spike recoveries for the batch were within the laboratory acceptance criteria.

Filters, swabs, wipes, tubes and badges will not have duplicate data as the whole sample is generally extracted during sample extraction.

Spikes for Physical and Aggregate Tests are not applicable.

For VOCs in water samples, three vials are required for duplicate or spike analysis.

Duplicates: >10xPQL - RPD acceptance criteria will vary depending on the analytes and the analytical techniques but is typically in the range 20%-50% – see ELN-P05 QA/QC tables for details; <10xPQL - RPD are higher as the results approach PQL and the estimated measurement uncertainty will statistically increase.

Matrix Spikes, LCS and Surrogate recoveries: Generally 70-130% for inorganics/metals (not SPOCAS); 60-140% for organics/SPOCAS (+/-50% surrogates) and 10-140% for labile SVOCs (including labile surrogates), ultra trace organics and speciated phenols is acceptable.

In circumstances where no duplicate and/or sample spike has been reported at 1 in 10 and/or 1 in 20 samples respectively, the sam When samples are received where certain analytes are outside of recommended technical holding times (THTs), the analysis has proceeded. Where analytes are on the verge of breaching THTs, every effort will be made to analyse within the THT or as soon as practicable.

Where sampling dates are not provided, Envirolab are not in a position to comment on the validity of the analysis where recommended technical holding times may have been breached.

Measurement Uncertainty estimates are available for most tests upon request.

Analysis of aqueous samples typically involves the extraction/digestion and/or analysis of the liquid phase only (i.e. NOT any settled sediment phase but inclusive of suspended particles if present), unless stipulated on the Envirolab COC and/or by correspondence. Notable exceptions include certain Physical Tests (pH/EC/BOD/COD/Apparent Colour etc.), Solids testing, total recoverable metals and PFAS where solids are included by default.

Borehole No. 1 1/2

Proje Loca						DENT LIVING UNITS ALON BEACH, NSW						
Job I	<b>lo.:</b> 3	32781B			Meth	od: SPIRAL AUGER		<b>R.L. Surface:</b> ≈ 8.3m				
	30/1							D	atum: A	AHD		
Plant	Туре	: JK205			Logo	jed/Checked by: A.C.K./T.C.						
Groundwater Record	ES U50 DB DS DS SAMPLES	Field Tests	Depth (m)	Graphic Log	Unified Classification	DESCRIPTION	Moisture Condition/ Weathering	Strength/ Rel. Density	Hand Penetrometer Readings (kPa.)	Remarks		
ORY ON OMPLET ON AND AFTER			0 -			FILL: Silty sand, fine to medium grained, dark grey brown, trace of root fibres.	М		-	GRASS COVER		
4 HRS		N = 5 2,3,2	-	¥ ¥ ¥	SP	SAND: fine to medium grained, light grey brown, trace of silt.	Μ	L	-	ALLUVIAL		
			1 — -		CL	Silty sandy CLAY: low plasticity, light grey brown mottled orange brown, medium grained sand.	w>PL	VSt	-	RESIDUAL		
		N = 8 5,4,4	-						280 360			
			2						-	-		
			-			Sandy CLAY: medium plasticity, light grey mottled orange brown.			-			
		N = 13 4,5,8	3-						360 270 350	-		
			-						-			
			4		CI-CH	light grey and red brown, trace of medium grained sand and fine graine			-	-		
		N = 14 3,5,9	-			sandstone gravel.		VSt-Hd	250 470 325			
			5						-			
			- - 6 —		-	Extremely Weathered siltstone: silty CLAY, medium to high plasticity, light grey	XW	Hd		NEWPORT FORMATION		
			-			grey.			-	VERY LOW 'TC' E RESISTANCE		
			-						-			

Borehole No. 1 2/2

ſ	Clier	Client: AVALON CENTRAL PTY LTD				AL PT	Y LTD				
	Proje	ect:	PROF	OSEI	D IND	EPENI	DENT LIVING UNITS				
	Loca	ation:	3 CEN	ITRAL	ROA	D, AV	ALON BEACH, NSW				
ľ	Job	No.: 3	32781B			Meth	od: SPIRAL AUGER		R	.L. Surf	<b>ace:</b> ≈ 8.3m
	Date	: 30/1	0/19						D	atum:	AHD
	Plan	t Туре	: JK205			Logo	ged/Checked by: A.C.K./T.C.				
	Groundwater Record	ES U50 DB SAMPLES	Field Tests	Depth (m)	Graphic Log	Unified Classification	DESCRIPTION	Moisture Condition/ Weathering	Strength/ Rel. Density	Hand Penetrometer Readings (kPa.)	Remarks
COPYRIGHT	Gr Re Gr						Extremely Weathered siltstone: silty CLAY, medium to high plasticity, light grey. as above, but with iron indurated bands. END OF BOREHOLE AT 9.0m	AX MC	PH Rt Rt		
λdΟ λ				14							_

Borehole No. 2 1/1

Location		NIRAL	ROA	-	ALON BEACH, NSW				
	32781B			Meth	od: SPIRAL AUGER				ace: ≈ 8.1m
Date: 30	)/10/19 <b>pe:</b> JK205				ed/Checked by: A.C.K./T.C.		D	atum: /	AHD
	-			LUGE	Jeu/Checkeu by. A.C.N./T.C.				
Groundwater Record <u>U50</u> SAMPLES		Depth (m)	Graphic Log	Unified Classification	DESCRIPTION	Moisture Condition/ Weathering	Strength/ Rel. Density	Hand Penetrometer Readings (kPa.)	Remarks
DRY ON OMPLET- ON AND		0 × × ×			FILL: Silty sand, fine to medium grained, dark grey brown, trace of root fibres.	Μ		-	GRASS COVER
AFTER 3 HRS	N = 5 2,2,3	¥. 		SP	SAND: fine to medium grained, light grey brown, trace of silt and root fibres.	М	L		ALLUVIAL
		1 -7 -7		CI-CH	Sandy silty CLAY: medium to high plasticity, light grey brown and orange brown, medium grained sand.	w>PL	VSt		RESIDUAL
	N = 9 2,4,5							260 230 270	
		2-						-	-
				— <u>—</u> —	Sandy silty CLAY: medium plasticity, light grey and orange brown, medium grained sand.			-	
 	N = 14 4,7,7	3-					VSt-Hd	380 340 405	
6/11/19									GROUNDWATER MONITORING WELL INSTALLED TO 6m. HAND SLOTTED 50mm DIA. PVC STANDPIPE 4m TO 6m. CASING 0m TO 4m. 2mm SAND
		4-			Sandy silty CLAY: medium plasticity, light grey mottled red brown and orange brown, trace of fine to medium grained ironstone gravel.			-	
	N = 15 4,7,8				שומווכע ווטווסנטווב שומיבו.		VSt	280 250 220	FILTER PACK 3m 6m. BENTONITE SEAL 0.8m TO 3n BACKFILLED WIT
		5						-	<ul> <li>SAND TO THE SURFACE.</li> <li>COMPLETED WI CONCRETED GA COVER.</li> </ul>
	N > 31 11,20/	6		-	Extremely Weathered siltstone: silty CLAY, medium to high plasticity, light	XW	Hd	>600 >600	NEWPORT

Borehole No. 3 1/1


Client:	AVALON CENTRAL PTY LTD PROPOSED INDEPENDENT LIVING UNITS								
Project:									
Location:	3 CEN	NIRAL	. ROA	D, AV	ALON BEACH, NSW				
Job No.: 3	2781B			Meth	od: SPIRAL AUGER		R	.L. Surf	<b>ace:</b> ≈ 10.7m
Date: 30/1	0/19						D	atum: /	AHD
Plant Type	: JK205			Logg	jed/Checked by: A.C.K./T.C.				
Groundwater Record ES DB DS SAMPLES DS	Field Tests	Depth (m)	Graphic Log	Unified Classification	DESCRIPTION	Moisture Condition/ Weathering	Strength/ Rel. Density	Hand Penetrometer Readings (kPa.)	Remarks
DRY ON OMPLET- DN AND AFTER		-0 			FILL: Silty sand, fine to medium grained, dark grey brown, trace of root fibres.	М		-	GRASS COVER
1.25 HRS	N = 3 2,1,2	1 -		SP CI	SAND: fine to medium grained, light <u>grey brown.</u> Silty sandy CLAY: medium plasticity, light grey brown, medium grained.	M w>PL	L St	120 130	ALLUVIAL RESIDUAL
				CI-CH	Silty CLAY: medium to high plasticity, light grey, orange brown and red brown, with medium grained sand.	w <pl< td=""><td>VSt-Hd</td><td>390</td><td></td></pl<>	VSt-Hd	390	
	N = 11 4,5,6	2						350 570	-
				CI	Sandy silty CLAY: medium plasticity, light grey and red brown, fine to medium grained sand, trace of fine to medium grained ironstone gravel.		Hd	-	
	N = 22 7,8,14	3-						>600 515 >600	-
		4						-	-
	N > 25 12,15, 10/50mm							>600 >600	
	REFUSAL			-	Extremely weathered siltstone: silty CLAY, medium plasticity, light grey, with iron indurated bands. END OF BOREHOLE AT 5.0m	XW	Hd		NEWPORT FORMATION HIGH 'TC' BIT RESISTANCE 'TC' BIT REFUSA ON INFERRED IRONSTONE BAN
		6						-	


Borehole No. 4 1/1

Client:		ON CEN							
Project:		PROPOSED INDEPENDENT LIVING UNITS							
Location:	: 3 CEN	NTRAL F	ROA	D, AV	ALON BEACH, NSW				
Job No.:	32781B			Meth	od: SPIRAL AUGER		R	.L. Surfa	ace: ≈ 12.7m
Date: 30/	/10/19						D	atum: A	\HD
Plant Typ	<b>e:</b> JK205			Logg	jed/Checked by: A.C.K./T.C.				
Groundwater Record ES U50 SAMPLES	DS Field Tests		Graphic Log	Unified Classification	DESCRIPTION	Moisture Condition/ Weathering	Strength/ Rel. Density	Hand Penetrometer Readings (kPa.)	Remarks
DRY ON DMPLET-		0	$\bigotimes$		FILL: silty sand, fine to medium $\neg$ grained, dark grey brown, trace of root	М			GRASS COVER
ION		-		SP	SAND: fine to medium grained, light	М	(L)	F	ALLUVIAL
	N = 10 3,3,7	1-		CI-CH	\grey brown, trace of silt. Silty CLAY: medium to high plasticity, light brown, with fine to medium grained sand.	w <pl< td=""><td>Hd</td><td>455 405 510</td><td>RESIDUAL</td></pl<>	Hd	455 405 510	RESIDUAL
				СН	Silty CLAY: high plasticity, light grey and red brown, with fine to medium grained sand.				
	N = 17 5,7,10	2-						>600 >600 >600	-
	N > 30 13,17/	3			as above, but with medium grained ironstone gravel and fine to medium grained sand.			- - - - - - - - - - - - - - - - - - -	
	REFUSAL	4 -		-	Extremely Weathered siltstone: silty CLAY, medium to high plasticity, light grey, with iron indurated bands.	XW	Hd	<u>&gt;600</u>	NEWPORT FORMATION
					as above, but with high strength sandstone bands.			-	VERY LOW 'TC' F RESISTANCE WI HIGH BANDS GROUNDWATER MONITORING W INSTALLED TO 6 HAND SLOTTED 50mm DIA. PVC STANDPIPE 4m 6m. CASING 0m 4m. 2mm SAND
					END OF BOREHOLE AT 6.0m				FILTER PACK 3m FILTER PACK 3m 6m. BENTONITE SEA 0m TO 3m. BACKFILLED WI SAND TO SURFA COMPLETED WI CONCRETED GA COVER




T DATE: 27/11/2019 11:47:30 AM DWG FILE: S:\6 GEOTECHNICAL\6F GEOTECHNICAL JOBS\32000'S\32781B AVALON\CAI

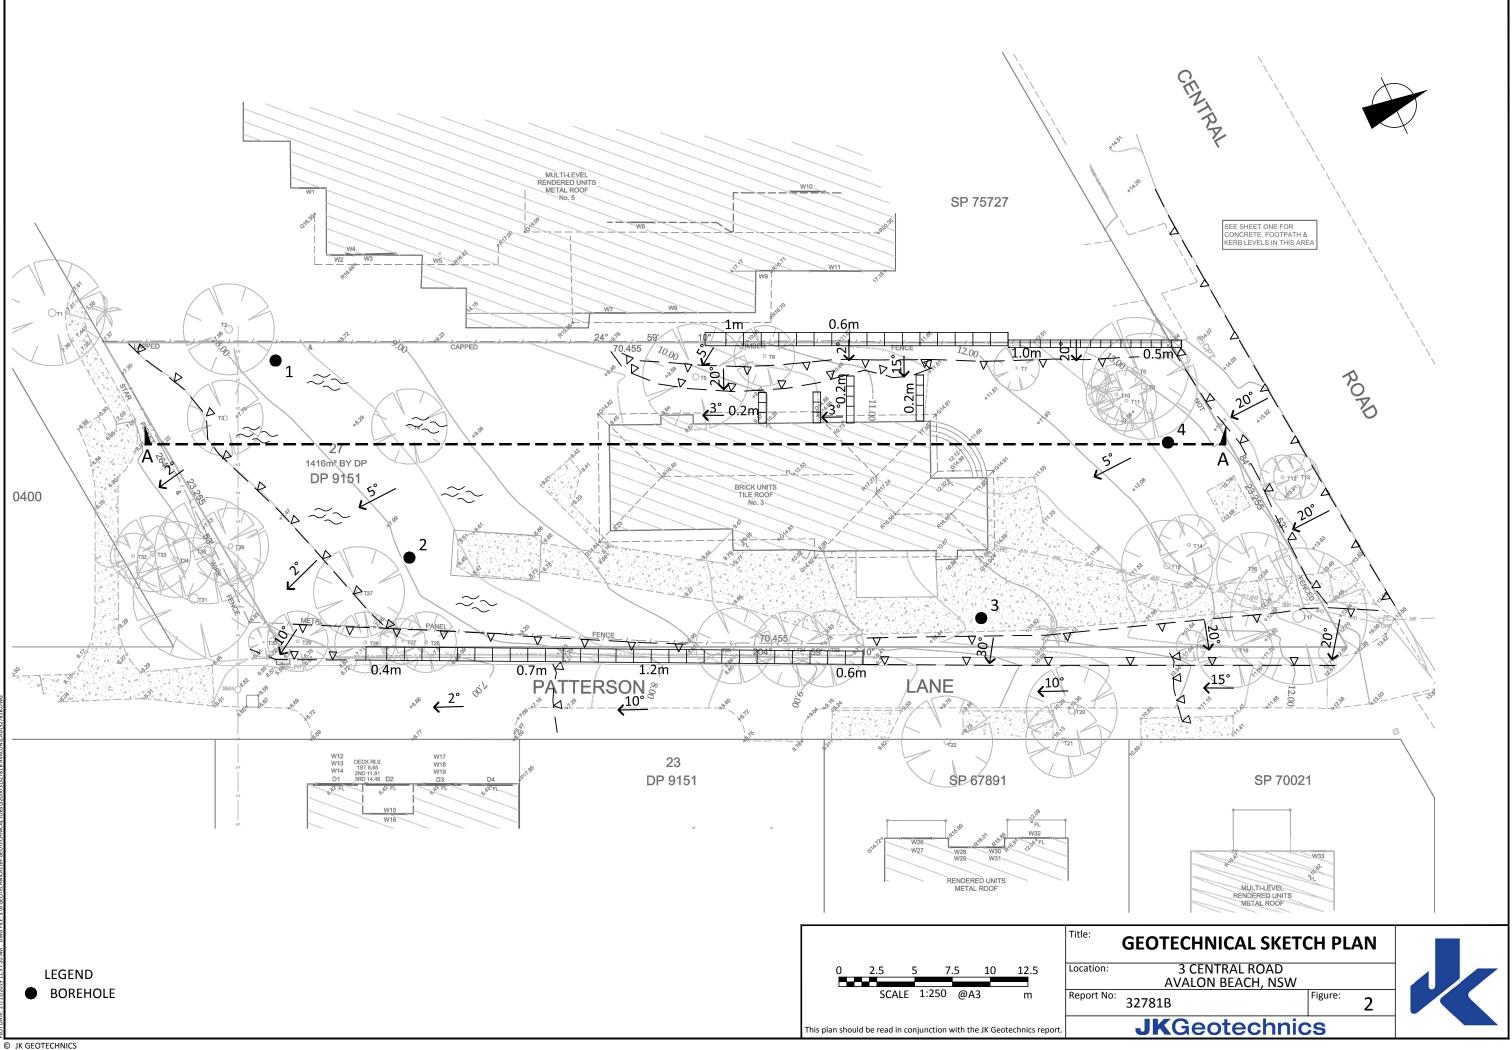


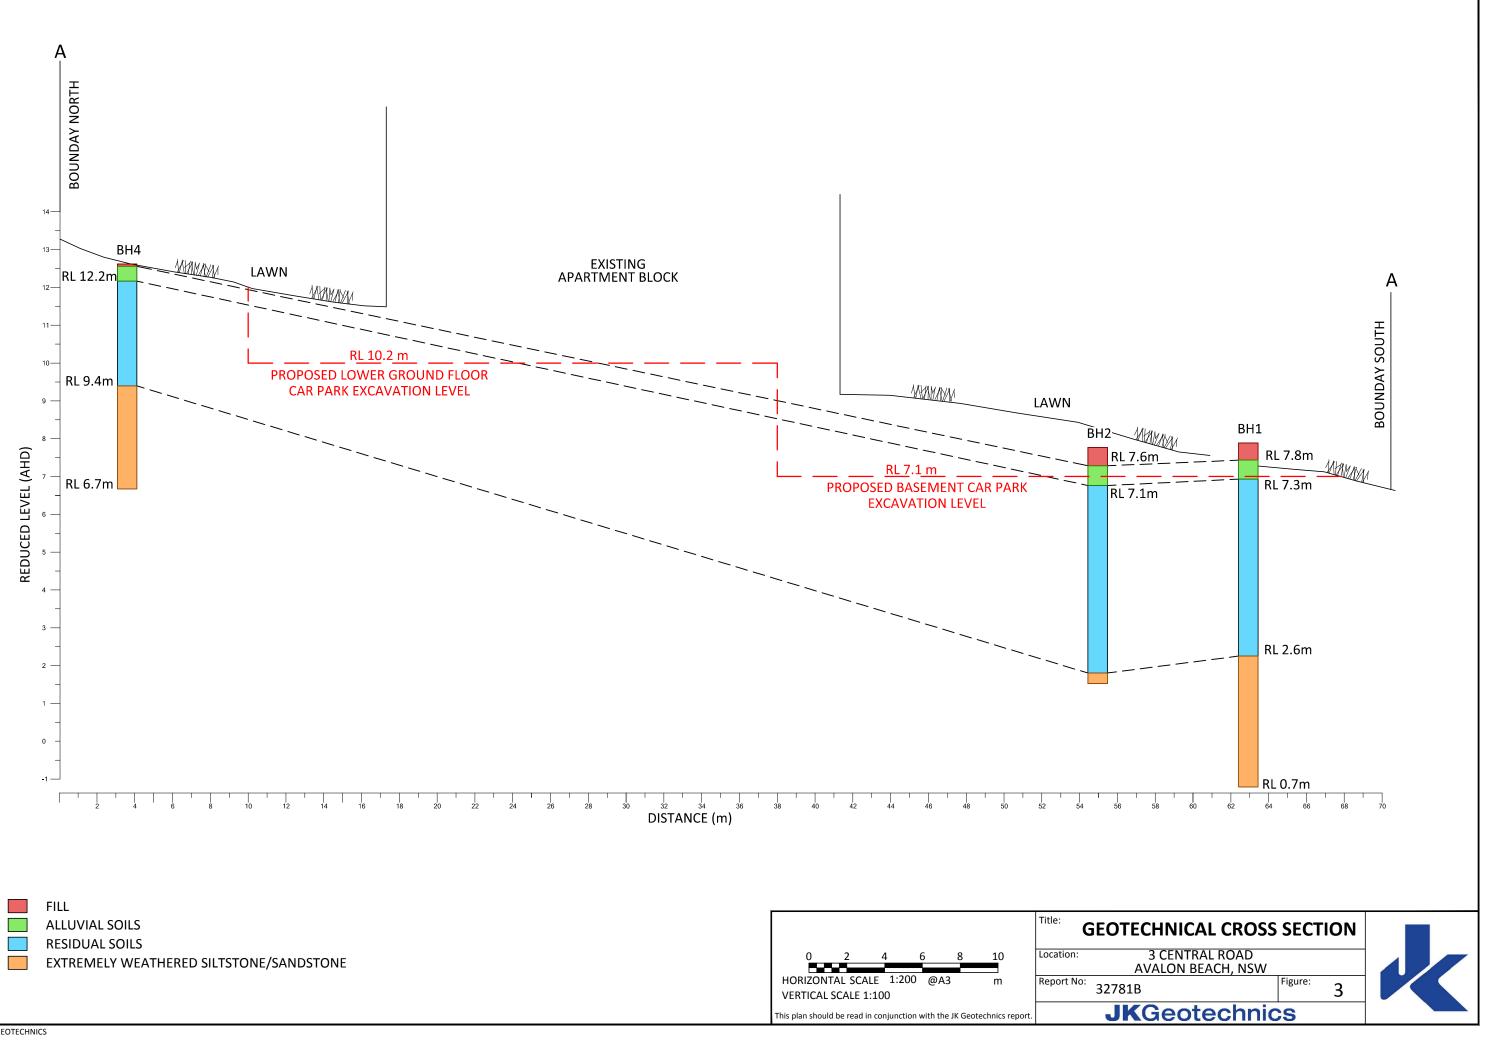

© JK GEOTECHNICS

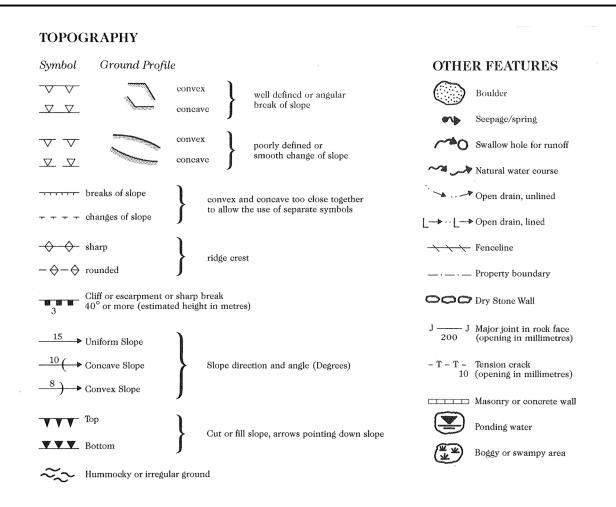

#### EXAMPLE OF USE OF TOPOGRAPHIC SYMBOLS:

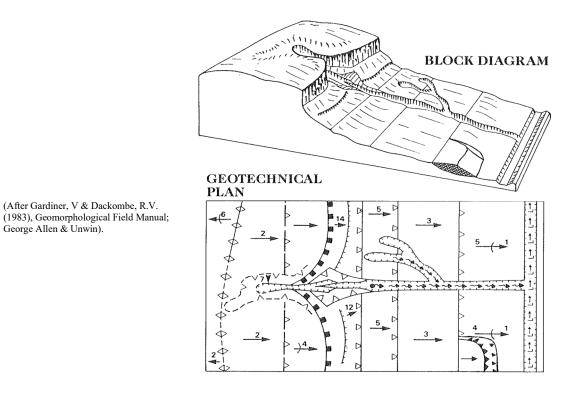

# **GEOTECHNICAL MAPPING SYMBOLS**





# **REPORT EXPLANATION NOTES**

#### INTRODUCTION

These notes have been provided to amplify the geotechnical report in regard to classification methods, field procedures and certain matters relating to the Comments and Recommendations section. Not all notes are necessarily relevant to all reports.

The ground is a product of continuing natural and man-made processes and therefore exhibits a variety of characteristics and properties which vary from place to place and can change with time. Geotechnical engineering involves gathering and assimilating limited facts about these characteristics and properties in order to understand or predict the behaviour of the ground on a particular site under certain conditions. This report may contain such facts obtained by inspection, excavation, probing, sampling, testing or other means of investigation. If so, they are directly relevant only to the ground at the place where and time when the investigation was carried out.

#### DESCRIPTION AND CLASSIFICATION METHODS

The methods of description and classification of soils and rocks used in this report are based on Australian Standard 1726:2017 *'Geotechnical Site Investigations'*. In general, descriptions cover the following properties – soil or rock type, colour, structure, strength or density, and inclusions. Identification and classification of soil and rock involves judgement and the Company infers accuracy only to the extent that is common in current geotechnical practice.

Soil types are described according to the predominating particle size and behaviour as set out in the attached soil classification table qualified by the grading of other particles present (eg. sandy clay) as set out below:

Soil Classification	Particle Size
Clay	< 0.002mm
Silt	0.002 to 0.075mm
Sand	0.075 to 2.36mm
Gravel	2.36 to 63mm
Cobbles	63 to 200mm
Boulders	> 200mm

Non-cohesive soils are classified on the basis of relative density, generally from the results of Standard Penetration Test (SPT) as below:

Relative Density	SPT 'N' Value (blows/300mm)
Very loose (VL)	< 4
Loose (L)	4 to 10
Medium dense (MD)	10 to 30
Dense (D)	30 to 50
Very Dense (VD)	> 50

Cohesive soils are classified on the basis of strength (consistency) either by use of a hand penetrometer, vane shear, laboratory testing and/or tactile engineering examination. The strength terms are defined as follows.

Classification	Unconfined Compressive Strength (kPa)	Indicative Undrained Shear Strength (kPa)
Very Soft (VS)	≤25	≤12
Soft (S)	> 25 and $\leq$ 50	> 12 and $\leq$ 25
Firm (F)	> 50 and $\leq$ 100	> 25 and $\leq$ 50
Stiff (St)	$>$ 100 and $\leq$ 200	> 50 and $\leq$ 100
Very Stiff (VSt)	> 200 and $\leq$ 400	$>$ 100 and $\leq$ 200
Hard (Hd)	> 400	> 200
Friable (Fr)	Strength not attainable	– soil crumbles

Rock types are classified by their geological names, together with descriptive terms regarding weathering, strength, defects, etc. Where relevant, further information regarding rock classification is given in the text of the report. In the Sydney Basin, 'shale' is used to describe fissile mudstone, with a weakness parallel to bedding. Rocks with alternating inter-laminations of different grain size (eg. siltstone/claystone and siltstone/fine grained sandstone) is referred to as 'laminite'.

#### SAMPLING

Sampling is carried out during drilling or from other excavations to allow engineering examination (and laboratory testing where required) of the soil or rock.

Disturbed samples taken during drilling provide information on plasticity, grain size, colour, moisture content, minor constituents and, depending upon the degree of disturbance, some information on strength and structure. Bulk samples are similar but of greater volume required for some test procedures.

Undisturbed samples are taken by pushing a thin-walled sample tube, usually 50mm diameter (known as a U50), into the soil and withdrawing it with a sample of the soil contained in a relatively undisturbed state. Such samples yield information on structure and strength, and are necessary for laboratory determination of shrinkswell behaviour, strength and compressibility. Undisturbed sampling is generally effective only in cohesive soils.

Details of the type and method of sampling used are given on the attached logs.



#### INVESTIGATION METHODS

The following is a brief summary of investigation methods currently adopted by the Company and some comments on their use and application. All methods except test pits, hand auger drilling and portable Dynamic Cone Penetrometers require the use of a mechanical rig which is commonly mounted on a truck chassis or track base.

**Test Pits:** These are normally excavated with a backhoe or a tracked excavator, allowing close examination of the insitu soils and 'weaker' bedrock if it is safe to descend into the pit. The depth of penetration is limited to about 3m for a backhoe and up to 6m for a large excavator. Limitations of test pits are the problems associated with disturbance and difficulty of reinstatement and the consequent effects on close-by structures. Care must be taken if construction is to be carried out near test pit locations to either properly recompact the backfill during construction or to design and construct the structure so as not to be adversely affected by poorly compacted backfill at the test pit location.

Hand Auger Drilling: A borehole of 50mm to 100mm diameter is advanced by manually operated equipment. Refusal of the hand auger can occur on a variety of materials such as obstructions within any fill, tree roots, hard clay, gravel or ironstone, cobbles and boulders, and does not necessarily indicate rock level.

**Continuous Spiral Flight Augers:** The borehole is advanced using 75mm to 115mm diameter continuous spiral flight augers, which are withdrawn at intervals to allow sampling and insitu testing. This is a relatively economical means of drilling in clays and in sands above the water table. Samples are returned to the surface by the flights or may be collected after withdrawal of the auger flights, but they can be very disturbed and layers may become mixed. Information from the auger sampling (as distinct from specific sampling by SPTs or undisturbed samples) is of limited reliability due to mixing or softening of samples by groundwater, or uncertainties as to the original depth of the samples. Augering below the groundwater table is of even lesser reliability than augering above the water table.

**Rock Augering:** Use can be made of a Tungsten Carbide (TC) bit for auger drilling into rock to indicate rock quality and continuity by variation in drilling resistance and from examination of recovered rock cuttings. This method of investigation is quick and relatively inexpensive but provides only an indication of the likely rock strength and predicted values may be in error by a strength order. Where rock strengths may have a significant impact on construction feasibility or costs, then further investigation by means of cored boreholes may be warranted.

**Wash Boring:** The borehole is usually advanced by a rotary bit, with water being pumped down the drill rods and returned up the annulus, carrying the drill cuttings. Only major changes in stratification can be assessed from the cuttings, together with some information from "feel" and rate of penetration.

**Mud Stabilised Drilling:** Either Wash Boring or Continuous Core Drilling can use drilling mud as a circulating fluid to stabilise the borehole. The term 'mud' encompasses a range of products ranging from bentonite to polymers. The mud tends to mask the cuttings and reliable identification is only possible from intermittent intact sampling (eg. from SPT and U50 samples) or from rock coring, etc.

**Continuous Core Drilling:** A continuous core sample is obtained using a diamond tipped core barrel. Provided full core recovery is achieved (which is not always possible in very low strength rocks and granular soils), this technique provides a very reliable (but relatively expensive) method of investigation. In rocks, NMLC or HQ triple tube core barrels, which give a core of about 50mm and 61mm diameter, respectively, is usually used with water flush. The length of core recovered is compared to the length drilled and any length not recovered is shown as NO CORE. The location of NO CORE recovery is determined on site by the supervising engineer; where the location is uncertain, the loss is placed at the bottom of the drill run.

**Standard Penetration Tests:** Standard Penetration Tests (SPT) are used mainly in non-cohesive soils, but can also be used in cohesive soils, as a means of indicating density or strength and also of obtaining a relatively undisturbed sample. The test procedure is described in Australian Standard 1289.6.3.1–2004 (R2016) 'Methods of Testing Soils for Engineering Purposes, Soil Strength and Consolidation Tests – Determination of the Penetration Resistance of a Soil – Standard Penetration Test (SPT)'.

The test is carried out in a borehole by driving a 50mm diameter split sample tube with a tapered shoe, under the impact of a 63.5kg hammer with a free fall of 760mm. It is normal for the tube to be driven in three successive 150mm increments and the 'N' value is taken as the number of blows for the last 300mm. In dense sands, very hard clays or weak rock, the full 450mm penetration may not be practicable and the test is discontinued.

The test results are reported in the following form:

• In the case where full penetration is obtained with successive blow counts for each 150mm of, say, 4, 6 and 7 blows, as

Ν	=	13
4,	6,	7

 In a case where the test is discontinued short of full penetration, say after 15 blows for the first 150mm and 30 blows for the next 40mm, as

> N > 30 15, 30/40mm

The results of the test can be related empirically to the engineering properties of the soil.

A modification to the SPT is where the same driving system is used with a solid 60° tipped steel cone of the same diameter as the SPT hollow sampler. The solid cone can be continuously driven for some distance in soft clays or loose sands, or may be used where damage would otherwise occur to the SPT. The results of this Solid Cone Penetration Test (SCPT) are shown as 'N<sub>c</sub>' on the borehole logs, together with the number of blows per 150mm penetration.



**Cone Penetrometer Testing (CPT) and Interpretation:** The cone penetrometer is sometimes referred to as a Dutch Cone. The test is described in Australian Standard 1289.6.5.1–1999 (R2013) 'Methods of Testing Soils for Engineering Purposes, Soil Strength and Consolidation Tests – Determination of the Static Cone Penetration Resistance of a Soil – Field Test using a Mechanical and Electrical Cone or Friction-Cone Penetrometer'.

In the tests, a 35mm or 44mm diameter rod with a conical tip is pushed continuously into the soil, the reaction being provided by a specially designed truck or rig which is fitted with a hydraulic ram system. Measurements are made of the end bearing resistance on the cone and the frictional resistance on a separate 134mm or 165mm long sleeve, immediately behind the cone. Transducers in the tip of the assembly are electrically connected by wires passing through the centre of the push rods to an amplifier and recorder unit mounted on the control truck. The CPT does not provide soil sample recovery.

As penetration occurs (at a rate of approximately 20mm per second), the information is output as incremental digital records every 10mm. The results given in this report have been plotted from the digital data.

The information provided on the charts comprise:

- Cone resistance the actual end bearing force divided by the cross sectional area of the cone – expressed in MPa. There are two scales presented for the cone resistance. The lower scale has a range of 0 to 5MPa and the main scale has a range of 0 to 50MPa. For cone resistance values less than 5MPa, the plot will appear on both scales.
- Sleeve friction the frictional force on the sleeve divided by the surface area – expressed in kPa.
- Friction ratio the ratio of sleeve friction to cone resistance, expressed as a percentage.

The ratios of the sleeve resistance to cone resistance will vary with the type of soil encountered, with higher relative friction in clays than in sands. Friction ratios of 1% to 2% are commonly encountered in sands and occasionally very soft clays, rising to 4% to 10% in stiff clays and peats. Soil descriptions based on cone resistance and friction ratios are only inferred and must not be considered as exact.

Correlations between CPT and SPT values can be developed for both sands and clays but may be site specific.

Interpretation of CPT values can be made to empirically derive modulus or compressibility values to allow calculation of foundation settlements.

Stratification can be inferred from the cone and friction traces and from experience and information from nearby boreholes etc. Where shown, this information is presented for general guidance, but must be regarded as interpretive. The test method provides a continuous profile of engineering properties but, where precise information on soil classification is required, direct drilling and sampling may be preferable. There are limitations when using the CPT in that it may not penetrate obstructions within any fill, thick layers of hard clay and very dense sand, gravel and weathered bedrock. Normally a 'dummy' cone is pushed through fill to protect the equipment. No information is recorded by the 'dummy' probe.

**Flat Dilatometer Test:** The flat dilatometer (DMT), also known as the Marchetti Dilometer comprises a stainless steel blade having a flat, circular steel membrane mounted flush on one side.

The blade is connected to a control unit at ground surface by a pneumatic-electrical tube running through the insertion rods. A gas tank, connected to the control unit by a pneumatic cable, supplies the gas pressure required to expand the membrane. The control unit is equipped with a pressure regulator, pressure gauges, an audio-visual signal and vent valves.

The blade is advanced into the ground using our CPT rig or one of our drilling rigs, and can be driven into the ground using an SPT hammer. As soon as the blade is in place, the membrane is inflated, and the pressure required to lift the membrane (approximately 0.1mm) is recorded. The pressure then required to lift the centre of the membrane by an additional 1mm is recorded. The membrane is then deflated before pushing to the next depth increment, usually 200mm down. The pressure readings are corrected for membrane stiffness.

The DMT is used to measure material index (I<sub>D</sub>), horizontal stress index (K<sub>D</sub>), and dilatometer modulus (E<sub>D</sub>). Using established correlations, the DMT results can also be used to assess the 'at rest' earth pressure coefficient (K<sub>o</sub>), over-consolidation ratio (OCR), undrained shear strength (C<sub>u</sub>), friction angle ( $\phi$ ), coefficient of consolidation (C<sub>h</sub>), coefficient of permeability (K<sub>h</sub>), unit weight ( $\gamma$ ), and vertical drained constrained modulus (M).

The seismic dilatometer (SDMT) is the combination of the DMT with an add-on seismic module for the measurement of shear wave velocity ( $V_s$ ). Using established correlations, the SDMT results can also be used to assess the small strain modulus ( $G_o$ ).

**Portable Dynamic Cone Penetrometers:** Portable Dynamic Cone Penetrometer (DCP) tests are carried out by driving a 16mm diameter rod with a 20mm diameter cone end with a 9kg hammer dropping 510mm. The test is described in Australian Standard 1289.6.3.2–1997 (R2013) 'Methods of Testing Soils for Engineering Purposes, Soil Strength and Consolidation Tests – Determination of the Penetration Resistance of a Soil – 9kg Dynamic Cone Penetrometer Test'.

The results are used to assess the relative compaction of fill, the relative density of granular soils, and the strength of cohesive soils. Using established correlations, the DCP test results can also be used to assess California Bearing Ratio (CBR).

Refusal of the DCP can occur on a variety of materials such as obstructions within any fill, tree roots, hard clay, gravel or ironstone, cobbles and boulders, and does not necessarily indicate rock level.



**Vane Shear Test:** The vane shear test is used to measure the undrained shear strength  $(C_u)$  of typically very soft to firm fine grained cohesive soils. The vane shear is normally performed in the bottom of a borehole, but can be completed from surface level, the bottom and sides of test pits, and on recovered undisturbed tube samples (when using a hand vane).

The vane comprises four rectangular blades arranged in the form of a cross on the end of a thin rod, which is coupled to the bottom of a drill rod string when used in a borehole. The size of the vane is dependent on the strength of the fine grained cohesive soils; that is, larger vanes are normally used for very low strength soils. For borehole testing, the size of the vane can be limited by the size of the casing that is used.

For testing inside a borehole, a device is used at the top of the casing, which suspends the vane and rods so that they do not sink under selfweight into the 'soft' soils beyond the depth at which the test is to be carried out. A calibrated torque head is used to rotate the rods and vane and to measure the resistance of the vane to rotation.

With the vane in position, torque is applied to cause rotation of the vane at a constant rate. A rate of 6° per minute is the common rotation rate. Rotation is continued until the soil is sheared and the maximum torque has been recorded. This value is then used to calculate the undrained shear strength. The vane is then rotated rapidly a number of times and the operation repeated until a constant torque reading is obtained. This torque value is used to calculate the remoulded shear strength. Where appropriate, friction on the vane rods is measured and taken into account in the shear strength calculation.

#### LOGS

The borehole or test pit logs presented herein are an engineering and/or geological interpretation of the subsurface conditions, and their reliability will depend to some extent on the frequency of sampling and the method of drilling or excavation. Ideally, continuous undisturbed sampling or core drilling will enable the most reliable assessment, but is not always practicable or possible to justify on economic grounds. In any case, the boreholes or test pits represent only a very small sample of the total subsurface conditions.

The terms and symbols used in preparation of the logs are defined in the following pages.

Interpretation of the information shown on the logs, and its application to design and construction, should therefore take into account the spacing of boreholes or test pits, the method of drilling or excavation, the frequency of sampling and testing and the possibility of other than 'straight line' variations between the boreholes or test pits. Subsurface conditions between boreholes or test pits may vary significantly from conditions encountered at the borehole or test pit locations.

#### GROUNDWATER

Where groundwater levels are measured in boreholes, there are several potential problems:

- Although groundwater may be present, in low permeability soils it may enter the hole slowly or perhaps not at all during the time it is left open.
- A localised perched water table may lead to an erroneous indication of the true water table.
- Water table levels will vary from time to time with seasons or recent weather changes and may not be the same at the time of construction.
- The use of water or mud as a drilling fluid will mask any groundwater inflow. Water has to be blown out of the hole and drilling mud must be washed out of the hole or 'reverted' chemically if reliable water observations are to be made.

More reliable measurements can be made by installing standpipes which are read after the groundwater level has stabilised at intervals ranging from several days to perhaps weeks for low permeability soils. Piezometers, sealed in a particular stratum, may be advisable in low permeability soils or where there may be interference from perched water tables or surface water.

#### FILL

The presence of fill materials can often be determined only by the inclusion of foreign objects (eg. bricks, steel, etc) or by distinctly unusual colour, texture or fabric. Identification of the extent of fill materials will also depend on investigation methods and frequency. Where natural soils similar to those at the site are used for fill, it may be difficult with limited testing and sampling to reliably assess the extent of the fill.

The presence of fill materials is usually regarded with caution as the possible variation in density, strength and material type is much greater than with natural soil deposits. Consequently, there is an increased risk of adverse engineering characteristics or behaviour. If the volume and quality of fill is of importance to a project, then frequent test pit excavations are preferable to boreholes.

#### LABORATORY TESTING

Laboratory testing is normally carried out in accordance with Australian Standard 1289 '*Methods of Testing Soils for Engineering Purposes*' or appropriate NSW Government Roads & Maritime Services (RMS) test methods. Details of the test procedure used are given on the individual report forms.

#### ENGINEERING REPORTS

Engineering reports are prepared by qualified personnel and are based on the information obtained and on current engineering standards of interpretation and analysis. Where the report has been prepared for a specific design proposal (eg. a three storey building) the information and interpretation may not be relevant if the design proposal is changed (eg. to a twenty storey building). If this happens, the Company will be pleased to review the report and the sufficiency of the investigation work.



Reasonable care is taken with the report as it relates to interpretation of subsurface conditions, discussion of geotechnical aspects and recommendations or suggestions for design and construction. However, the Company cannot always anticipate or assume responsibility for:

- Unexpected variations in ground conditions the potential for this will be partially dependent on borehole spacing and sampling frequency as well as investigation technique.
- Changes in policy or interpretation of policy by statutory authorities.
- The actions of persons or contractors responding to commercial pressures.
- Details of the development that the Company could not reasonably be expected to anticipate.

If these occur, the Company will be pleased to assist with investigation or advice to resolve any problems occurring.

#### SITE ANOMALIES

In the event that conditions encountered on site during construction appear to vary from those which were expected from the information contained in the report, the Company requests that it immediately be notified. Most problems are much more readily resolved when conditions are exposed rather than at some later stage, well after the event.

# REPRODUCTION OF INFORMATION FOR CONTRACTUAL PURPOSES

Where information obtained from this investigation is provided for tendering purposes, it is recommended that all information, including the written report and discussion, be made available. In circumstances where the discussion or comments section is not relevant to the contractual situation, it may be appropriate to prepare a specially edited document. The Company would be pleased to assist in this regard and/or to make additional report copies available for contract purposes at a nominal charge.

Copyright in all documents (such as drawings, borehole or test pit logs, reports and specifications) provided by the Company shall remain the property of Jeffery and Katauskas Pty Ltd. Subject to the payment of all fees due, the Client alone shall have a licence to use the documents provided for the sole purpose of completing the project to which they relate. Licence to use the documents may be revoked without notice if the Client is in breach of any obligation to make a payment to us.

#### **REVIEW OF DESIGN**

Where major civil or structural developments are proposed <u>or</u> where only a limited investigation has been completed <u>or</u> where the geotechnical conditions/constraints are quite complex, it is prudent to have a joint design review which involves an experienced geotechnical engineer/engineering geologist.

#### SITE INSPECTION


The Company will always be pleased to provide engineering inspection services for geotechnical aspects of work to which this report is related.

Requirements could range from:

- a site visit to confirm that conditions exposed are no worse than those interpreted, to
- a visit to assist the contractor or other site personnel in identifying various soil/rock types and appropriate footing or pile founding depths, or
- iii) full time engineering presence on site.



# SYMBOL LEGENDS

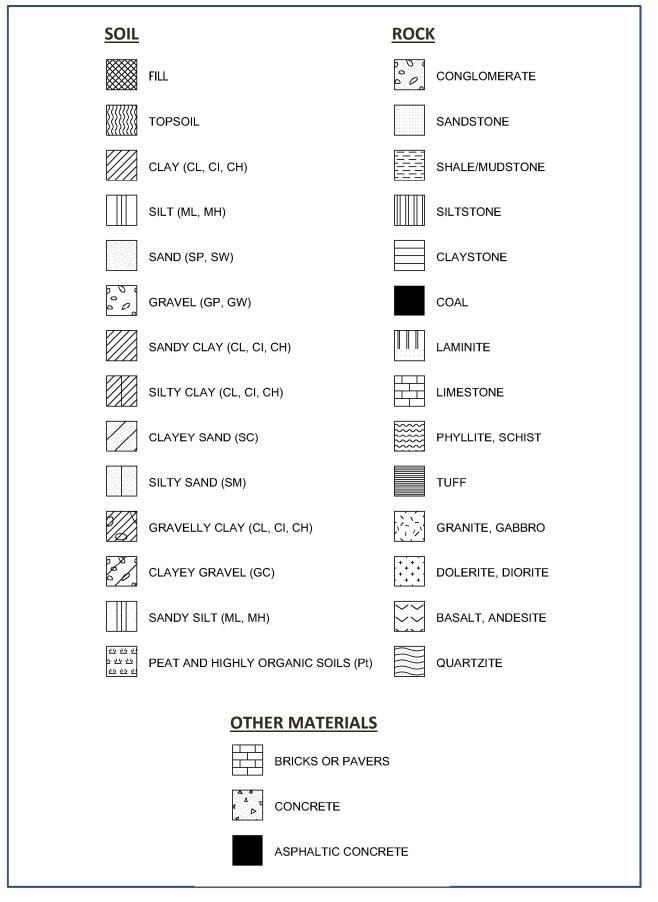

# **CLASSIFICATION OF COARSE AND FINE GRAINED SOILS**

Ma	ajor Divisions	Group Symbol	Typical Names	Field Classification of Sand and Gravel	Laboratory Cl	assification
ianis	GRAVEL (more GW € than half		Gravel and gravel-sand mixtures, little or no fines	Wide range in grain size and substantial amounts of all intermediate sizes, not enough fines to bind coarse grains, no dry strength	≤ 5% fines	C <sub>u</sub> >4 1 <c<sub>c&lt;3</c<sub>
ersize fraction is	of coarse fraction is larger than 2.36mm	GP	Gravel and gravel-sand mixtures, little or no fines, uniform gravels	Predominantly one size or range of sizes with some intermediate sizes missing, not enough fines to bind coarse grains, no dry strength	≤ 5% fines	Fails to comply with above
6		GM	Gravel-silt mixtures and gravel- sand-silt mixtures	'Dirty' materials with excess of non-plastic fines, zero to medium dry strength	≥ 12% fines, fines are silty	Fines behave as silt
Coarse grained soil (more than 65% of soil excluding greater than 0.0075mm)	0.075mm		Gravel-clay mixtures and gravel- sand-clay mixtures	'Dirty' materials with excess of plastic fines, medium to high dry strength	≥ 12% fines, fines are clayey	Fines behave as clay
re than 65% greater thar	SAND (more than half	SW	Sand and gravel-sand mixtures, little or no fines	Wide range in grain size and substantial amounts of all intermediate sizes, not enough fines to bind coarse grains, no dry strength	≤ 5% fines	Cu>6 1 <cc<3< td=""></cc<3<>
iai (mare gn	of coarse fraction is smaller than	SP	Sand and gravel-sand mixtures, little or no fines	Predominantly one size or range of sizes with some intermediate sizes missing, not enough fines to bind coarse grains, no dry strength	≤ 5% fines	Fails to comply with above
egraineds	2.36mm)	SM	Sand-silt mixtures	'Dirty' materials with excess of non-plastic fines, zero to medium dry strength	≥ 12% fines, fines are silty	
Coarse		SC	Sand-clay mixtures	'Dirty' materials with excess of plastic fines, medium to high dry strength	≥ 12% fines, fines are clayey	N/A

					Field Classification of Silt and Clay		Laboratory Classification
Maj	or Divisions	Group Symbol	Typical Names	Dry Strength	Dilatancy	Toughness	% < 0.075mm
alpr	SILT and CLAY (low to medium	ML	Inorganic silt and very fine sand, rock flour, silty or clayey fine sand or silt with low plasticity	None to low	Slow to rapid	Low	Below A line
ained soils (more than 35% of soil excl oversize fraction is less than 0.075mm)	plasticity)	CL, CI	Inorganic clay of low to medium plasticity, gravelly clay, sandy clay	Medium to high	None to slow	Medium	Above A line
an 35% ssthan		OL	Organic silt	Low to medium	Slow	Low	Below A line
onisle	SILT and CLAY	MH	Inorganic silt	Low to medium	None to slow	Low to medium	Below A line
soils (m te fracti	(high plasticity)	СН	Inorganic clay of high plasticity	High to very high	None	High	Above A line
inegrained soils (more than 35% of soil excluding oversize fraction is less than 0.075mm)		ОН	Organic clay of medium to high plasticity, organic silt	Medium to high	None to very slow	Low to medium	Below A line
.=	Highly organic soil	Pt	Peat, highly organic soil	-	-	-	-

#### Laboratory Classification Criteria


A well graded coarse grained soil is one for which the coefficient of uniformity Cu > 4 and the coefficient of curvature  $1 < C_c < 3$ . Otherwise, the soil is poorly graded. These coefficients are given by:

$$C_U = \frac{D_{60}}{D_{10}}$$
 and  $C_C = \frac{(D_{30})^2}{D_{10} D_{60}}$ 

Where  $D_{10}$ ,  $D_{30}$  and  $D_{60}$  are those grain sizes for which 10%, 30% and 60% of the soil grains, respectively, are smaller.

#### NOTES:

- 1 For a coarse grained soil with a fines content between 5% and 12%, the soil is given a dual classification comprising the two group symbols separated by a dash; for example, for a poorly graded gravel with between 5% and 12% silt fines, the classification is GP-GM.
- 3 Clay soils with liquid limits > 35% and ≤ 50% may be classified as being of medium plasticity.
- 4 The U line on the Modified Casagrande Chart is an approximate upper bound for most natural soils.

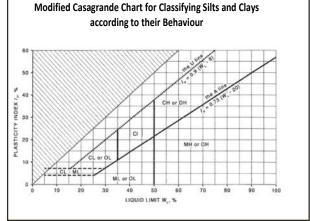

# **JK**Geotechnics



# LOG SYMBOLS

Log Column	Symbol	Definition						
Groundwater Record	<b></b>	Standing water le	vel. Time delay following comp	letion of drilling/excavation may be shown.				
		Extent of borehol	e/test pit collapse shortly after	drilling/excavation.				
		— Groundwater see	page into borehole or test pit n	oted during drilling or excavation.				
Samples	ES		er depth indicated, for environm					
	U50 DB		m diameter tube sample taken mple taken over depth indicate	-				
	DB		ag sample taken over depth indicate					
	ASB		over depth indicated, for asbes					
	ASS		over depth indicated, for acid	-				
	SAL	Soil sample taken	over depth indicated, for salini	ty analysis.				
Field Tests	N = 17 4, 7, 10	figures show blow		etween depths indicated by lines. Individual usal' refers to apparent hammer refusal within				
	N <sub>c</sub> =	5 Solid Cone Penet	ration Test (SCPT) performed b	between depths indicated by lines. Individual				
				0° solid cone driven by SPT hammer. 'R' refers				
		BR to apparent hami	mer refusal within the correspo	nding 150mm depth increment.				
	VNS = 25	Vane shear readir	ng in kPa of undrained shear str	ength.				
	PID = 100		Photoionisation detector reading in ppm (soil sample headspace test).					
Moisture Condition	w > PL	Moisture content	Moisture content estimated to be greater than plastic limit.					
(Fine Grained Soils)	$w \approx PL$		Moisture content estimated to be approximately equal to plastic limit.					
	w < PL		estimated to be less than plast					
	w≈LL		Moisture content estimated to be near liquid limit.					
	w > LL		Moisture content estimated to be wet of liquid limit.					
(Coarse Grained Soils)	D		DRY – runs freely through fingers.					
	M W		MOIST – does not run freely but no free water visible on soil surface. WET – free water visible on soil surface.					
Strength (Consistency) Cohesive Soils	۷S		VERY SOFT – unconfined compressive strength $\leq 25$ kPa.					
Concave Solis	S F		unconfined compressive streng	-				
	St		FIRM– unconfined compressive strength > 50kPa and ≤ 100kPa.STIFF– unconfined compressive strength > 100kPa and ≤ 200kPa.					
	VSt							
	Hd		unconfined compressive streng unconfined compressive streng					
	Fr		strength not attainable, soil cru	-				
	( )		•	ency based on tactile examination or other				
		assessment.						
Density Index/ Relative Density			Density Index (I <sub>D</sub> ) Range (%)	SPT 'N' Value Range (Blows/300mm)				
(Cohesionless Soils)	VL	VERY LOOSE	≤15	0-4				
	L	LOOSE	> 15 and $\leq$ 35	4-10				
	MD	MEDIUM DENSE	$>$ 35 and $\leq$ 65	10 – 30				
	D	DENSE	$> 65 \text{ and } \le 85$	30 – 50				
	VD	VERY DENSE	> 85	> 50				
	()	Bracketed symbo	i indicates estimated density ba	ased on ease of drilling or other assessment.				
Hand Penetrometer Readings	300 250		g in kPa of unconfined compress presentative undisturbed mater	sive strength. Numbers indicate individual rial unless noted otherwise.				

8

**JK**Geotechnics



Log Column	Symbol	Definition	
Remarks	'V' bit	Hardened steel 'V	″ shaped bit.
	'TC' bit	Twin pronged tur	ngsten carbide bit.
	$T_{60}$	Penetration of au without rotation	ger string in mm under static load of rig applied by drill head hydraulics of augers.
	Soil Origin	The geological ori	gin of the soil can generally be described as:
		RESIDUAL	<ul> <li>soil formed directly from insitu weathering of the underlying rock.</li> <li>No visible structure or fabric of the parent rock.</li> </ul>
		EXTREMELY WEATHERED	<ul> <li>soil formed directly from insitu weathering of the underlying rock.</li> <li>Material is of soil strength but retains the structure and/or fabric of the parent rock.</li> </ul>
		ALLUVIAL	- soil deposited by creeks and rivers.
		ESTUARINE	<ul> <li>soil deposited in coastal estuaries, including sediments caused by inflowing creeks and rivers, and tidal currents.</li> </ul>
		MARINE	<ul> <li>soil deposited in a marine environment.</li> </ul>
		AEOLIAN	<ul> <li>soil carried and deposited by wind.</li> </ul>
		COLLUVIAL	<ul> <li>soil and rock debris transported downslope by gravity, with or without the assistance of flowing water. Colluvium is usually a thick deposit formed from a landslide. The description 'slopewash' is used for thinner surficial deposits.</li> </ul>
		LITTORAL	<ul> <li>beach deposited soil.</li> </ul>



# **Classification of Material Weathering**

Term		Abbreviation		Definition	
Residual Soil		RS		Material is weathered to such an extent that it has soil properties. Mass structure and material texture and fabric of original rock are no longer visible, but the soil has not been significantly transported.	
Extremely Weathered		xw		Material is weathered to such an extent that it has soil properties. Mass structure and material texture and fabric of original rock are still visible.	
Highly Weathered	Distinctly Weathered (Note 1)	HW	The whole of the rock material is discoloured, usually by iron staining or bleaching to the extent that the colour of the original rock is not recognisable. Rock strength is significantly changed by weathering. Some primary minerals have weathered to clay minerals. Porosity may be increased by leaching, or may be decreased due to deposition of weathering products in pores.		
Moderately Weathered		MW		The whole of the rock material is discoloured, usually by iron staining or bleaching to the extent that the colour of the original rock is not recognisable, but shows little or no change of strength from fresh rock.	
Slightly Weathered		SW		Rock is partially discoloured with staining or bleaching along joints but shows little or no change of strength from fresh rock.	
Fresh		FR		Rock shows no sign of decomposition of individual minerals or colour changes.	

**NOTE 1:** The term 'Distinctly Weathered' is used where it is not practicable to distinguish between 'Highly Weathered' and 'Moderately Weathered' rock. 'Distinctly Weathered' is defined as follows: 'Rock strength usually changed by weathering. The rock may be highly discoloured, usually by iron staining. Porosity may be increased by leaching, or may be decreased due to deposition of weathering products in pores'. There is some change in rock strength.

# **Rock Material Strength Classification**

			Guide to Strength				
Term	Abbreviation	Uniaxial Compressive Strength (MPa)	Point Load Strength Index Is <sub>(50)</sub> (MPa)	Field Assessment			
Very Low Strength	VL	0.6 to 2	0.03 to 0.1	Material crumbles under firm blows with sharp end of pick; can be peeled with knife; too hard to cut a triaxial sample by hand. Pieces up to 30mm thick can be broken by finger pressure.			
Low Strength	L	2 to 6	0.1 to 0.3	Easily scored with a knife; indentations 1mm to 3mm show in the specimen with firm blows of the pick point; has dull sound under hammer. A piece of core 150mm long by 50mm diameter may be broken by hand. Sharp edges of core may be friable and break during handling.			
Medium Strength	М	6 to 20	0.3 to 1	Scored with a knife; a piece of core 150mm long by 50mm diameter can be broken by hand with difficulty.			
High Strength	н	20 to 60	1 to 3	A piece of core 150mm long by 50mm diameter cannot be broken by hand but can be broken by a pick with a single firm blow; rock rings under hammer.			
Very High Strength	VH	60 to 200	3 to 10	Hand specimen breaks with pick after more than one blow; rock rings under hammer.			
Extremely High Strength	EH	> 200	> 10	Specimen requires many blows with geological pick to break through intact material; rock rings under hammer.			



# Abbreviations Used in Defect Description

Cored Borehole L	.og Column	Symbol Abbreviation	Description
Point Load Streng	gth Index	• 0.6	Axial point load strength index test result (MPa)
		x 0.6	Diametral point load strength index test result (MPa)
Defect Details	– Туре	Ве	Parting – bedding or cleavage
		CS	Clay seam
		Cr	Crushed/sheared seam or zone
		J	Joint
		Jh	Healed joint
		Ji	Incipient joint
		XWS	Extremely weathered seam
	– Orientation	Degrees	Defect orientation is measured relative to normal to the core axis (ie. relative to the horizontal for a vertical borehole)
	– Shape	Р	Planar
		С	Curved
		Un	Undulating
		St	Stepped
		lr	Irregular
	– Roughness	Vr	Very rough
		R	Rough
		S	Smooth
		Ро	Polished
		SI	Slickensided
	– Infill Material	Са	Calcite
		Cb	Carbonaceous
		Clay	Clay
		Fe	Iron
		Qz	Quartz
		Ру	Pyrite
	– Coatings	Cn	Clean
		Sn	Stained – no visible coating, surface is discoloured
		Vn	Veneer – visible, too thin to measure, may be patchy
		Ct	Coating $\leq$ 1mm thick
		Filled	Coating > 1mm thick
	– Thickness	mm.t	Defect thickness measured in millimetres



# **APPENDIX A**

LANDSLIDE RISK MANAGEMENT TERMINOLOGY



## APPENDIX A LANDSLIDE RISK MANAGEMENT

# **Definition of Terms and Landslide Risk**

Risk Terminology	Description
Acceptable Risk	A risk for which, for the purposes of life or work, we are prepared to accept as it is with no regard to its management. Society does not generally consider expenditure in further reducing such risks justifiable.
Annual Exceedance Probability (AEP)	The estimated probability that an event of specified magnitude will be exceeded in any year.
Consequence	The outcomes or potential outcomes arising from the occurrence of a landslide expressed qualitatively or quantitatively, in terms of loss, disadvantage or gain, damage, injury or loss of life.
Elements at Risk	The population, buildings and engineering works, economic activities, public services utilities, infrastructure and environmental features in the area potentially affected by landslides.
Frequency	A measure of likelihood expressed as the number of occurrences of an event in a given time. See also 'Likelihood' and 'Probability'.
Hazard	A condition with the potential for causing an undesirable consequence (the landslide). The description of landslide hazard should include the location, volume (or area), classification and velocity of the potential landslides and any resultant detached material, and the likelihood of their occurrence within a given period of time.
Individual Risk to Life	The risk of fatality or injury to any identifiable (named) individual who lives within the zone impacted by the landslide; or who follows a particular pattern of life that might subject him or her to the consequences of the landslide.
Landslide Activity	The stage of development of a landslide; pre failure when the slope is strained throughout but is essentially intact; failure characterised by the formation of a continuous surface of rupture; post failure which includes movement from just after failure to when it essentially stops; and reactivation when the slope slides along one or several pre-existing surfaces of rupture. Reactivation may be occasional (eg. seasonal) or continuous (in which case the slide is 'active').
Landslide Intensity	A set of spatially distributed parameters related to the destructive power of a landslide. The parameters may be described quantitatively or qualitatively and may include maximum movement velocity, total displacement, differential displacement, depth of the moving mass, peak discharge per unit width, or kinetic energy per unit area.
Landslide Risk	The AGS Australian GeoGuide LR7 (AGS, 2007e) should be referred to for an explanation of Landslide Risk.
Landslide Susceptibility	The classification, and volume (or area) of landslides which exist or potentially may occur in an area or may travel or retrogress onto it. Susceptibility may also include a description of the velocity and intensity of the existing or potential landsliding.
Likelihood	Used as a qualitative description of probability or frequency.
Probability	A measure of the degree of certainty. This measure has a value between zero (impossibility) and 1.0 (certainty). It is an estimate of the likelihood of the magnitude of the uncertain quantity, or the likelihood of the occurrence of the uncertain future event.
	These are two main interpretations:
	<ul> <li>(i) Statistical – frequency or fraction – The outcome of a repetitive experiment of some kind like flipping coins. It includes also the idea of population variability. Such a number is called an 'objective' or relative frequentist probability because it exists in the real world and is in principle measurable by doing the experiment.</li> </ul>



Risk Terminology	Description
Probability	(ii) Subjective probability (degree of belief) – Quantified measure of belief, judgment, or
(continued)	(ii) Subjective probability (degree of belief) – cuantined measure of belief, judgment, of confidence in the likelihood of an outcome, obtained by considering all available information honestly, fairly, and with a minimum of bias. Subjective probability is affected by the state of understanding of a process, judgment regarding an evaluation, or the quality and quantity of information. It may change over time as the state of knowledge changes.
Qualitative Risk Analysis	An analysis which uses word form, descriptive or numeric rating scales to describe the magnitude of potential consequences and the likelihood that those consequences will occur.
Quantitative Risk Analysis	An analysis based on numerical values of the probability, vulnerability and consequences and resulting in a numerical value of the risk.
Risk	A measure of the probability and severity of an adverse effect to health, property or the environment. Risk is often estimated by the product of probability x consequences. However, a more general interpretation of risk involves a comparison of the probability and consequences in a non-product form.
Risk Analysis	The use of available information to estimate the risk to individual, population, property, or the environment, from hazards. Risk analyses generally contain the following steps: scope definition, hazard identification and risk estimation.
Risk Assessment	The process of risk analysis and risk evaluation.
Risk Control or Risk Treatment	The process of decision-making for managing risk and the implementation or enforcement of risk mitigation measures and the re-evaluation of its effectiveness from time to time, using the results of risk assessment as one input.
Risk Estimation	The process used to produce a measure of the level of health, property or environmental risks being analysed. Risk estimation contains the following steps: frequency analysis, consequence analysis and their integration.
Risk Evaluation	The stage at which values and judgments enter the decision process, explicitly or implicitly, by including consideration of the importance of the estimated risks and the associated social, environmental and economic consequences, in order to identify a range of alternatives for managing the risks.
Risk Management	The complete process of risk assessment and risk control (or risk treatment).
Societal Risk	The risk of multiple fatalities or injuries in society as a whole: one where society would have to carry the burden of a landslide causing a number of deaths, injuries, financial, environmental and other losses.
Susceptibility	See 'Landslide Susceptibility'.
Temporal Spatial Probability	The probability that the element at risk is in the area affected by the landsliding, at the time of the landslide.
Tolerable Risk	A risk within a range that society can live with so as to secure certain net benefits. It is a range of risk regarded as non-negligible and needing to be kept under review and reduced further if possible.
Vulnerability	The degree of loss to a given element or set of elements within the area affected by the landslide hazard. It is expressed on a scale of 0 (no loss) to 1 (total loss). For property, the loss will be the value of the damage relative to the value of the property; for persons, it will be the probability that a particular life (the element at risk) will be lost, given the person(s) is affected by the landslide.

**NOTE:** Reference should be made to Figure A1 which shows the inter-relationship of many of these terms and the relevant portion of Landslide Risk Management.

Reference should also be made to the paper referenced below for Landslide Terminology and more detailed discussion of the above terminology.

This appendix is an extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

Standard Sheets\Explanation Notes - Stability Assessment\APPENDIX A Landslide Risk Management June08

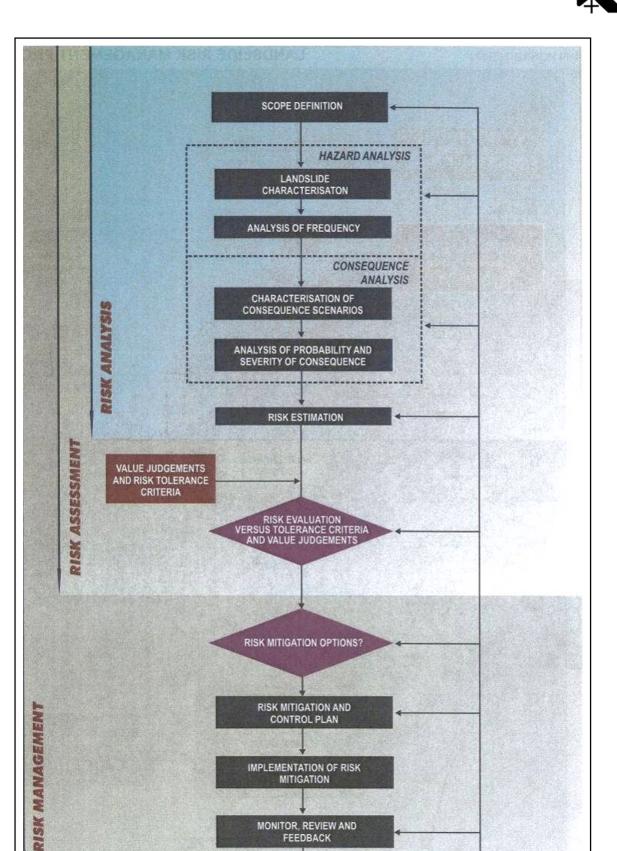


FIGURE A1: Flowchart for Landslide Risk Management.

This figure is an extract from GUIDELINE FOR LANDSLIDE SUSCEPTIBILITY, HAZARD AND RISK ZONING FOR LAND USE PLANNING, as presented in Australian Geomechanics Vol 42, No 1, March 2007, which discusses the matter more fully.

After Fell et al, (2005)

Standard Sheets\Explanation Notes - Stability Assessment\Figure A1 Flowchart for Landslide Risk Management June08



# TABLE A1: LANDSLIDE RISK ASSESSMENTQUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY

#### QUALITATIVE MEASURES OF LIKELIHOOD

Approximate Annual Probability         Implied Indicative L           Indicative         Notional         Recurrence Integration		Description		Descriptor	Level	
Value	Boundary					
10 <sup>-1</sup>	5x10 <sup>-2</sup>	10 years		The event is expected to occur over the design life.	ALMOST CERTAIN	А
10 <sup>-2</sup>	5x10 <sup>-3</sup>	100 years	20 years	The event will probably occur under adverse conditions over the design life.	LIKELY	В
10 <sup>-3</sup>	5x10 <sup>-4</sup>	1000 years	200 years 2000 years	The event could occur under adverse conditions over the design life.	POSSIBLE	С
10-4	5x10 <sup>-5</sup>	10,000 years	20,000 years	The event might occur under very adverse circumstances over the design life.	UNLIKELY	D
10 <sup>-5</sup>	5x10 <sup>-6</sup>	100,000 years	200,000 years	The event is conceivable but only under exceptional circumstances over the design life.	RARE	Е
10 <sup>-6</sup>	<u>ex</u> re	1,000,000 years	200,000 years	The event is inconceivable or fanciful over the design life.	BARELY CREDIBLE	F

Note: (1) The table should be used from left to right; use Approximate Annual Probability or Description to assign Descriptor, not vice versa.

### QUALITATIVE MEASURES OF CONSEQUENCES TO PROPERTY

Approximate Cost of Damage				
Indicative Value	Notional Boundary	- Description	Descriptor	Level
200%	100%	Structure(s) completely destroyed and/or large scale damage requiring major engineering works for stabilisation. Could cause at least one adjacent property major consequence damage.	CATASTROPHIC	1
60%	40%	Extensive damage to most of structure, and/or extending beyond site boundaries requiring significant stabilisation works. Could cause at least one adjacent property medium consequence damage.	MAJOR	2
20%	10%	Moderate damage to some of structure, and/or significant part of site requiring large stabilisation works. Could cause at least one adjacent property minor consequence damage.	MEDIUM	3
5%	1%	Limited damage to part of structure, and/or part of site requiring some reinstatement stabilisation works.	MINOR	4
0.5%	. /0	Little damage. (Note for high probability event (Almost Certain), this category may be subdivided at a notional boundary of 0.1%. See Risk Matrix.)	INSIGNIFICANT	5

Notes: (2) The Approximate Cost of Damage is expressed as a percentage of market value, being the cost of the improved value of the unaffected property which includes the land plus the unaffected structures.

(3) The Approximate Cost is to be an estimate of the direct cost of the damage, such as the cost of reinstatement of the damaged portion of the property (land plus structures), stabilisation works required to render the site to tolerable risk level for the landslide which has occurred and professional design fees, and consequential costs such as legal fees, temporary accommodation. It does not include additional stabilisation works to address other landslides which may affect the property.

(4) The table should be used from left to right; use Approximate Cost of Damage or Description to assign Descriptor, not vice versa.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.

Standard Sheets\Explanation Notes - Stability Assessment\APPENDIX A Table A1 Landslide Risk Assessment June08



# TABLE A1: LANDSLIDE RISK ASSESSMENT QUALITATIVE TERMINOLOGY FOR USE IN ASSESSING RISK TO PROPERTY (continued)

#### QUALITATIVE RISK ANALYSIS MATRIX – LEVEL OF RISK TO PROPERTY

LIKELIHOO	CONSEQUENCES TO PROPERTY (With Indicative Approximate Cost of Damage)					
	Indicative Value of Approximate Annual Probability	1: CATASTROPHIC 200%	2: MAJOR 60%	3: MEDIUM 20%	4: MINOR 5%	5: INSIGNIFICANT 0.5%
A – ALMOST CERTAIN	10 <sup>-1</sup>	VH	VH	VH	Н	M or L (5)
B - LIKELY	10-2	VH	VH	Н	М	L
C - POSSIBLE	10 <sup>-3</sup>	VH	Н	М	М	VL
D - UNLIKELY	10-4	Н	М	L	L	VL
E - RARE	10-5	М	L	L	VL	VL
F - BARELY CREDIBLE	10 <sup>-6</sup>	L	VL	VL	VL	VL

**Notes:** (5) Cell A5 may be subdivided such that a consequence of less than 0.1% is Low Risk.

(6) When considering a risk assessment it must be clearly stated whether it is for existing conditions or with risk control measures which may not be implemented at the current time.

#### RISK LEVEL IMPLICATIONS

Risk Level		Example Implications (7)		
		Unacceptable without treatment. Extensive detailed investigation and research, planning and implementation of		
VH	VERY HIGH RISK	treatment options essential to reduce risk to Low; may be too expensive and not practical. Work likely to cost more		
		than value of the property.		
ц	HIGH RISK	Unacceptable without treatment. Detailed investigation, planning and implementation of treatment options required		
п		to reduce risk to Low. Work would cost a substantial sum in relation to the value of the property.		
		May be tolerated in certain circumstances (subject to regulator's approval) but requires investigation, planning and		
M MODERATE RISK		implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be		
		implemented as soon as practicable.		
		Usually acceptable to regulators. Where treatment has been required to reduce the risk to this level, ongoing		
L LOW RISK		maintenance is required.		
VL	VERY LOW RISK	Acceptable. Manage by normal slope maintenance procedures.		

**Note:** (7) The implications for a particular situation are to be determined by all parties to the risk assessment and may depend on the nature of the property at risk; these are only given as a general guide.

Extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in Australian Geomechanics, Vol 42, No 1, March 2007, which discusses the matter more fully.



### AUSTRALIAN GEOGUIDE LR2 (LANDSLIDES)

#### What is a Landslide?

Any movement of a mass of rock, debris, or earth, down a slope, constitutes a "landslide". Landslides take many forms, some of which are illustrated. More information can be obtained from Geoscience Australia, or by visiting its Australian landslide Database at <u>www.ga.gov.au/urban/factsheets/landslide.jsp</u>. Aspects of the impact of landslides on buildings are dealt with in the book "Guideline Document Landslide Hazards" published by the Australian Building Codes Board and referenced in the Building Code of Australia. This document can be purchased over the internet at the Australian Building Codes Board's website <u>www.abcb.gov.au</u>.

Landslides vary in size. They can be small and localised or very large, sometimes extending for kilometres and involving millions of tonnes of soil or rock. It is important to realise that even a 1 cubic metre boulder of soil, or rock, weighs at least 2 tonnes. If it falls, or slides, it is large enough to kill a person, crush a car, or cause serious structural damage to a house. The material in a landslide may travel downhill well beyond the point where the failure first occurred, leaving destruction in its wake. It may also leave an unstable slope in the ground behind it, which has the potential to fall again, causing the landslide to extend (regress) uphill, or expand sideways. For all these reasons, both "potential" and "actual" landslides must be taken very seriously. The present a real threat to life and property and require proper management.

Identification of landslide risk is a complex task and must be undertaken by a geotechnical practitioner (GeoGuide LR1) with specialist experience in slope stability assessment and slope stabilisation.

#### What Causes a Landslide?

Landslides occur as a result of local geological and groundwater conditions, but can be exacerbated by inappropriate development (GeoGuide LR8), exceptional weather, earthquakes and other factors. Some slopes and cliffs never seem to change, but are actually on the verge of failing. Others, often moderate slopes (Table 1), move continuously, but so slowly that it is not apparent to a casual observer. In both cases, small changes in conditions can trigger a landslide with series consequences. Wetting up of the ground (which may involve a rise in groundwater table) is the single most important cause of landslides (GeoGuide LR5). This is why they often occur during, or soon after, heavy rain. Inappropriate development often results in small scale landslides which are very expensive in human terms because of the proximity of housing and people.

#### Does a Landslide Affect You?

Any slope, cliff, cutting, or fill embankment may be a hazard which has the potential to impact on people, property, roads and services. Some tell-tale signs that might indicate that a landslide is occurring are listed below:

- Open cracks, or steps, along contours
- Groundwater seepage, or springs
- Bulging in the lower part of the slope
- Hummocky ground

- trees leaning down slope, or with exposed roots
- debris/fallen rocks at the foot of a cliff
- tilted power poles, or fences
- cracked or distorted structures

These indications of instability may be seen on almost any slope and are not necessarily confined to the steeper ones (Table 1). Advice should be sought from a geotechnical practitioner if any of them are observed. Landslides do not respect property boundaries. As mentioned above they can "run-out" from above, "regress" from below, or expand sideways, so a landslide hazard affecting your property may actually exist on someone else's land.

Local councils are usually aware of slope instability problems within their jurisdiction and often have specific development and maintenance requirements. Your local council is the first place to make enquiries if you are responsible for any sort of development or own or occupy property on or near sloping land or a cliff.

	Slope	Maximum	
Appearance	Angle	Gradient	Slope Characteristics
Gentle	0° - 10°	1 on 6	Easy walking.
Moderate	10° - 18°	1 on 3	Walkable. Can drive and manoeuvre a car on driveway.
Steep	18° - 27°	1 on 2	Walkable with effort. Possible to drive straight up or down roughened concrete driveway, but cannot practically manoeuvre a car.
Very Steep	27° - 45°	1 on 1	Can only climb slope by clutching at vegetation, rocks, etc.
Extreme	45° - 64°	1 on 0.5	Need rope access to climb slope.
Cliff	64° - 84°	1 on 0.1	Appears vertical. Can abseil down.
Vertical or Overhang	84° - 90±°	Infinite	Appears to overhang. Abseiler likely to lose contact with the face.

#### TABLE 1 – Slope Descriptions


Standard Sheets/Explanation Notes - Stability Assessment/Appendix A Australian Geoguide LR2 (Landslides) June08




Some typical landslides which could affect residential housing are illustrated below:

Rotational or circular slip failures (Figure 1) - can occur on moderate to very steep soil and weathered rock slopes (Table 1). The sliding surface of the moving mass tends to be deep seated. Tension cracks may open at the top of the slope and bulging may occur at the toe. The ground may move in discrete "steps" separated by long periods without movement. More rapid movement may occur after heavy rain.

**Translational slip failures (Figure 2)** - tend to occur on moderate to very steep slopes (Table 1) where soil, or weak rock, overlies stronger strata. The sliding mass is often relatively shallow. It can move, or deform slowly (creep) over long periods of time. Extensive linear cracks and hummocks sometimes form along the contours. The sliding mass may accelerate after heavy rain.

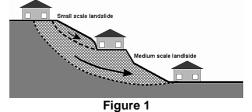

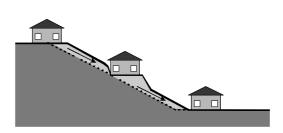


Wedge failures (Figure 3) - normally only occur on extreme slopes, or cliffs (Table 1), where discontinuities in the rock are inclined steeply downwards out of the face.

**Rock falls (Figure 3)** - tend to occur from cliffs and overhangs (Table 1).

Cliffs may remain, apparently unchanged, for hundreds of years. Collections of boulders at the foot of a cliff may indicate that rock falls are ongoing. Wedge failures and rock falls do not "creep". Familiarity with a particular local situation can instil a false sense of security since failure, when it occurs, is usually sudden and catastrophic.

**Debris flows and mud slides (Figure 4)** - may occur in the foothills of ranges, where erosion has formed valleys which slope down to the plains below. The valley bottoms are often lined with loose eroded material (debris) which can "flow" if it becomes saturated during and after heavy rain. Debris flows are likely to occur with little warning; they travel a long way and often involve large volumes of soil. The consequences can be devastating.

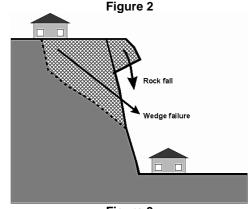



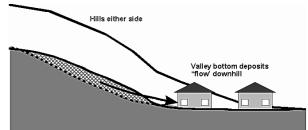


Figure 4

#### More information relevant to your particular situation may be found in other Australian GeoGuides:

- GeoGuide LR1 Introduction
- GeoGuide LR3 Soil Slopes
- GeoGuide LR4 Rock Slopes
- GeoGuide LR5 Water & Drainage
- GeoGuide LR6 Retaining Walls

- GeoGuide LR7 Landslide Risk
- GeoGuide LR8 Hillside Construction
- GeoGuide LR9 Effluent & Surface Water Disposal
- GeoGuide LR10 Coastal Landslides
- GeoGuide LR11 Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the <u>Australian Geomechanics Society</u>, a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.

•

•



# AUSTRALIAN GEOGUIDE LR7 (LANDSLIDE RISK)

#### **Concept of Risk**

Risk is a familiar term, but what does it really mean? It can be defined as "a measure of the probability and severity of an adverse effect to health, property, or the environment." This definition may seem a bit complicated. In relation to landslides, geotechnical practitioners (see GeoGuide LR1) are required to assess risk in terms of the likelihood that a particular landslide will occur and the possible consequences. This is called landslide risk assessment. The consequences of a landslide are many and varied, but our concerns normally focus on loss of, or damage to, property and loss of life.

#### Landslide Risk Assessment

Some local councils in Australia are aware of the potential for landslides within their jurisdiction and have responded by designating specific "landslide hazard zones". Development in these areas is normally covered by special regulations. If you are contemplating building, or buying an existing house, particularly in a hilly area, or near cliffs, then go first for information to your local council. If you have any concern that you could be dealing with a landslide hazard that your local council is not aware of you should seek advice from a geotechnical practitioner.

#### Landslide risk assessment must be undertaken by a geotechnical practitioner. It may involve visual inspection, geological mapping, geotechnical

investigation and monitoring to identify:

- potential landslides (there may be more than one that could impact on your site);
- the likelihood that they will occur;
- the damage that could result;
- the cost of disruption and repairs; and
- the extent to which lives could be lost.

Risk assessment is a predictive exercise, but since the ground and the processes involved are complex, prediction inevitably lacks precision. If you commission a landslide risk assessment for a particular site you should expect to receive a report prepared in accordance with current professional guidelines and in a form that is acceptable to your local council, or planning authority.

#### **Risk to Property**

Table 1 indicates the terms used to describe risk to property. Each risk level depends on an assessment of how likely a landslide is to occur and its consequences in dollar terms. Likelihood is the chance of it happening in any one year, as indicated in Table 2. Consequences are related to the cost of the repairs and perhaps temporary loss of use. These two factors are combined by the geotechnical practitioner to determine the Qualitative Risk.

Qualitative Risk Significance - Geotechnical engineering requirements		Significance - Geotechnical engineering requirements	
Very high	VH	<b>Unacceptable</b> without treatment. Extensive detailed investigation and research, planning and implementation of treatment options essential to reduce risk to Low. May be too expensive and no practical. Work likely to cost more than the value of the property.	
High	н	<b>Unacceptable</b> without treatment. Detailed investigation, planning and implementation of treatment options required to reduce risk to acceptable level. Work would cost a substantial sum in relation to the value of the property.	
Moderate	М	<b>May be tolerated</b> in certain circumstances (subject to regulator's approval) but requires investigation, planning and implementation of treatment options to reduce the risk to Low. Treatment options to reduce to Low risk should be implemented as soon as possible.	
Low	L	<b>Usually acceptable</b> to regulators. Where treatment has been needed to reduce the risk to this level, ongoing maintenance is required.	
Very Low	VL	Acceptable. Manage by normal slope maintenance procedures.	

#### **TABLE 2 – LIKELIHOOD**

Likelihood	Annual Probability
Almost Certain	1:10
Likely	1:100
Possible	1:1,000
Unlikely	1:10,000
Rare	1:100,000
Barely credible	1:1,000,000

The terms "unacceptable", "tolerable" etc. in Table 1 indicate how most people react to an assessed risk level. However, some people will always be more prepared, or better able, to tolerate a higher risk level than others. Some local councils and planning authorities stipulate a maximum tolerable risk level. This may be lower than you feel is reasonable for your block but it is, nonetheless, a pre-requisite for development. Reasons for this include the fact that a landslide on your block may pose a risk to neighbours and passers-by and that , should you sell, subsequent owners of the block may be more risk averse than you.

#### TABLE 1 – RISK TO PROPERTY



#### **Risk to Life**

Most of us have some difficulty grappling with the concept of risk and deciding whether, or not, we are prepared to accept it. However, without doing any sort of analysis, or commissioning a report from an "expert", we all take risks every day. One of them is the risk of being killed in an accident. This is worth thinking about, because it tells us a lot about ourselves and can help to put an assessed risk into a meaningful context. By identifying activities that we either are, or are not, prepared to engage in, we can get some indication of the maximum level of risk that we are prepared to take. This knowledge can help us to decide whether we really are able to accept a particular risk, or to tolerate a particular likelihood of loss, or damage, to our property (Table 2).

In Table 3, data from NSW for the years 1998 to 2002, and other sources, is presented. A risk of 1 in 100,000 means that, in any one year, 1 person is killed for every 100,000 people undertaking that particular activity. The NSW data assumes that the whole population undertakes the activity. That is, we are all at risk of being killed in a fire, or of choking on our food, but it is reasonable to assume that only people who go deep sea fishing run a risk of being killed while doing it.

It can be seen that the risks of dying as a result of falling, using a motor vehicle, or engaging in waterrelated activities (including bathing) are all greater than 1:100,000 and yet few people actively avoid situations where these risks are present. Some people are averse to flying and yet it represents a lower risk than choking to death on food. The data also indicate that, even when the risk of dying as a consequence of a particular event is very small, it could still happen to any one of us today. If this were not so, there would be no risk at all and clearly that is not the case. In NSW, the planning authorities consider that 1:1,000,000 is the maximum tolerable risk for domestic housing built near an obvious hazard, such as a chemical factory. Although not specifically considered in the NSW guidelines there is little difference between the hazard presented by a neighbouring factory and a landslide: both have the capacity to destroy life and property and both are always present.

#### TABLE 3 – RISK TO LIFE

Risk (deaths per participant per year)	Activity/Event Leading to Death (NSW data unless noted)
1:1,000	Deep sea fishing (UK)
1:1,000 to 1:10,000	Motor cycling, horse riding , ultra-light flying (Canada)
1:23,000	Motor vehicle use
1:30,000	Fall
1:70,000	Drowning
1:180,000	Fire/burn
1:660,000	Choking on food
1:1,000,000	Scheduled airlines (Canada)
1:2,300,000	Train travel
1:32,000,000	Lightning strike

#### More information relevant to your particular situation may be found in other AUSTRALIAN GEOGUIDES:

GeoGuide LR4	- Landslides - Landslides in Soil - Landslides in Rock	<ul><li>GeoGuide LR8</li><li>GeoGuide LR9</li><li>GeoGuide LR10</li></ul>	- Retaining Walls - Hillside Construction - Effluent & Surface Water Disposal ) - Coastal Landslides
GeoGuide LR5	- Water & Drainage	<ul> <li>GeoGuide LR11</li> </ul>	I - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the Australian Geomechanics Society, a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.



# **APPENDIX B**

# SOME GUIDELINES FOR HILLSIDE CONSTRUCTION



## APPENDIX B - SOME GUIDELINES FOR HILLSIDE CONSTRUCTION

GOOD ENGINEERING PRACTICE

POOR ENGINEERING PRACTICE

ADVICE	GOOD ENGINEERING PRACTICE	FOOR ENGINEERING FRACTICE
GEOTECHNICAL ASSESSMENT	Obtain advice from a qualified, experienced geotechnical consultant at early stage of planning and before site works.	Prepare detailed plan and start site works before geotechnical advice.
PLANNING		
SITE PLANNING	Having obtained geotechnical advice, plan the development with the risk arising from the identified hazards and consequences in mind.	Plan development without regard for the Risk.
DESIGN AND CONSTRUC	TION	
HOUSE DESIGN	Use flexible structures which incorporate properly designed brickwork, timber or steel frames, timber or panel cladding. Consider use of split levels. Use decks for recreational areas where appropriate.	Floor plans which require extensive cutting and filling. Movement intolerant structures.
SITE CLEARING	Retain natural vegetation wherever practicable.	Indiscriminately clear the site.
ACCESS & DRIVEWAYS	Satisfy requirements below for cuts, fills, retaining walls and drainage. Council specifications for grades may need to be modified. Driveways and parking areas may need to be fully supported on piers.	Excavate and fill for site access before geotechnical advice.
EARTHWORKS	Retain natural contours wherever possible.	Indiscriminant bulk earthworks.
CUTS	Minimise depth. Support with engineered retaining walls or batter to appropriate slope. Provide drainage measures and erosion control.	Large scale cuts and benching. Unsupported cuts. Ignore drainage requirements.
FILLS	Minimise height. Strip vegetation and topsoil and key into natural slopes prior to filling. Use clean fill materials and compact to engineering standards. Batter to appropriate slope or support with engineered retaining wall. Provide surface drainage and appropriate subsurface drainage.	Loose or poorly compacted fill, which if it fails, may flow a considerable distance (including onto properties below). Block natural drainage lines. Fill over existing vegetation and topsoil. Include stumps, trees, vegetation, topsoil, boulders, building rubble etc. in fill.
ROCK OUTCROPS & BOULDERS	Remove or stabilise boulders which may have unacceptable risk. Support rock faces where necessary.	Disturb or undercut detached blocks or boulders.
RETAINING WALLS	Engineer design to resist applied soil and water forces. Found on bedrock where practicable. Provide subsurface drainage within wall backfill and surface drainage on slope above. Construct wall as soon as possible after cut/fill operation.	Construct a structurally inadequate wall such as sandstone flagging, brick or unreinforced blockwork. Lack of subsurface drains and weepholes.
FOOTINGS	Found within bedrock where practicable. Use rows of piers or strip footings oriented up and down slope. Design for lateral creep pressures if necessary. Backfill footing excavations to exclude ingress of surface water.	Found on topsoil, loose fill, detached boulders or undercut cliffs.
SWIMMING POOLS	Engineer designed. Support on piers to rock where practicable. Provide with under-drainage and gravity drain outlet where practicable. Design for high soil pressures which may develop on uphill side whilst there may be little or no lateral support on downhill side.	
DRAINAGE SURFACE	Provide at tops of cut and fill slopes. Discharge to street drainage or natural water courses. Provide generous falls to prevent blockage by siltation and incorporate silt traps. Line to minimise infiltration and make flexible where possible. Special structures to dissipate energy at changes of slope and/or direction.	Discharge at top of fills and cuts. Allow water to pond bench areas.
SUBSURFACE	Provide filter around subsurface drain. Provide drain behind retaining walls. Use flexible pipelines with access for maintenance. Prevent inflow of surface water.	Discharge of roof run-off into absorption trenches.
SEPTIC & SULLAGE	Usually requires pump-out or mains sewer systems; absorption trenches may be possible in some areas if risk is acceptable. Storage tanks should be water-tight and adequately founded.	Discharge sullage directly onto and into slopes. Use of absorption trenches without consideration of landslide risk.
EROSION CONTROL & LANDSCAPING	Control erosion as this may lead to instability. Revegetate cleared area.	Failure to observe earthworks and drainage recommendations when landscaping.
DRAWINGS	Building Application drawings should be viewed by a geotechnical consultant.	
SITE VISITS	Site visits by consultant may be appropriate during construction.	
INSPECTION AND MAINT	ENANCE BY OWNER	
OWNER'S RESPONSIBILITY	Clean drainage systems; repair broken joints in drains and leaks in supply pipes. Where structural distress is evident seek advice.	
	If seepage observed, determine cause or seek advice on consequences.	


This table is an extract from PRACTICE NOTE GUIDELINES FOR LANDSLIDE RISK MANAGEMENT as presented in *Australian Geomechanics*, Vol 42, No 1, March 2007 which discusses the matter more fully.

## **AUSTRALIAN GEOGUIDE LR8 (CONSTRUCTION PRACTICE)**



#### HILLSIDE CONSTRUCTION PRACTICE

Sensible development practices are required when building on hillsides, particularly if the hillside has more than a low risk of instability (GeoGuide LR7). Only building techniques intended to maintain, or reduce, the overall level of landslide risk should be considered. Examples of good hillside construction practice are illustrated below.

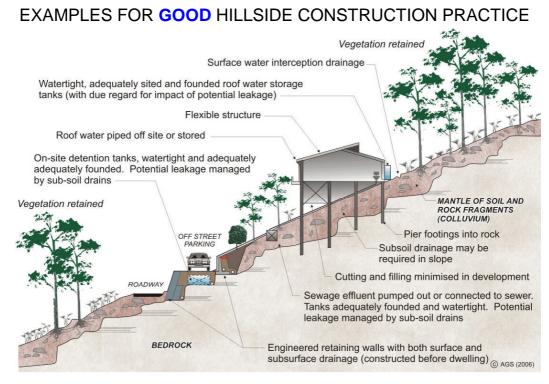

#### WHY ARE THESE PRACTICES GOOD?

**Roadways and parking areas -** are paved and incorporate kerbs which prevent water discharging straight into the hillside (GeoGuide LR5).

Cuttings - are supported by retaining walls (GeoGuide LR6).

**Retaining walls -** are engineer designed to withstand the lateral earth pressures and surcharges expected, and include drains to prevent water pressures developing in the backfill. Where the ground slopes steeply down towards the high side of a retaining wall, the disturbing force (see GeoGuide LR6) can be two or more times that due to level ground. Retaining walls must be designed taking these forces into account.

Sewage - whether treated or not is either taken away in pipes or contained in properly founded tanks so it cannot soak into the ground.

**Surface water** - from roofs and other hard surfaces is piped away to a suitable discharge point rather than being allowed to infiltrate into the ground. Preferably, the discharge point will be in a natural creek where ground water exits, rather than enters, the ground. Shallow, lined, drains on the surface can fulfill the same purpose (GeoGuide LR5).

**Surface loads** - are minimised. No fill embankments have been built. The house is a lightweight structure. Foundation loads have been taken down below the level at which a landslide is likely to occur and, preferably, to rock. This sort of construction is probably not applicable to soil slopes (GeoGuide LR3). If you are uncertain whether your site has rock near the surface, or is essentially a soil slope, you should engage a geotechnical practitioner to find out.

**Flexible structures -** have been used because they can tolerate a certain amount of movement with minimal signs of distress and maintain their functionality.

**Vegetation clearance** - on soil slopes has been kept to a reasonable minimum. Trees, and to a lesser extent smaller vegetation, take large quantities of water out of the ground every day. This lowers the ground water table, which in turn helps to maintain the stability of the slope. Large scale clearing can result in a rise in water table with a consequent increase in the likelihood of a landslide (GeoGuide LR5). An exception may have to be made to this rule on steep rock slopes where trees have little effect on the water table, but their roots pose a landslide hazard by dislodging boulders.


Possible effects of ignoring good construction practices are illustrated on page 2. Unfortunately, these poor construction practices are not as unusual as you might think and are often chosen because, on the face of it, they will save the developer, or owner, money. You should not lose sight of the fact that the cost and anguish associated with any one of the disasters illustrated, is likely to more than wipe out any apparent savings at the outset.

#### ADOPT GOOD PRACTICE ON HILLSIDE SITES

Extract from Geoguide LR8 – Hillside Construction Practice



# EXAMPLES FOR **POOR** HILLSIDE CONSTRUCTION PRACTICE

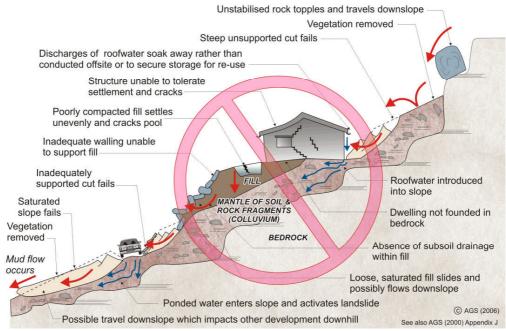

#### WHY ARE THESE PRACTICES POOR?

Roadways and parking areas - are unsurfaced and lack proper table drains (gutters) causing surface water to pond and soaks into the ground.

**Cut and fill -** has been used to balance earthworks quantities and level the site leaving unstable cut faces and added large surface loads to the ground. Failure to compact the fill properly has led to settlement, which will probably continue for several years after completion. The house and pool have been built on the fill and have settled with it and cracked. Leakage from the cracked pool and the applied surface loads from the fill have combined to cause landslides.

**Retaining walls** - have been avoided, to minimise cost, and hand placed rock walls used instead. Without applying engineering design principles, the walls have failed to provide the required support to the ground and have failed, creating a very dangerous situation.

**A heavy, rigid, house** - has been built on shallow, conventional, footings. Not only has the brickwork cracked because of the resulting ground movements, but it has also become involved in a man-made landslide.

**Soak-away drainage -** has been used for sewage and surface water run-off from roofs and pavements. This water soaks into the ground and raises the water table (GeoGuide LR5). Subsoil drains that run along the contours should be avoided for the same reason. If felt necessary, subsoil drains should run steeply downhill in a chevron, or herringbone, pattern. This may conflict with the requirements for effluent and surface water disposal (GeoGuide LR9) and if so, you will need to seek professional advice.

**Rock debris** - from landslides higher up on the slope seems likely to pass through the site. Such locations are often referred to by geotechnical practitioners as "debris flow paths". Rock is normally even denser than ordinary fill, so even quite modest boulders are likely to weigh many tonnes and do a lot of damage once they start to roll. Boulders have been known to travel hundreds of metres downhill leaving behind a trail of destruction.

**Vegetation** - has been completely cleared, leading to a possible rise in the water table and increased landslide risk (GeoGuide LR5).

#### DON'T CUT CORNERS ON HILLSIDE SITES - OBTAIN ADVICE FROM A GEOTECHNICAL PRACTITIONER

#### More information relevant to your particular situation may be found in other Australian GeoGuides:

•	GeoGuide LR1	- Introduction	•	GeoGuide LR6 - Retaining Walls
•	GeoGuide LR2	- Landslides	•	GeoGuide LR7 - Landslide Risk
•	GeoGuide LR3	- Landslides in Soil	•	GeoGuide LR9 - Effluent & Surface Water Disposal
•	GeoGuide LR4	- Landslides in Rock	•	GeoGuide LR10 Coastal Landslides
•	GeoGuide LR5	- Water & Drainage	•	GeoGuide LR11 - Record Keeping

The Australian GeoGuides (LR series) are a set of publications intended for property owners; local councils; planning authorities; developers; insurers; lawyers and, in fact, anyone who lives with, or has an interest in, a natural or engineered slope, a cutting, or an excavation. They are intended to help you understand why slopes and retaining structures can be a hazard and what can be done with appropriate professional advice and local council approval (if required) to remove, reduce, or minimise the risk they represent. The GeoGuides have been prepared by the <u>Australian Geomechanics Society</u>, a specialist technical society within Engineers Australia, the national peak body for all engineering disciplines in Australia, whose members are professional geotechnical engineers and engineering geologists with a particular interest in ground engineering. The GeoGuides have been funded under the Australian governments' National Disaster Mitigation Program.

Extract from Geoguide LR8 – Hillside Construction Practice.

Standard Sheets\Explanation Notes - Stability Assessment\APPENDIX A Examples of Good and Poor Hillside Construction June08



# **APPENDIX C. ON-SITE DETENTION CHECKLIST**



# Appendix 16 – On-site Detention Checklist

This checklist is to be used to determine the on-site stormwater disposal requirement for developments and must be completed and included with the submission of any development application for these works. Please read this form carefully for its notes, guidelines, definition and relevant policies.

For assistance and support, please contact Council's Development Engineering and Certification team on 1300 434 434.

Part 1 Location of the Property				
House Humber	3	Legal Property Descript	ion	
Street	Central Road	Lot	27	
Suburb	Avalon Beach	Section	Null	
Postcode	2107	DP	DP9151	

Part 2 Site Details			
Northern Beaches Stormwater Regions (refer to Map 2 of Northern Beaches Council's Water Management for Development policy)	1	Total Site Area	1,417m²
Pre-Development Impervious Area	457m <sup>2</sup>	Post-Development Impervious Area	799m²
Is the site of the development located with referred to Council's Local Environmental	Yes 🗆 No 🗹		
If yes, On-site stormwater Detention syster to part 5 of this checklist If no, please proceed to part 3 of this chec			

#### Part 3: Northern Beaches Stormwater Regions

(refer to Map 2 of Northern Beaches Council's Water Management for Development policy)

If the site of the development located within Region 1, please proceed to the part 4.1 of this checklist

If the site of the development located within Region 2, please proceed to the part 4.2 of this checklist

If the site of the development located within Region 3, please proceed to the part 4.3 of this checklist

If the site of the development located within Region 4, please refer to Council's Warriewood Valley Water Management Specification.



#### Part 4 Determination of OSD Requirements

#### Part 4.1 Northern Beaches Stormwater Region 1

Is the additional impervious area of the development more than 50  $\rm m^2\,on$  a cumulative basis since February 1996?

Yes 🚺 No 🗆

If yes, OSD is required and please refer to section 9.3.1 of Council's Water Management for Development Policy

If no, OSD is not required and please proceed to the part 5 of this checklist

Part 4.2 Northern Beaches Stormwater Region 2					
Part 4.2.1 Description of Work					
Residential flat building, commercial, industrial, multiple occupancy development and subdivisions resulting in the creation of three lots or more, will require OSD in all case. Please provide a design in accordance with the section 9.3.2 of Council's Water Management for Development Policy. Any single residential building development, please proceed to part 4.2.2 of this checklist.					
Part 4.2.2 Exemption					
Is the site area less th	an 450m²?	Yes 🗆 No 🗆			
to pass through a drai	Does the site of the development drain directly to the ocean without the need to pass through a drainage control structure such as pipe, bridge, culvert, kerb and gutter or natural drainage system?				
Is it an alternation and	addition development to the existing dwellings?	Yes 🗆 No 🗆			
	ove questions, OSD is not required. questions, proceed to part 4.2.3				
Part 4.2.3 Determina	tion of OSD Requirements				
Calculation a) Site area $m^2 \times 0.40 (40\%) = \dots m^2$ b) Post- development impervious area = $\dots m^2$					
OSD will not be required when (a) is greater than (b) Is OSD required for this development (tick one only) Yes □ No □					
If yes, provide a design in accordance with the section 9.3.2 of Council's Water Management for Development Policy. If no, OSD is not required and please proceed to part 5 of this checklist.					



#### Part 4.3 Northern Beaches Stormwater Region 3

#### Part 4.3.1 Stormwater Zone

In the region, the method of stormwater control to be applied shall depend on the location of the site. Please refer to Map 3 of Northern Beaches Council's Water Management for Development policy.

If the site of the development located within stormwater zone 1, please proceed to the part 4.3.2 of this checklist

If the site of the development located within stormwater zone 2, please provide a design in accordance with the section 9.3.3.3 of Council's Water Management for Development Policy.

If the site of the development located within stormwater zone 3, please provide a design in accordance with the section 9.3.3.4 of Council's Water Management for Development Policy.

If the site of the development located within stormwater zone 4, please provide a design in accordance with the section 9.3.3.5 of Council's Water Management for Development Policy.

#### Part 4.3.2 Determination of OSD requirements in Stormwater Zone 1

Part 4.3.2.1 For A New Building					
1) Exemption	a) Is the site area less than 400? b) Is the post-development impervious area less than 190 m <sup>2</sup> ? Yes D No D				
	If yes to both questions, OSD is not required. If no to any of the above questions, please process to calculation				
2) Calculation	a) Site aream <sup>2</sup> x 0.35 =m <sup>2</sup> + 50 =m <sup>2</sup> b) Post- development impervious aream <sup>2</sup>				
	OSD will not be required when (b) is less than 250 m <sup>2</sup> and (a) is greater than (b) Is OSD required for this development? Yes $\Box$ No $\Box$				
	If yes, provide a design in accordance with the section 9.3.3.2 of Council's Water Management for Development Policy. If no, OSD is not required and please proceed to part 5.				
Part 4.3.2.2 For	Alterations and Additions				
If the current impervious area of the site is more than 60% of the site area, OSD will be required. Alternatively, please proceed to the next calculation section.					

	Alternatively, please proceed to the next calculation section.		
		Is the post development impervious area increased by less than 50 m <sup>2</sup> ? Yes $\Box$ No $\Box$ Is the post development impervious area less than 60% of the site area? Yes $\Box$ No $\Box$	
		If yes to both questions, OSD is not required. If no to any of the above questions, provide a design in accordance with section 9.3.3.2 of Council's Water Management for Development Policy	



# Part 5 Disposal of Stormwater Does the site fall naturally towards the street? Yes ♥ No □ If yes, provide a design in accordance with section 5.1 of Council's Water Management for Development Policy. If no, provide a design in accordance with section 5.5 of Council's Water Management for Development

Policy.

 Definitions


 Designed to help you fill out this application

 Site area: This refers to the area of the land bounded by its existing or proposed boundaries.

 Impervious area: This refers to driveways, parking spaces, pathways, paved areas, hardstand areas, roofed areas, garages and outbuildings.

 Pre Development Impervious area: This refers all impervious areas of the site before the development.

 Post Development Impervious areas: This refers all the impervious areas within the site after the development is completed.

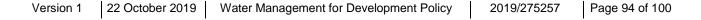



# **APPENDIX D. MAINTENANCE & MONITORING SCHEDULE**

Job No.: 172579 Author Name: Danya Leiva Date: 31 July 2020 Signature:

# **PROJECT ADDRESS: 3 Central Road, Avalon Beach**

# **General Notes:**

- 1. Maintenance is to be carried out with regard to relevant occupational health and safety guidelines and standards. This includes all confined space, traffic management, fall arrest and other requirements.
- 2. Initial monitoring and inspections of the stormwater system post commissioning are to be carried out every 3 months for the first year of operation. The amount and type of debris is to be noted and recorded. This information shall be used to determine if modification of the frequency of inspections is required.
- 3. The frequency of inspections shown in the stormwater maintenance schedule are the maximum periods. Inspection frequencies may be reduced upon completion of the initial monitoring and inspection program as noted in note 2.
- 4. Blank copies of the maintenance schedule are to be made and filled out during each subsequent inspection with the details kept on site for future reference.

Inspected by: .....

Date of Inspection:

Date of Next Inspection:

Item to be Inspected	Frequency	Performed by	Inspected	Maintenance Required	Maintenance Procedure	Maintenance Completed
			Yes/No	Yes/No		Date
General						
Eaves/Box Guttering System and Downpipes	Six Monthly/ After Major Storm	Owner / Maintenance Contractor			Inspect and remove any build up of sediment, debris, litter and vegetation within gutter system.	
Stormwater surface inlet and junction pits	Four Monthly/ After Major Storm	Owner / Maintenance Contractor			Remove grate and inspect internal walls and base, repair where required. Remove any collected sediment, debris, litter and vegetation. (e.g. Vacuum/eductor truck) Inspect and ensure grate is clear of sediment, debris, litter and vegetation. Ensure flush placement of grate on refitment	
General inspection of complete stormwater drainage system (that's visible)	Bi-annually	Owner / Maintenance Contractor			Inspect all drainage structures noting any dilapidation, carry out required repairs.	



## HYDRAULIC | CIVIL | FIRE

Rainwater Tank			
First Flush Pit 6 Monthly		Owner / Maintenance Contractor	Inspect first flush device to ensure correct op accumulated litter & debris. If device is not fu or replace.
Internal Inspection 6 Monthly		Owner / Maintenance Contractor	Check for evidence of access by animals, bird the presence of mosquito larvae. If present, ic close. If evidence of algal growth, find and clo
Tank and tank roof   6 Monthly		Owner / Maintenance Contractor	Check structural integrity of tank including roo Any dilapidation including holes or gaps are to
Proprietary Treatment Devices	1	1	
Construction Cuard Defar Manufactures Manual L		Maintenance / Specialised Contractor	Refer to manufacturers operation and mainte
OceanProtect PSorb StormFilter Cartridges Refer Manufactures Manual		Maintenance / Specialised Contractor	Refer to manufacturers operation and mainte
On-Site Detention Tank	1		
Trash Screen Six Monthly/ After Major Storm		Owner / Maintenance Contractor	Inspect trash screen to ensure correct operat accumulated litter & debris. If device is not fur or replace.
Orifice Plate Six Monthly/ After Major Storm		Owner / Maintenance Contractor	Inspect orifice plate to ensure correct operation diameter size is correct and no damage is pre Check orifice plate is securely fastened to wa between plate and face of wall. If gaps are pre mortar to provide water tight seal.
Tank and tank roof 6 Monthly		Owner / Maintenance Contractor	Check structural integrity of tank including roo Any dilapidation including holes or gaps are to



peration. Remove unctioning properly repair	
rds or insects including identify access point and ose points of light entry.	
oof and access covers. to be noted and repaired.	
enance manual.	
enance manual.	
tion. Remove unctioning properly repair	
ion. Check orifice resent to orifice edge. all with no gaps present resent fill with sealant or	
oof and access covers. to be noted and repaired.	