

**GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER**  
**FORM NO. 1 – To be submitted with Development Application**

Development Application for \_\_\_\_\_  
Name of Applicant

Address of site 58 Whale Beach Road, Avalon

*The following checklist covers the minimum requirements to be addressed in a Geotechnical Risk Declaration made by geotechnical engineer or engineering geologist or coastal engineer (where applicable) as part of a geotechnical report*

I, Ben White on behalf of White Geotechnical Group Pty Ltd  
(Insert Name) (Trading or Company Name)

on this the 8/7/22 certify that I am a geotechnical engineer or engineering geologist or coastal engineer as defined by the Geotechnical Risk Management Policy for Pittwater - 2009 and I am authorised by the above organisation/company to issue this document and to certify that the organisation/company has a current professional indemnity policy of at least \$10million.

I:

**Please mark appropriate box**

- ☒ have prepared the detailed Geotechnical Report referenced below in accordance with the Australia Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- ☒ am willing to technically verify that the detailed Geotechnical Report referenced below has been prepared in accordance with the Australian Geomechanics Society's Landslide Risk Management Guidelines (AGS 2007) and the Geotechnical Risk Management Policy for Pittwater - 2009
- ☐ have examined the site and the proposed development in detail and have carried out a risk assessment in accordance with Section 6.0 of the Geotechnical Risk Management Policy for Pittwater - 2009. I confirm that the results of the risk assessment for the proposed development are in compliance with the Geotechnical Risk Management Policy for Pittwater - 2009 and further detailed geotechnical reporting is not required for the subject site.
- ☐ have examined the site and the proposed development/alteration in detail and I am of the opinion that the Development Application only involves Minor Development/Alteration that does not require a Geotechnical Report or Risk Assessment and hence my Report is in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009 requirements.
- ☐ have examined the site and the proposed development/alteration is separate from and is not affected by a Geotechnical Hazard and does not require a Geotechnical Report or Risk Assessment and hence my Report is in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009 requirements.
- ☐ have provided the coastal process and coastal forces analysis for inclusion in the Geotechnical Report


**Geotechnical Report Details:**

Report Title: Geotechnical Report 58 Whale Beach Road, Avalon  
Report Date: 8/7/22  
  
Author: BEN WHITE  
  
Author's Company/Organisation: WHITE GEOTECHNICAL GROUP PTY LTD

**Documentation which relate to or are relied upon in report preparation:**

Australian Geomechanics Society Landslide Risk Management March 2007.  
White Geotechnical Group company archives.

I am aware that the above Geotechnical Report, prepared for the abovementioned site is to be submitted in support of a Development Application for this site and will be relied on by Pittwater Council as the basis for ensuring that the Geotechnical Risk Management aspects of the proposed development have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk.

Signature   
Name Ben White  
Chartered Professional Status MScGEOLAusIMM CP GEOL  
Membership No. 222757  
Company White Geotechnical Group Pty Ltd

**GEOTECHNICAL RISK MANAGEMENT POLICY FOR PITTWATER**  
**FORM NO. 1(a) - Checklist of Requirements for Geotechnical Risk Management Report for Development Application**

Development Application for	Name of Applicant
Address of site	<u>58 Whale Beach Road, Avalon</u>

The following checklist covers the minimum requirements to be addressed in a Geotechnical Risk Management Geotechnical Report. This checklist is to accompany the Geotechnical Report and its certification (Form No. 1).

**Geotechnical Report Details:**

Report Title: Geotechnical Report <u>58 Whale Beach Road, Avalon</u>
Report Date: <u>8/7/22</u>
Author: <u>BEN WHITE</u>
Author's Company/Organisation: <u>WHITE GEOTECHNICAL GROUP PTY LTD</u>

**Please mark appropriate box**

- ☒ Comprehensive site mapping conducted 10/5/22  
(date)
- ☒ Mapping details presented on contoured site plan with geomorphic mapping to a minimum scale of 1:200 (as appropriate)
- ☒ Subsurface investigation required
  - ☐ No Justification \_\_\_\_\_
  - ☒ Yes Date conducted 10/5/22
- ☒ Geotechnical model developed and reported as an inferred subsurface type-section
- ☒ Geotechnical hazards identified
  - ☒ Above the site
  - ☒ On the site
  - ☒ Below the site
  - ☐ Beside the site
- ☒ Geotechnical hazards described and reported
- ☒ Risk assessment conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
  - ☒ Consequence analysis
  - ☒ Frequency analysis
- ☒ Risk calculation
- ☒ Risk assessment for property conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
- ☒ Risk assessment for loss of life conducted in accordance with the Geotechnical Risk Management Policy for Pittwater - 2009
- ☒ Assessed risks have been compared to "Acceptable Risk Management" criteria as defined in the Geotechnical Risk Management Policy for Pittwater - 2009
- ☒ Opinion has been provided that the design can achieve the "Acceptable Risk Management" criteria provided that the specified conditions are achieved.
- ☒ Design Life Adopted:
  - ☒ 100 years
  - ☐ Other \_\_\_\_\_  
specify
- ☒ Geotechnical Conditions to be applied to all four phases as described in the Geotechnical Risk Management Policy for Pittwater - 2009 have been specified
- ☒ Additional action to remove risk where reasonable and practical have been identified and included in the report.
- ☐ Risk assessment within Bushfire Asset Protection Zone.

I am aware that Pittwater Council will rely on the Geotechnical Report, to which this checklist applies, as the basis for ensuring that the geotechnical risk management aspects of the proposal have been adequately addressed to achieve an "Acceptable Risk Management" level for the life of the structure, taken as at least 100 years unless otherwise stated, and justified in the Report and that reasonable and practical measures have been identified to remove foreseeable risk.

  
Signature \_\_\_\_\_  
Name Ben White  
Chartered Professional Status MScGEOLAusIMM CP GEOL  
Membership No. 222757  
Company White Geotechnical Group Pty Ltd

## **GEOTECHNICAL INVESTIGATION:**

Alterations and Additions and New Pool and Granny Flat at **58 Whale Beach Road, Avalon**

### **1. Proposed Development**

- 1.1** Construct an extension to the downhill side of the house.
- 1.2** Install a pool on the downhill side of the property.
- 1.3** Construct a granny flat on the downhill side of the property.
- 1.4** Construct a carport and storage room on the uphill side of the property by excavating to a maximum depth of ~1.6m.
- 1.5** Various other minor internal and external additions and alterations.
- 1.6** Details of the proposed development are shown on 12 drawings prepared by Markham-Lee Architecture, drawings numbered DA00 to DA09, DA11, and DA12, dated 7.7.22.

### **2. Site Description**

- 2.1** The site was inspected on the 10<sup>th</sup> May, 2022.
- 2.2** This residential property is on the low side of the road and has a W aspect. It is located on the gently to moderately graded upper reaches of a hillslope. The natural slope falls across the property at an average angle of ~7°. The slope above the property increases in grade to the crest of the slope, and the slope below the property continues at similar angles.
- 2.3** At the road frontage, a concrete driveway runs to a parking area on the uphill side of the property, and past the house to a carport on the downhill side of the property (Photo 1 & 2). The carport is to be demolished as part of the proposed works.

A ~0.8m high rendered masonry retaining wall supports a fill for a garden bed in between the road frontage and the house (Photo 3). There is some small stepped cracking through the render present, but otherwise the wall is in good condition. The two-storey rendered brick house is supported on external brick walls. The external brick walls show no significant signs of movement. A stable rendered masonry retaining wall reaching up to ~1.0m in height supports a cut for a gently sloping patio area on the downhill side of the house (Photo 4). A gently sloping lawn area extends from the downhill side of the patio to a metal shed at the lower common boundary (Photo 5).

### **3. Geology**

The Sydney 1:100 000 Geological sheet indicates the site is underlain by the Newport Formation of the Narrabeen Group. This is described as interbedded laminite, shale and quartz to lithic quartz sandstone.

### **4. Subsurface Investigation**

Five Dynamic Cone Penetrometer (DCP) tests were put down to determine the relative density of the overlying soil and the depth to weathered rock. The locations of the tests are shown on the site plan attached. It should be noted that a level of caution should be applied when interpreting DCP test results. The test will not pass through hard buried objects so in some instances it can be difficult to determine whether refusal has occurred on an obstruction in the profile or on the natural rock surface. This is not expected to be an issue for the testing on this site. However, excavation and foundation budgets should always allow for the possibility that the interpreted ground conditions in this report vary from those encountered during excavations. See the appended "Important information about your report" for a more comprehensive explanation. The results are as follows:

**DCP RESULTS ON THE NEXT PAGE**

DCP TEST RESULTS – Dynamic Cone Penetrometer					
Equipment: 9kg hammer, 510mm drop, conical tip.			Standard: AS1289.6.3.2 - 1997		
Depth(m) Blows/0.3m	DCP 1 (~RL27.7)	DCP 2 (~RL28)	DCP 3 (~RL28.3)	DCP 4 (~RL28.5)	DCP 5 (~RL29.4)
0.0 to 0.3	6	5	6	5	3
0.3 to 0.6	8	7	5	4	3
0.6 to 0.9	6	8	4	5	6
0.9 to 1.2	7	8	8	9	7
1.2 to 1.5	9	14	12	11	12
1.5 to 1.8	21	25	21	18	14
1.8 to 2.1	30	32	34	28	29
2.1 to 2.4	#	#	#	39	#
2.4 to 2.7				#	
	End of Test @ 2.1m	End of Test @ 2.1m	End of Test @ 2.1m	End of Test @ 2.4m	End of Test @ 2.1m

#refusal/end of test. F=DCP fell after being struck showing little resistance through all or part of the interval.

### DCP Notes:

DCP1 – End of test @ 2.1m, DCP still going down slowly, red clay on dry tip, wet sandy clay smeared up DCP.

DCP2 – End of test @ 2.1m, DCP still going down slowly red clay on dry tip, wet sandy clay smeared up DCP.

DCP3 – End of test @ 2.1m, DCP still going down slowly, yellow brown clay on wet tip.

DCP4 – End of test @ 2.4m, DCP still going down slowly, yellow brown clay on wet tip.

DCP5 – End of test @ 2.1m, DCP still going down slowly, yellow brown clay on wet tip.

## 5. Geological Observations/Interpretation

A layer of sandy sediment overlies the natural residual clays. In the test locations, the ground materials consist of ~0.9m of sand over residual firm to stiff clay. The sandy clays merge into the underlying weathered rock at depths of between ~1.5m and ~1.8m below the current

ground surface. The weathered zone is interpreted to be Extremely Low Strength Shale. See Type Section attached for a diagrammatical representation of the expected ground materials.

## 6. Groundwater

Normal ground water seepage is expected to move over the buried surface of the clay and rock underlying the sand. Due to the slope and elevation of the block, the water table is expected to be many metres below the base of the proposed works.

## 7. Surface Water

No evidence of significant surface flows were observed on the property during the inspection. Normal sheet wash from the slope above will be intercepted by the street drainage system for Whale Beach Road above.

## 8. Geotechnical Hazards and Risk Analysis

No geotechnical hazards were observed beside the property. The gentle to moderately graded slope that falls across the property and continues above and below is a potential hazard (**Hazard One**). The proposed excavation for the carport is a potential hazard until retaining walls are in place (**Hazard Two**).

**RISK ANALYSIS ON THE NEXT PAGE**

## Risk Analysis Summary

HAZARDS	Hazard One	Hazard Two
TYPE	The gentle to moderate slope that falls across the property and continues above and below failing and impacting on the proposed works.	The excavation (up to a maximum depth of ~1.6m) collapsing onto the work site before retaining walls are in place.
LIKELIHOOD	'Unlikely' ( $10^{-4}$ )	'Possible' ( $10^{-3}$ )
CONSEQUENCES TO PROPERTY	'Medium' (12%)	'Medium' (15%)
RISK TO PROPERTY	'Low' ( $2 \times 10^{-5}$ )	'Moderate' ( $2 \times 10^{-4}$ )
RISK TO LIFE	$8.3 \times 10^{-7}$ /annum	$8.3 \times 10^{-6}$ /annum
COMMENTS	This level of risk is 'ACCEPTABLE'.	This level of risk to life and property is 'UNACCEPTABLE'. To move risk to 'ACCEPTABLE' levels, the recommendations in <b>Section 13 and 14</b> are to be followed.

(See Aust. Geomech. Jnl. Mar 2007 Vol. 42 No 1, for full explanation of terms)

## 9. Suitability of the Proposed Development for the Site

The proposed development is suitable for the site. No geotechnical hazards will be created by the completion of the proposed development provided it is carried out in accordance with the requirements of this report and good engineering and building practice.

## 10. Stormwater

The fall is away from the street. The stormwater engineer is to refer to council stormwater policy for suitable options for stormwater disposal.

## 11. Excavations

An excavation to a maximum depth of ~1.6m is required to construct the proposed carport and storage room.

The excavations are expected to be through a layer of sandy sediment approximately ~0.9m in extent over clay with Extremely Low Strength Shale expected at depths of between ~1.5m and ~1.8m. It is envisaged that excavations through soil, sand, clay, and Extremely Low Strength Shale can be carried out with an excavator and bucket.

## 12. Vibrations

No excessive vibrations will be generated by excavation through soil, sand, clay, and Extremely Low Strength Shale. Any vibrations generated by a domestic machine and bucket up to 16 ton carrying out excavation works will be below the threshold limit for infrastructure or building damage.

## 13. Excavation Support Advice

The excavations for the proposed carport and storage room will reach a maximum depth of 1.6m. Allowing for 0.5m of back wall drainage, the setbacks are as follows:

- ~1.0m from the S common boundary.
- ~1.9m from the N common boundary.

As such both the N and S common boundaries will lie within the zone of influence of the proposed excavation. In this instance, the zone of influence is the area above a theoretical 45° line through clay and shale from the base of the excavation towards the surrounding structures and boundaries. This line reduces to 30° through the fill, soil, and sand.

Where room permits, the upper ~1.0m of the excavation faces are expected to stand temporarily at batter angles of 30° (1.0 Vertical to 1.7 Horizontal). Where there is not room for these batters, such as along the S side of the excavation, the excavation through soil and sand will need to be temporarily or permanently supported prior to the commencement of excavation, or during the excavation process in a staged manner, so cut batters are not left unsupported. The support will need to be designed / approved by the structural engineer. See the site plan attached for the minimum extent of the required shoring.



The geotechnical consultant is to inspect the early stages of the excavation, while the machine/excavation equipment is on site, to ensure the ground materials are as expected and no additional temporary support is required.

Upslope runoff is to be diverted from the cut faces by sandbag mounds or other diversion works. Unsupported cut batters through soil, sand, and clay are to be covered to prevent access of water in wet weather and loss of moisture in dry weather. The covers are to be tied down with metal pegs or other suitable fixtures so they can't blow off in a storm. The materials and labour to construct the retaining walls are to be organised so on completion of the excavation they can be constructed as soon as possible. The excavation is to be carried out during a dry period. No excavations are to commence if heavy or prolonged rainfall is forecast.

All excavation spoil is to be removed from site following the current Environmental Protection Agency (EPA) waste classification guidelines.

## 14. Retaining Walls

For cantilever or singly-propped retaining walls, it is suggested the design be based on a triangular pressure distribution of lateral pressures using the parameters shown in Table 1.

**Table 1 – Likely Earth Pressures for Retaining Walls**

Unit	Earth Pressure Coefficients		
	Unit weight (kN/m <sup>3</sup> )	'Active' K <sub>a</sub>	'At Rest' K <sub>0</sub>
Soil, sand, and Residual Clays	20	0.35	0.45
Extremely Low Strength Shale	22	0.3	0.25

For rock classes refer to Pells et al "Design Loadings for Foundations on Shale and Sandstone in the Sydney Region". Australian Geomechanics Journal 1978.

It is to be noted that the earth pressures in Table 1 assume a level surface above the structure, do not account for any surcharge loads, and assume retaining walls are fully drained. Rock

strength and relevant earth pressure coefficients are to be confirmed on site by the geotechnical consultant.

All retaining walls are to have sufficient back-wall drainage and be backfilled immediately behind the structure with free-draining material (such as gravel). This material is to be wrapped in a non-woven Geotextile fabric (i.e., Bidim A34 or similar), to prevent the drainage from becoming clogged with silt and clay. If no back-wall drainage is installed in retaining walls, the likely hydrostatic pressures are to be accounted for in the structural design.

## **15. Foundations**

The proposed carport and storage area can be supported on a thickened edge / raft slab with piers taken to Extremely Low Strength Shale where necessary. It is expected to be exposed across the uphill side of the proposed excavation. Where it is not exposed, and where weathered rock drops away with the slope, piers will be required to maintain a uniform foundation material across the structure.

Due to the likely presence of higher groundwater levels running over the top of the clay, the proposed extension, pool, and granny flat are to be supported on piers taken to the underlying Extremely Low Strength Shale.

This material is expected at depths of between 1.5m to 1.8m below the current surface in the area of the proposed works.

A maximum allowable bearing pressure of 600kPa can be assumed for footings on Extremely Low Strength Shale. It should be noted that this material is a soft rock and a rock auger will cut through it so the builders should not be looking for refusal to end the footings.

As the bearing capacity of clay and shale reduces when it is wet, we recommend the footings be dug, inspected, and poured in quick succession (ideally the same day if possible). If the footings get wet, they will have to be drained and the soft layer of wet clay or shale on the footing surface will have to be removed before concrete is poured.

If a rapid turnaround from footing excavation to the concrete pour is not possible, a sealing layer of concrete may be added to the footing surface after it has been cleaned.

**NOTE:** If the contractor is unsure of the footing material required, it is more cost-effective to get the geotechnical consultant on site at the start of the footing excavation to advise on footing depth and material. This mostly prevents unnecessary over-excavation in clay-like shaly-rock but can be valuable in all types of geology.

## 16. Geotechnical Review

The structural plans are to be checked and certified by the geotechnical engineer as being in accordance with the geotechnical recommendations. On completion, a Form 2B will be issued. This form is required for the Construction Certificate to proceed.

## 17. Inspections

The client and builder are to familiarise themselves with the following required inspections as well as council geotechnical policy. We cannot provide geotechnical certification for the owners and Occupation Certificate if the following inspections have not been carried out during the construction process.

- The geotechnical consultant is to inspect the early stages of the excavation progress while the machine/excavation equipment is on site, to ensure the ground materials are as expected and no additional temporary support is required.
- All footings are to be inspected and approved by the geotechnical consultant while the excavation equipment and contractors are still onsite and before steel reinforcing is placed or concrete is poured.

White Geotechnical Group Pty Ltd.



Ben White M.Sc. Geol.,  
AusIMM., CP GEOL.  
No. 222757  
Engineering Geologist.





Photo 1



Photo 2





Photo 3



Photo 4





Photo 5

## Important Information about Your Report

It should be noted that Geotechnical Reports are documents that build a picture of the subsurface conditions from the observation of surface features and testing carried out at specific points on the site. The spacing and location of the test points can be limited by the location of existing structures on the site or by budget and time constraints of the client. Additionally, the test themselves, although chosen for their suitability for the particular project, have their own limiting factors. The testing gives accurate information at the location of the test, within the confines of the test's capability. A geological interpretation or model is developed by joining these test points using all available data and drawing on previous experience of the geotechnical consultant. Even the most experienced practitioners cannot determine every possible feature or change that may lie below the earth. All of the subsurface features can only be known when they are revealed by excavation. As such, a Geotechnical report can be considered an interpretive document. It is based on factual data but also on opinion and judgement that comes with a level of uncertainty. This information is provided to help explain the nature and limitations of your report.

With this in mind, the following points are to be noted:

- If upon the commencement of the works the subsurface ground or ground water conditions prove different from those described in this report, it is advisable to contact White Geotechnical Group immediately, as problems relating to the ground works phase of construction are far easier and less costly to overcome if they are addressed early.
- If this report is used by other professionals during the design or construction process, any questions should be directed to White Geotechnical Group as only we understand the full methodology behind the report's conclusions.
- The report addresses issues relating to your specific design and site. If the proposed project design changes, aspects of the report may no longer apply. Contact White Geotechnical if this occurs.
- This report should not be applied to any other project other than that outlined in section 1.0.
- This report is to be read in full and should not have sections removed or included in other documents as this can result in misinterpretation of the data by others.
- It is common for the design and construction process to be adapted as it progresses (sometimes to suit the previous experience of the contractors involved). If alternative design and construction processes are required to those described in this report, contact White Geotechnical Group. We are familiar with a variety of techniques to reduce risk and can advise if your proposed methods are suitable for the site conditions.

Chamberlain  
58 Whale Beach Road, Avalon Beach - LOT 106 DP 17189  
markham-lee architecture






# TYPE SECTION – Diagrammatical Interpretation of expected Ground Materials

## Expected Ground Materials

- Fill
- Topsoil
- Sand – Loose to Medium Dense
- Clay – Firm to Stiff
- Narrabeen Group Rocks – Extremely Low Strength Shale - *after being cut up by excavation equipment can resemble a stiff to hard clay.*

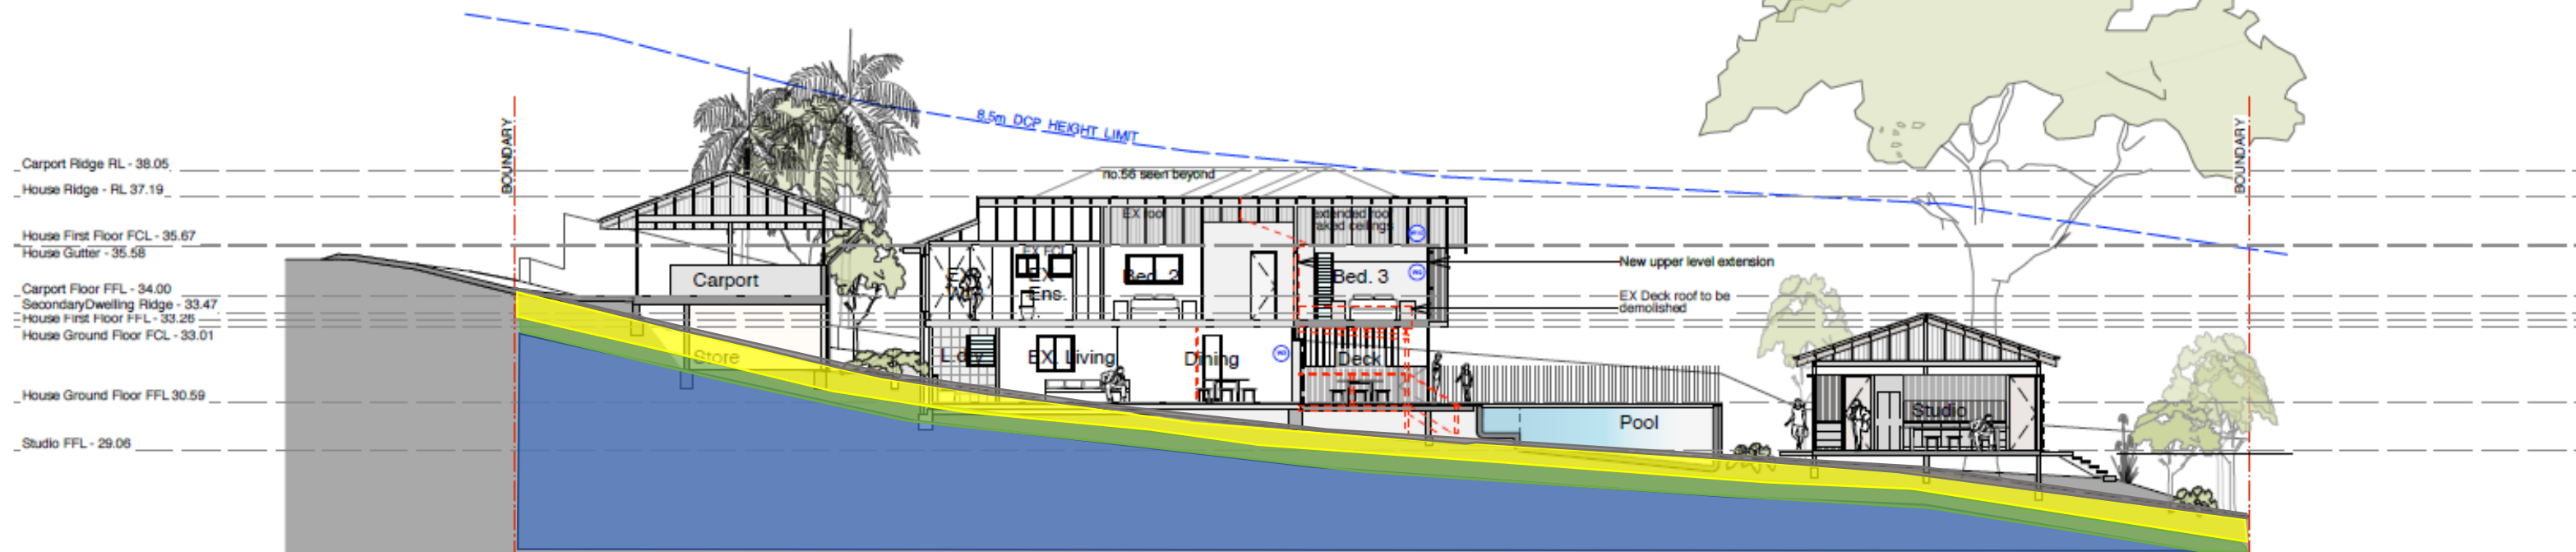

### KEY

EX  
CONC  
MRS  
PC  
M  
LWC  
TIM  
TS  
FG  
OB

Existing  
Concrete  
Metal roof sheeting  
Polycarbonate  
Rendered masonry  
Lightweight cladding  
Timber  
Timber Screen  
Fixed glazing  
Obscure glass

SS  
NGL  
TO  
PP  
WM  
BAL  
PF  
R  
MB  
GM

Sandstone  
Natural ground Level  
Top of wall  
Power pole  
Washing Machine  
Balustrade  
Pool Fence  
Robe  
Meter board (elec)  
Gas meter

DP  
FS  
L  
RWT  
w/a  
w/b

Downpipe  
Flyscreen  
Louvers  
Rainwater Tank  
Window above  
Window below

### WALL TYPE KEY

- Existing Walls
- New walls
- Existing to demolish

Chamberlain

58 Whale Beach Road, Avalon Beach - LOT 106 DP 17189

markham-lee architecture

## DA 07 - Section AA

Do not scale from drawings. Verify all dimensions and levels on site.  
All drawings must be verified by the structural engineer's documents.  
All drawings to be verified by the Survey Plan.  
The architect retains the copyright subsisting in these documents.  
NOT for Construction or Tender

1:200 @ A3

07.07.22

# EXAMPLES OF **GOOD** HILLSIDE PRACTICE



# EXAMPLES OF **POOR** HILLSIDE PRACTICE

